

Appendix

i. Scope of Existing Condition Survey

Goody, Clancy & Associates - Architecture, Planning & Preservation

Task 1 Review all existing drawings and identify missing plans, elevations and details necessary to represent the building as it exists today.

2 Make field trips to check existing drawings for accuracy and to identify missing features

3 Make field trips to examine the building exterior and interior and note condition of materials. Note significant historical features and details and condition of same.

Product 1 Provide building plans, elevations, sections and relevant interior elevations in AutoCAD. Add new handicap ramp and elevator to drawings.

2 Produce existing conditions narrative (to be included in the Final Building Study document) with discussion of historical elements and make recommendations for repair or replacement of building shell components

3 Assemble final conditions report

SEI Companies - HVAC, Electrical

Task 1 Field investigation of the P&FCB to identify all Mechanical & Electrical systems.

2 Review of the 1978 addition to confirm accuracy of the existing drawings and to confirm interconnects with the P&FCB.

3 Field investigation for the site interconnections with the Superior Court and Commissioners Building and understand those systems.

Product 1 Preparation of diagrammatic Mechanical and Electrical floor plans for P&FCB.

2 Preparation of systems diagrams for the site Mechanical and Electrical interconnections.

3 Preparation of report.

Lim Consultants - Structural

Task 1 Review existing structural drawings and existing conditions narrative

2 Scope under review at DCAM 9/23/05

Product 1 Provide written description of findings. Comment on potential need for seismic upgrade.

Judith Nitsch Engineering

- Task**
- 1 Review Existing Condition Site Survey
 - 2 Make field trip to verify site features. Collect any existing records of facilities and meet with building maintenance staff.
 - 3 Research and review existing site and utility plans
- Product**
- 1 Provide written description identifying any lacking information for further investigation

DMC Engineering

- Task**
- 1 Field investigation of the P&FCB to identify all Plumbing & Fire Protection systems.
 - 2 Review of the 1978 addition to confirm accuracy of the existing drawings and to confirm interconnects with the P&FCB.
 - 3 Field investigation for the site interconnections with the Superior Court and Commissioners Building and understand those systems.
- Product**
- 1 Preparation of diagrammatic Plumbing & Fire Protection floor plans for P&FCB.
 - 2 Preparation of systems diagrams for the site Plumbing & Fire Protection interconnections.
 - 3 Preparation of report.

Appendix

ii. Structural Investigation location drawings

Appendix

iii. Room Inventory & Inspection; Window Inventory & Inspection; Architectural Photos and Annotated Drawings

SALEM TRIAL COURT
EXISTING CONDITION SURVEY - Room Inventory & Inspection

Goody Clancy Project Number 6290

Condition Rating:

**Good/Minor Repair
Major Repair**

Total Replacement

Date:

Surveyor

Floor materials: CP Carpet, WD wood, TT terrazzo, MB marble, C concrete
Wall materials: WP wood panel, PL plaster, GWB gyp wall bd, MB marble, AT acoustic tile
Base materials: MW marble below wood, TW terrazzo below wood, MB marble, TZ terrazzo
Ceiling materials: PL plaster, AT acoustic tile, SAT suspended acoustic tile, WB wall board
Trim materials: Wp wood painted, Wv wood verdigris stain, Ws wood stain

SALEM TRIAL COURT
EXISTING CONDITION SURVEY - Room Inventory & Inspection
Goody Clancy Project Number 6290

Condition Rating:

- 1 Good/Minor Repair
- 2 Major Repair
- 3 Total Replacement

Date:

Surveyor:

Room No.	Floor	Walls	Ceiling	Wainscot	Misc.	Comments							
						Finish	Condition	Height	Finish	Condition	Height	Base	Comments
1-8	VCT	1	W	PL	1				Wp	TWP			Wp trim at top of wall, few inches bel ceiling line
		N	PL	1					Wp	TWP			Wp chair rail blends into window apron
	S	PL	1						Wp	TWP			
	E	PL	1						Wp	TWP			
	S	PL	1						Wp	TWP			
	E	PL	1						Wp	TWP			
	N	PL	1						Wp	TWP			
	S	PL	1						Wp	TWP			
	E	PL	1						Wp	TWP			
1-9	VCT	1	W	PL	1	SAT	1		Wp	TWP			Wp trim at top of wall, few inches bel ceiling line
	N	*WP	1						Wp	TWP			Wp chair rail blends into window apron
	S	PL	1						Wp	TWP			
	E	PL	1						Wp	TWP			
	MB	1	W	PL	1	*PL	1		Wp	TWP			
1-11	MB	1	N						MB	1	42"	MB	* high quality oak millwork bet.columns/natural finish;
	S	PL	1						MB	1	42"	MB	Horiz crack @ MB col halfwy up - NE corner col.
	E	PL	1						MB	1	42"	MB	Vert jt open'g @ col @ stair up to 2nd fl. (Both sides of wall)
	MB	1	N						MB	1	42"	MB	*coffered ceiling
1-12									S				REVIEW PENDING
									E				
									W				

SALEM TRIAL COURT
EXISTING CONDITION SURVEY - Room Inventory & Inspection
 Goody Clancy Project Number 6290

Condition Rating:

- 1 Good/Minor Repair
- 2 Major Repair
- 3 Total Replacement

Date:

Surveyor:

Floor materials: CP Carpet, WD wood, TT terrazzo, MB marble, C concrete
 Wall materials: WP wood panel, PL plaster, GWB gypsum wall bd, MB marble, AT acoustic tile
 Base materials: MW marble below wood, TW terrazzo below wood, MB marble, TZ terrazzo
 Ceiling materials: PL plaster, AT acoustic tile, SAT suspended acoustic tile, WB wall board
 Trim materials: Wp wood painted, Wv wood verdigris stain, Ws wood staine

Room No.	Orientation	Condition	Finish	Height	Condition	Finish	Height	Condition	Finish	Height	Comments	Misc.	
1-13 VCT 1	N	PL	1			TWP						*plaster crazing and holes	
	S	PL	*2			TWP							
	E	PL	1			TWP							
	V	W	PL	*	PL	1						*plaster crazing and holes	
1-14 CP 1	N	PL	1			Wp						Wp trim at top of wall, few inches bel ceiling line	
	S	PL	1			Wp						Wp chair rail blends into window apron	
	E	PL	1			Wp							
	W	PL	1			Wp						*cracking- minor repairs needed	
1-14A TT 1	N	PL	1									*MB toilet stall w/ WP door - excellent condition	
	S	PL	1									*Cast-iron radiator bel. Window	
	E	PL	1										
1-15 VCT 1	W	PL	1	PL	*1.5							Wp trim at top of wall, few inches bel ceiling line	
	N	PL	1									Wp chair rail blends into window apron	
	S	PL	1										
	E	PL	1										
	W	PL	1	SAT	1	8 ft						*Slight water damage	

SALEM TRIAL COURT
EXISTING CONDITION SURVEY - Room Inventory & Inspection

Goody Clancy Project Number 6290

Condition Rating:

- 1 Good/Minor Repair
- 2 Major Repair
- 3 Total Replacement

Date:

Surveyor:

Floor materials: CP Carpet, WD wood, TT terrazzo, MB marble, C concrete
 Wall materials: WP wood panel, PL plaster, GWB gyp wall bd, MB marble, AT acoustic tile
 Base materials: MW marble below wood, TW terrazzo below wood, MB marble, TZ terrazzo
 Ceiling materials: PL plaster, AT acoustic tile, SAT suspended acoustic tile, WB wall board
 Trim materials: Wp wood painted, Wv wood verdigris stain, Ws wood stain

Room No.	Floor	Walls	Ceiling	Wainscot	Misc.	Comments	
						Height	Condition
1-16	VCT	1	W	PL	1	PL	1
		N	PL	1		Wp	TWp
	S	PL	1			Wp	TWp
	E	PL	1			Wp	TWp
	N	PL	1			Wp	TWp
	S	PL	1			Wv	TWv
	E	PL	1			Wv	TWv
1-17	TT	1	W	PL	1	SAT	2 11.75'
	N	PL	1			Wp	
	S	PL	1			Wp	
	E	PL	1			Wp	
	W	PL	1			Wp	
	N	AT	1			Wp	TWp
	S	AT	1			Wp	TWp
	E	AT	1			Wp	TWp
1-19	TT	*W	AT	1	AT	2	
						Wp	TWp

*Box bm bel ceiling; 10.58' to underside of bm.

WP chair rail blends into window apron

AT glued to PL walls & ceiling; no AT bel chair rail.

WP trim at top of wall, few inches bel ceiling line

WP chair rail blends into window apron

WP trim at top of wall, few inches bel ceiling line

WP chair rail blends into window apron

WP trim at top of wall, few inches bel ceiling line

WP chair rail blends into window apron

WP trim at top of wall, few inches bel ceiling line

WP chair rail blends into window apron

WP trim at top of wall, few inches bel ceiling line

WP chair rail blends into window apron

WP trim at top of wall, few inches bel ceiling line

WP chair rail blends into window apron

WP trim at top of wall, few inches bel ceiling line

WP chair rail blends into window apron

WP trim at top of wall, few inches bel ceiling line

WP chair rail blends into window apron

WP trim at top of wall, few inches bel ceiling line

WP chair rail blends into window apron

WP trim at top of wall, few inches bel ceiling line

WP chair rail blends into window apron

WP trim at top of wall, few inches bel ceiling line

WP chair rail blends into window apron

WP trim at top of wall, few inches bel ceiling line

WP chair rail blends into window apron

SALEM TRIAL COURT
EXISTING CONDITION SURVEY - Room Inventory & Inspection
 Goody Clancy Project Number 6290

Condition Rating:

- 1 Good/Minor Repair
- 2 Major Repair
- 3 Total Replacement

Date:

Surveyor:

Floor materials: CP Carpet, WD wood, TT terrazzo, MB marble, C concrete

Wall materials: WP wood panel, PL plaster, GWB gypsum wall bd, MB marble, AT acoustic tile

Base materials: MW marble below wood, TW terrazzo below wood, MB marble, TZ terrazzo

Ceiling materials: PL plaster, AT acoustic tile, SAT suspended acoustic tile, WB wall board

Trim materials: Wp wood painted, Wy wood verdigris stain, Ws wood staine

Room No.	Floor	Walls	Ceiling	Wainscot	Misc.	Comments						
						Finish	Condition	Finish	Height	Condition	Finish	Height
1-20	TT	N PL 1				Wp	TWP	Wp	TWP	Wp trim at top of wall, few inches bel ceiling line		
		S PL 1				Wp	TWP	Wp	TWP	Wp chair rail blends into window apron		
		E PL 1				Wp	TWP	Wp	TWP			
		W PL 1	PL 1	*		Wp	TWP	Wp	TWP	* two ceiling ht's: 11.92' bel landing; 11.67' @ window		
		N PL 1				Wp	TWP	Wp	TWP	Wp trim at top of wall, few inches bel ceiling line		
		S PL 1				Wp	TWP	Wp	TWP	Wp chair rail blends into window apron		
1-21	CP	1 W PL 1	PL 1	11.67'		Wp	TWP	Wp	TWP			
1.5-1	Inner floor ladies room	N PL 1				MB 1	6 ft			Access room from Stair S2 at First Fl.		
		S PL 1				MB 1	6 ft			MB toilet stalls w/ WP doors (typ)		
		E PL 1				MB 1	6 ft					
		W PL 1	PL 1			MB 1	6 ft			yes		
1.5-2	Inner floor lobby	N PL 1				Wv				Access from Stair S5 at Second Fl.		
		S PL 1				Wv						
		E PL 1				Wv *						
		W PL 1	2 *SAT	7.2'		Wv						

SALEM TRIAL COURT

EXISTING CONDITION SURVEY - Room Inventory & Inspection

Goody Clancy Project Number 6290

Condition Rating:

- 1 Good/Minor Repair
- 2 Major Repair
- 3 Total Replacement

Date:

Surveyor:

Floor materials: CP Carpet, WD wood, TT terrazzo, MB marble, C concrete
 Wall materials: WP wood panel, PL plaster, GWB gypsum wall bd, MB marble, AT acoustic tile
 Base materials: MW marble below wood, TW terrazzo below wood, MB marble, TZ terrazzo
 Ceiling materials: PL plaster, AT acoustic tile, SAT suspended acoustic tile, WB wall board
 Trim materials: Wp wood painted, Wv wood verdigris stain, Ws wood staine

Room No.	Orientation	Finish	Condition	Height	Trim	Base	Casework/Built in Furn.	Historic Lighting	Comments	Misc.	
1.5-3 Inner floor mens room	N S E TT	PL 1 1 W PL 1	PL 1 1 PL 1	MB 1 MB 1 MB 1 MB 1	6 ft 6 ft 6 ft 6 ft	Wp Twp Twp Twp	Twp Twp Twp Twp	Access from inner floor lobby			
	S E N S E N	PL 1 PL 1 PL 1 PL 1	PL 1 PL 1 PL 1 PL 1	MB 1 MB 1 MB 1 MB 1 MB 1	6 ft 6 ft 6 ft 6 ft 6 ft 6 ft 6 ft 6 ft	Wp Twp Twp Wp Twp Twp Twp Twp	Wp trim at top of wall, few inches bel ceiling line Wp chair rail blends into window apron Ceiling soffit 14'd x 17" w @ east Ceiling soffit 14'd x 32" w @ west Wp trim at top of wall, few inches bel ceiling line Wp trim at top of wall, few inches bel ceiling line Wp trim at top of wall, few inches bel ceiling line Wp trim at top of wall, few inches bel ceiling line				
1-22 CP 1	W PL 1	PL 1	PL 1	Wp Twp Twp							
	S E N S E N	PL 1 PL 1 PL 1 PL 1	PL 1 PL 1 PL 1 PL 1	MB 1 MB 1 MB 1 MB 1 MB 1	42" 42" 42" 42" 42" 42" 42"	Wp Twp Twp Wp Twp Twp Twp	Ceiling soffit 14'd x 17" w @ east Ceiling soffit 14'd x 32" w @ west MB Pilasters - good condition MB Pilasters - good condition Wide oak trim at ceiling/wall line				
1-22A CP 1	W PL 1	PL 1	PL 1	Wp Twp Twp							
	N S E N S E N	PL 1 PL 1 PL 1 PL 1 PL 1	PL 1 PL 1 PL 1 PL 1 PL 1	MB 1 MB 1 MB 1 MB 1 MB 1 MB 1	42" 42" 42" 42" 42" 42" 42" 42"	Wp Twp Twp Wp Twp Twp Twp Twp	MB Pilasters - good condition MB Pilasters - good condition Wide oak trim at ceiling/wall line				
1-23 MB 1	W PL 1	*PL 1	*PL 1	MB 1	42"	yes	*Coffer ceiling brms/rendered in PL transverse space				

SALEM TRIAL COURT
EXISTING CONDITION SURVEY - Room Inventory & Inspection

Goody Clancy Project Number 6290

Date:

Surveyor:

Condition Rating:

- 1 Good/Minor Repair
- 2 Major Repair
- 3 Total Replacement

Floor materials: CP Carpet, WD wood, TT terrazzo, MB marble, C concrete
 Wall materials: WP wood panel, PL plaster, GWB gypsum wall bd, MB marble, AT acoustic tile
 Base materials: MW marble below wood, TW terrazzo below wood, MB marble, TZ terrazzo
 Ceiling materials: PL plaster, AT acoustic tile, SAT suspended acoustic tile, WB wall board
 Trim materials: Wp wood painted, Wv wood verdigris stain, Ws wood staine

Room No.	Finish	Orientation	Condition	Finish	Height	Condition	Misc.	Comments	Historic Lighting	Cassework/Built in Furn.									
1-24 TT	N PL	1																	
	S PL	1																	
	E PL	1																	
	W PL	1	PL	*3															
	N PL	1																	
	S PL	1																	
	E PL	1																	
1-25A TT	W PL	1	PL	2															
	N PL	1																	
	S WPV	1																	
	E																		
1-26	MB	1	W				PL	1											
	N PL	1																	
	S PL	1																	
	E PL	1																	
S-1	MB	1	W	PL	1	PL	1												
	N PL	1																	
	S PL	1																	
	E PL	1																	
	MB	1	42"				MB	1	42"										
	MB	1	42"				MB	1	42"										
	MB	1	42"				MB	1	42"										
	MB	1	42"				MB	1	42"										

*vert. joint openings @ veneer - both sides of wall @ 1st Fl
 Oak MPV @ openings bet. Pilasters - excellent condition
 Vert jt open'g @ col @ stair up to 2nd fl. (Both sides of wall)
 *Coffer ceiling bms/rendered in PL transverse space
 *vert. joint openings @ veneer - both sides of wall @ 1st Fl
 pilaster adj. to bottom of stair. MB veneer cap at top of
 pilaster adj. to landing loose @ corner; joints opened; this
 occurs also 2nd floor top of pilaster - both sides

SALEM TRIAL COURT
EXISTING CONDITION SURVEY - Room Inventory & Inspection
Goody Clancy Project Number 629n

Goody Clancy Project Number 62290

- | Condition Rating: | 1 | Good/Minor Repair |
|--------------------|--|-------------------|
| | 2 | Major Repair |
| | 3 | Total Replacement |
| Floor materials: | CP Carpet, WD wood, TT terrazzo, MB marble, C concrete | |
| Wall materials: | WP wood panel, PL plaster, GWB gyp wall bd, MB marble, AT acoustic tile | |
| Base materials: | MW marble below wood, TW terrazzo below wood, MB marble, TZ terrazzo | |
| Ceiling materials: | PL plaster, AT acoustic tile, SAT suspended acoustic tile, WB wall board | |
| Trim materials: | WP wood painted, Wv wood verdigris stain, Ws wood stain | |

Surveyor: _____ **Date:** _____

Date:

Surveyor _____ Date: _____

SALEM TRIAL COURT
EXISTING CONDITION SURVEY - Room Inventory & Inspection
Goody Clancy Project Number 6290

Goody Clancy Project Number 6290

Dati

Date: Surveyor:
Floor materials: CP Carpet, WD wood, TT terrazzo, MB marble, C concrete
Wall materials: WP wood panel, PL plaster, GWB gyp wall bd, MB marble, AT acoustic tile
Base materials: MW marble below wood, TW terrazzo below wood, MB marble, TZ terrazzo
Ceiling materials: PL plaster, AT acoustic tile, SAT suspended acoustic tile, WB wall board
Trim materials: W/p wood painted, Wv wood verdigris stain, Ws wood stain

Survivor

Condition Rating:

Goodwill Donor

Good/Major R:

Total Replacement

Room No.	Floor	Walls		Ceiling		Wainscot		Misc.	
		Condition	Orientalion	Condition	Orientalion	Condition	Orientalion	Base	Comments
2-1	VCT	N	PL	1				*PL MWV	* 5-bay coffer, detailed in plaster, excellent condition
		S	PL	1				*PL MWV	* high quality oak millwork bet. columns/verdigris finish
		E	PL	1				*PL MWV	Major PL damage @ ceiling spandrel bms/coffers @ NE corner;
		W	PL	1	*PL 1&2			*PL MWV	and minor PL damage bet ceiling spandrel @ NW corner
2-2	CP	1	W	PL	1	SAT	*1	WP	Pilaster centered @ east wall
			N	PL	1			WP	
			S	PL	1			WP	
			E	PL	1			WP	
2-3	TT	1	W	PL	1	SAT	*1	WP	*new furred SAT ceiling conceals major damage to orig.
			N	PL	1			WP	
			S	PL	1			WP	
			E	PL	1			WP	
2-4	TT	1	W	PL	1	PL	1	WP	
			N	PL	1			WP	
			S	PL	1			WP	
			E	PL	1			WP	

SALEM TRIAL COURT
EXISTING CONDITION SURVEY - Room Inventory & Inspection
Goody Clancy Project Number 6290

Condition Rating:

- 1 Good/Minor Repair
- 2 Major Repair
- 3 Total Replacement

Date:

Surveyor:

Floor materials: CP Carpet, WD wood, TT terrazzo, MB marble, C concrete
 Wall materials: WP wood panel, PL plaster, GWB gypsum wall bd, MB marble, AT acoustic tile
 Base materials: MW marble below wood, TW terrazzo below wood, MB marble, TZ terrazzo
 Ceiling materials: PL plaster, AT acoustic tile, SAT suspended acoustic tile, WB wall board
 Trim materials: Wp wood painted, Wv wood verdigris stain, Ws wood staine

Room No.	Condition @ CP w/ TT	Orientation	Finish	Finish	Ceiling Condition	Ceiling Height	Wainscot Condition	Wainscot Finish	Base Column/Pilaster	Base Height	Chair/Picture Rail Condition	Chair/Picture Rail Finish	Cassework/Built in Furniture	Historic Lighting	Comments	Surveyor:			
2-9	N	PL	1			MB 1 42"	MB			MB	MB					MB toilet stalls w/ WP doors (typ)			
	S	PL	1			MB 1 42"	MB			MB	MB					*new furred SAT ceiling conceals major damage to orig.			
	E	PL	1			MB 1 42"	MB			MB	MB					MB vert. joint openings @ col. veneer adj. to col @ T.O. stair & adj. to stair opening @ corridor. MB veneer cap at top of pilaster adj. to landing loose @ corner; joints opened.			
2-10	W	PL	1	SAT	*	MB 1 42"	MB			MB	MB					PL coffer ceiling bays; *Water damage @ west wall & coffer			
	N	PL	1			MB 1 42"	MB			MB	MB					Wv trim at top of wall, few inches bel ceiling line			
	S	PL	1			MB 1 42"	MB			MB	MB					Wv chair rail; Wv picture rail abv.			
	E	PL	1			MB 1 42"	MB			MB	MB					Top of chair rail 44" AFF; PL pilaster @ west wall;			
2-11	CP	1	W	PL	2	*PL	1			MB	MB					*Coffer ceiling rendered in PL			
		N	PL	1						Wv	Wv								
		S	PL	1						Wv	Wv								
		E	PL	1						Wv	Wv								
2-12			N							Wv	PL	TWv					REVIEW PENDING		

SALEM TRIAL COURT
EXISTING CONDITION SURVEY - Room Inventory & Inspection
Goody Clancy Project Number 6290

Condition Rating:

- 1 Good/Minor Repair
- 2 Major Repair
- 3 Total Replacement

Date:

Surveyor:

Floor materials: CP Carpet, WD wood, TT terrazzo, MB marble, C concrete

Wall materials: WP wood panel, PL plaster, GWP gyp wall bd, MB marble, AT acoustic tile

Base materials: MW marble below wood, TW terrazzo below wood, MB marble, TZ terrazzo

Ceiling materials: PL plaster, AT acoustic tile, SAT suspended acoustic tile, WB wall board

Trim materials: Wp wood painted, Wv wood verdigris stain, Ws wood staine

Room No.	Orientation	Finish	Condition	Height	Finish	Condition	Height	Finish	Condition	Height	Finish	Comments	Misc.				
													Base	Casework/Built in Furn.	Historic Lighting		
2-16.5	TT	N	PL	*2	MB	1	60"										*PL damage at T.O.wall - north
		S	PL	1	MB	1	60"										
		E	PL	1	MB	1	60"										
		1	W	PL	1	PL	1	MB	1	60"							
2-17	VCT	1	W	PL	1												
			N	PL	1												
			S	PL	1												
			E	PL	*1&2												
			2-18	N	PL	1											
				S													
				E													
				W													
2-19	CP	W	PL	1	PL	*1											
				N	PL	1											
				S	PL	1											
				E	PL	1											
				PL	Pliaster	@ west wall											

REVIEW PENDING

*new furred dn PL ceiling conceals major damage to orig.

SALEM TRIAL COURT
EXISTING CONDITION SURVEY - Room Inventory & Inspection
Goody Clancy Project Number 6290

卷之三

Condition Rating:

Good/Minor Re-

Major Repair **Total Replacement**


Data

Cinco años

Date: 2018-01-01 Sui Veyor:

Floor materials: CP Carpet, WD wood, TT terrazzo, MB marble, C concrete
 Wall materials: WP wood panel, PL plaster, GWP gyp wall bd, MB marble, AT acoustic tile
 Base materials: MW marble below wood, TW terrazzo below wood, MB marble, TZ terrazzo
 Ceiling materials: PL plaster, AT acoustic tile, SAT suspended acoustic tile, WB wall board
 Trim materials: Wp wood painted, Wv wood verdigris stain, Ws wood stain

Condition Rating:	1	Good/Minor Repair
Floor materials:	CP Carpet, WD wood, TT terrazzo, MB marble, C concrete	
Wall materials:	WP wood panel, PL plaster, GWB gyp wall bd, MB marble, AT acoustic tile	
Base materials:	MW marble below wood, TW terrazzo below wood, MB marble, TZ terrazzo	
Ceiling materials:	PL plaster, AT acoustic tile, SAT suspended acoustic tile, WB wall board	
Trim materials:	WP wood painted, Wv wood verdigris stain, Ws wood staine	

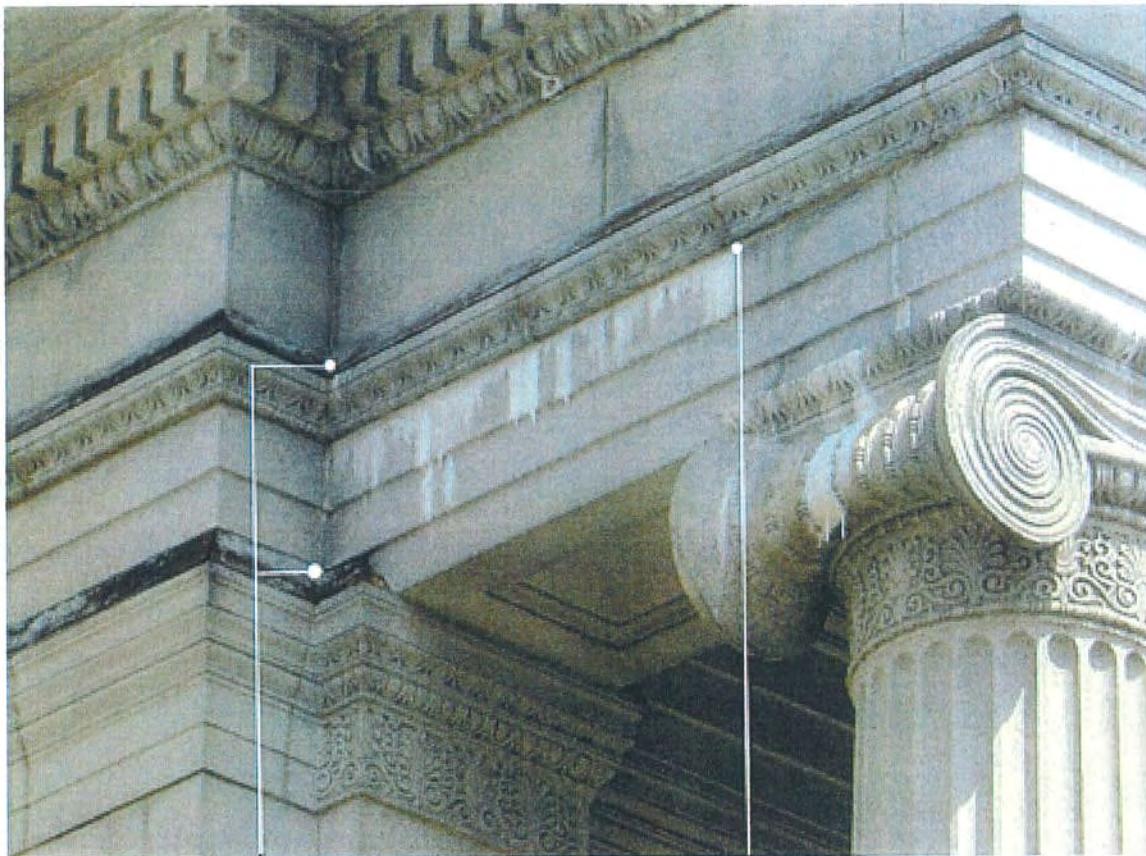

Plywood Bird Proofing

Staining from open mortar joints
above cove

Entablature Southeast Corner

Photo #E-1



Moss and Vegetation
At Joint


Recent Stone
Repair

Open Joints

Structural Anchor

Pediment - North Elevation West Corner

Photo #E-2

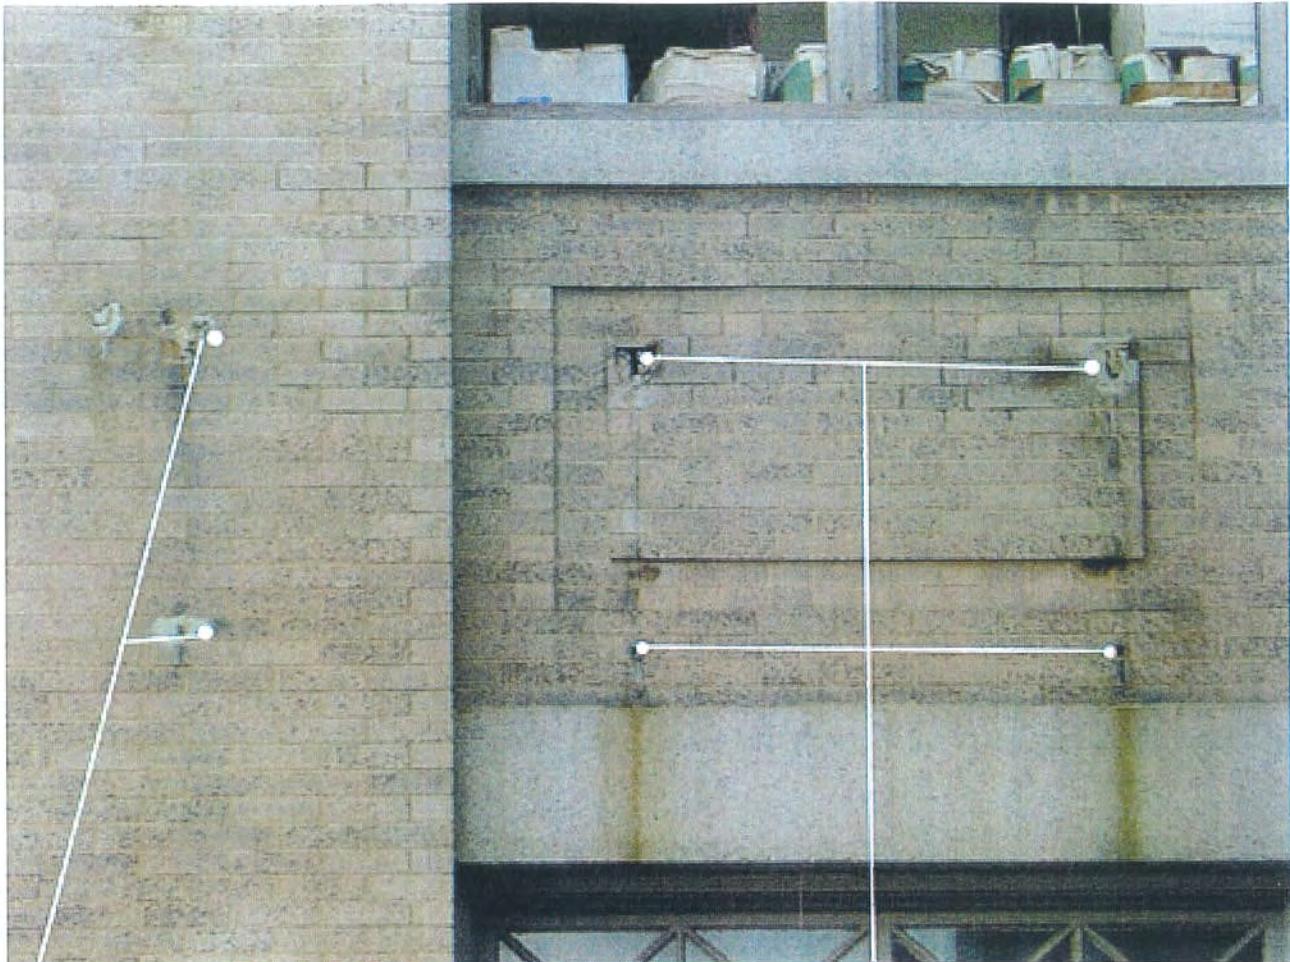


Open Holes from Fire Escape Anchors

Steel Sections Remain from Removal of Fire Escape

Mortar Elevation - East Wing


Photo #E-3

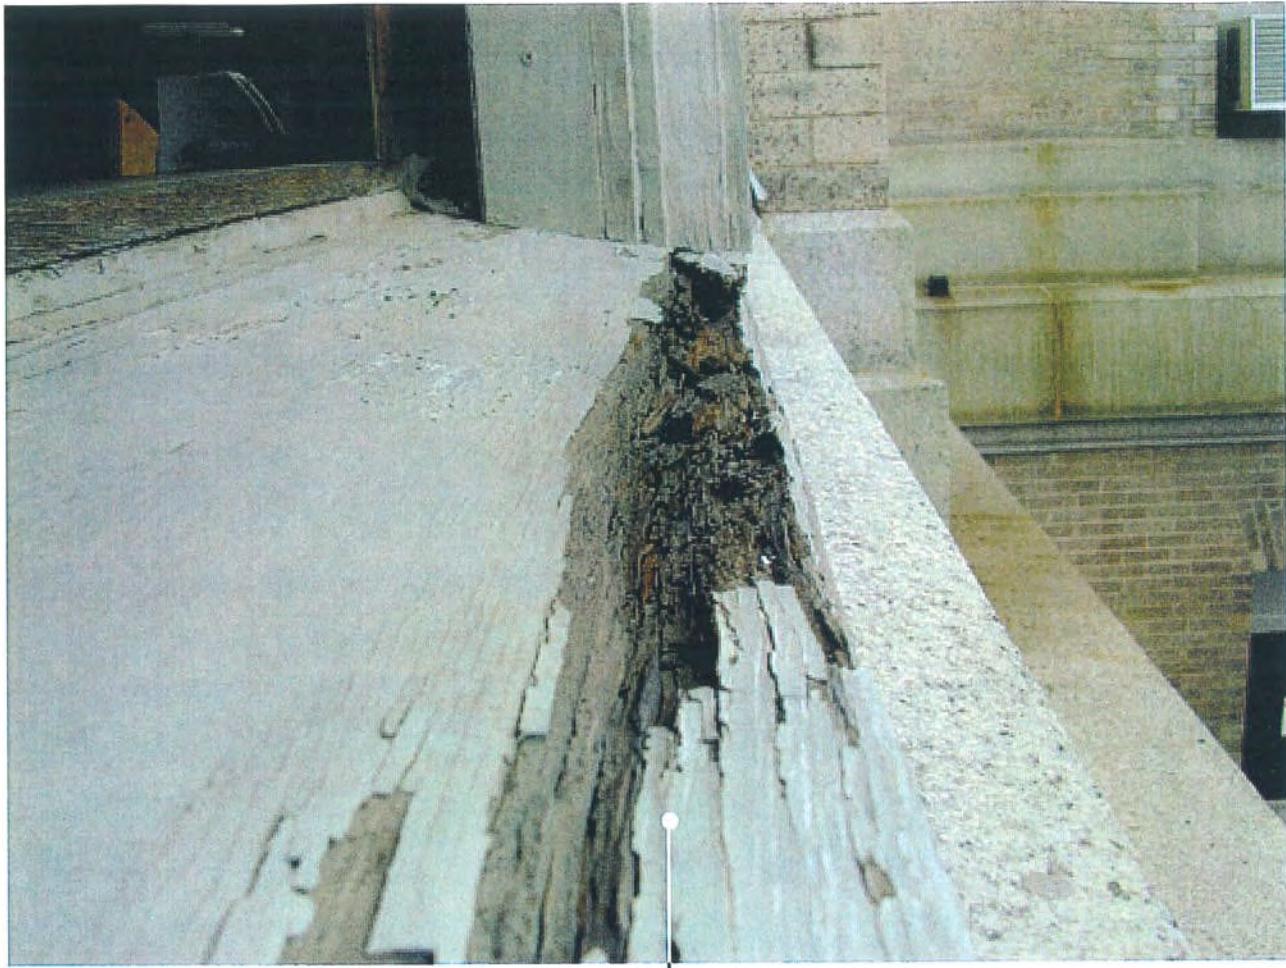

Rotted Sill

North Elevation East Wing - Second Story

Photo #E-4

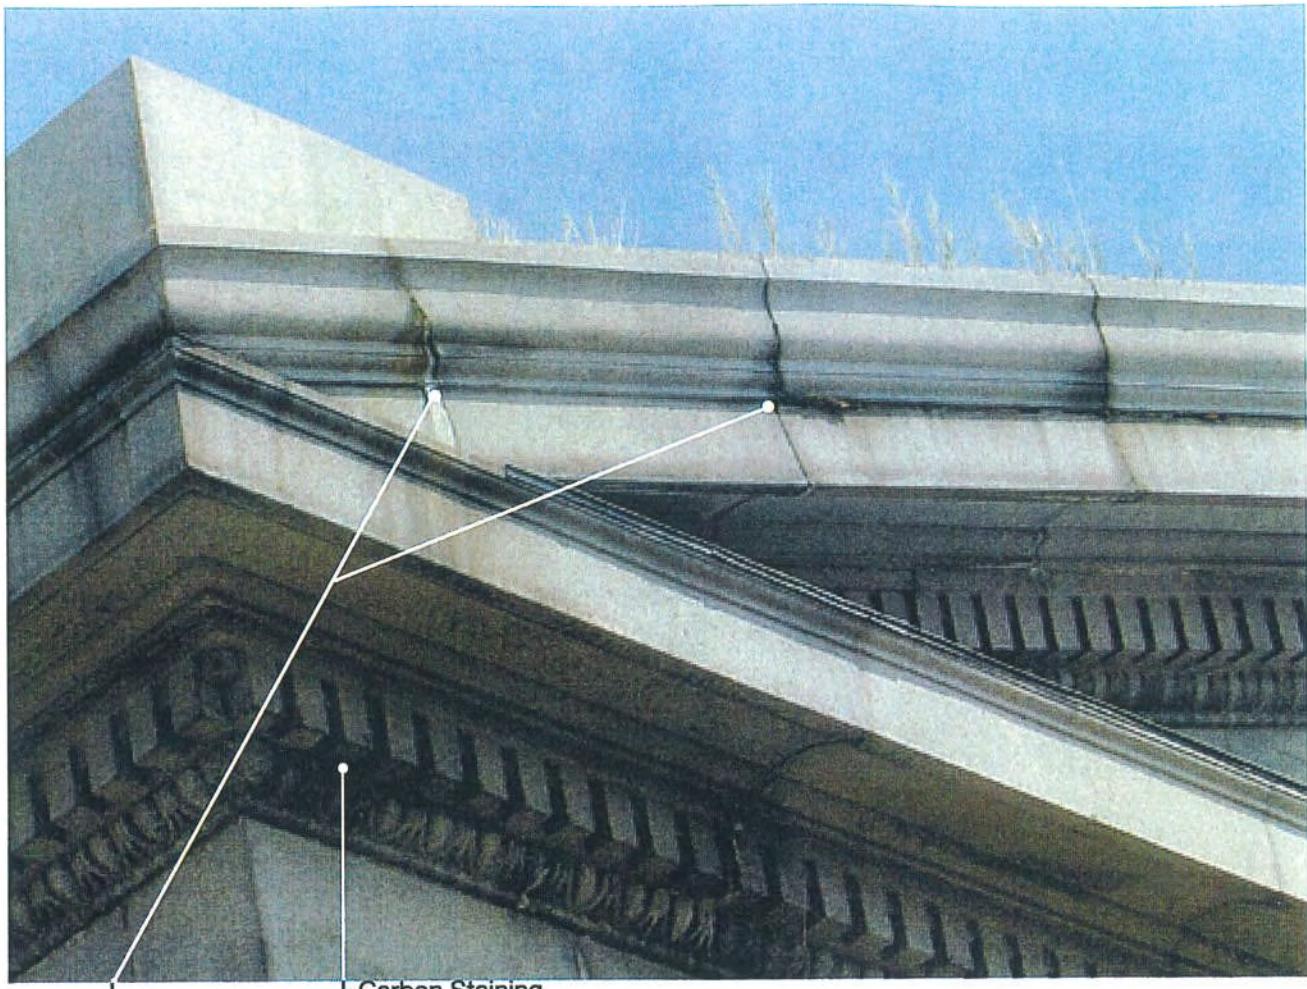


Carbon Staining

Open Mortar Joints. Moss in Joints at bottom cove.
Vegetation in joint at top of cove.

South Elevation Pediment - West Corner

Photo #E-5

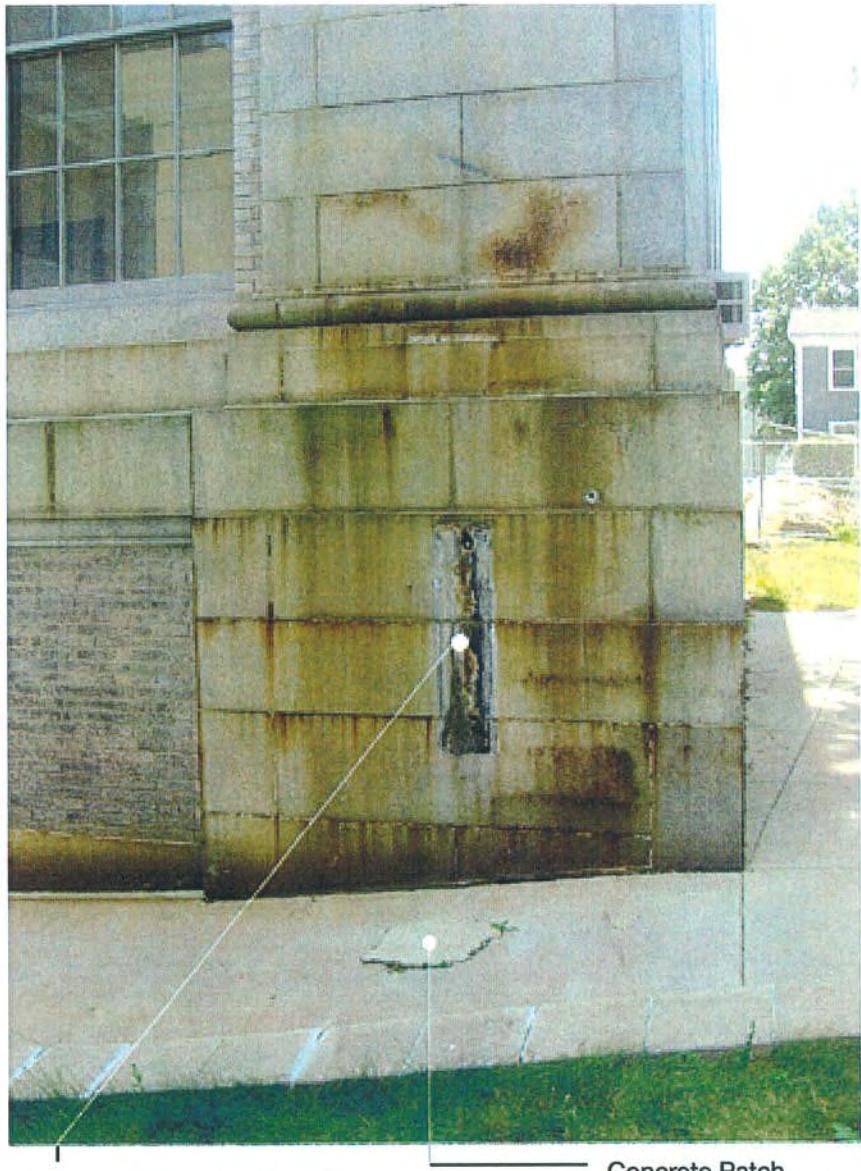


Anchors Support removed
from spiral stair/
fire escape

Concrete Patch
former anchorage for
center pole at
fire escape/spiral stair

North Elevation West Wing

Photo #E-6

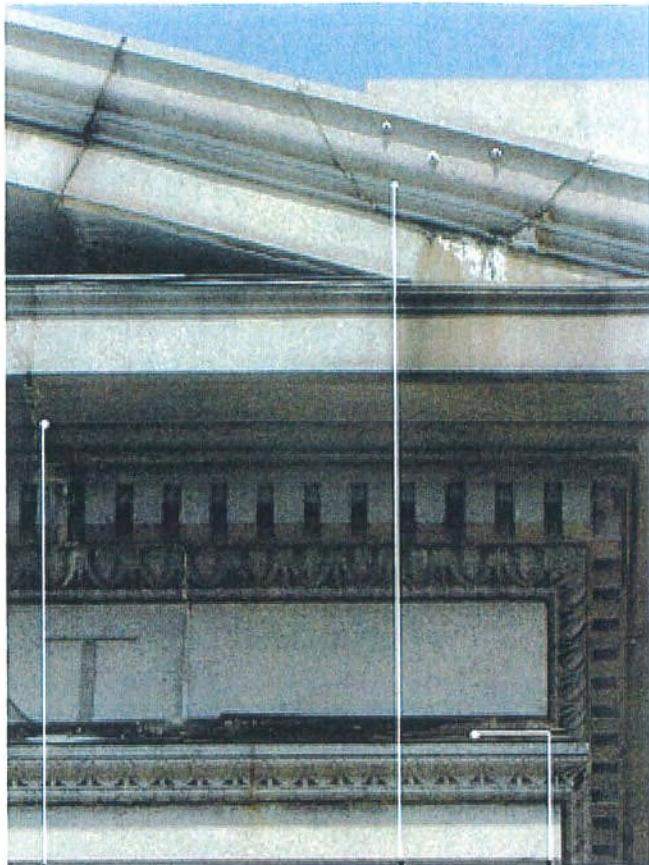


Open Joints

Plywood Birdproofing

Improper Stone Repair

South Elevation Pediment East Corner

Photo #E-7

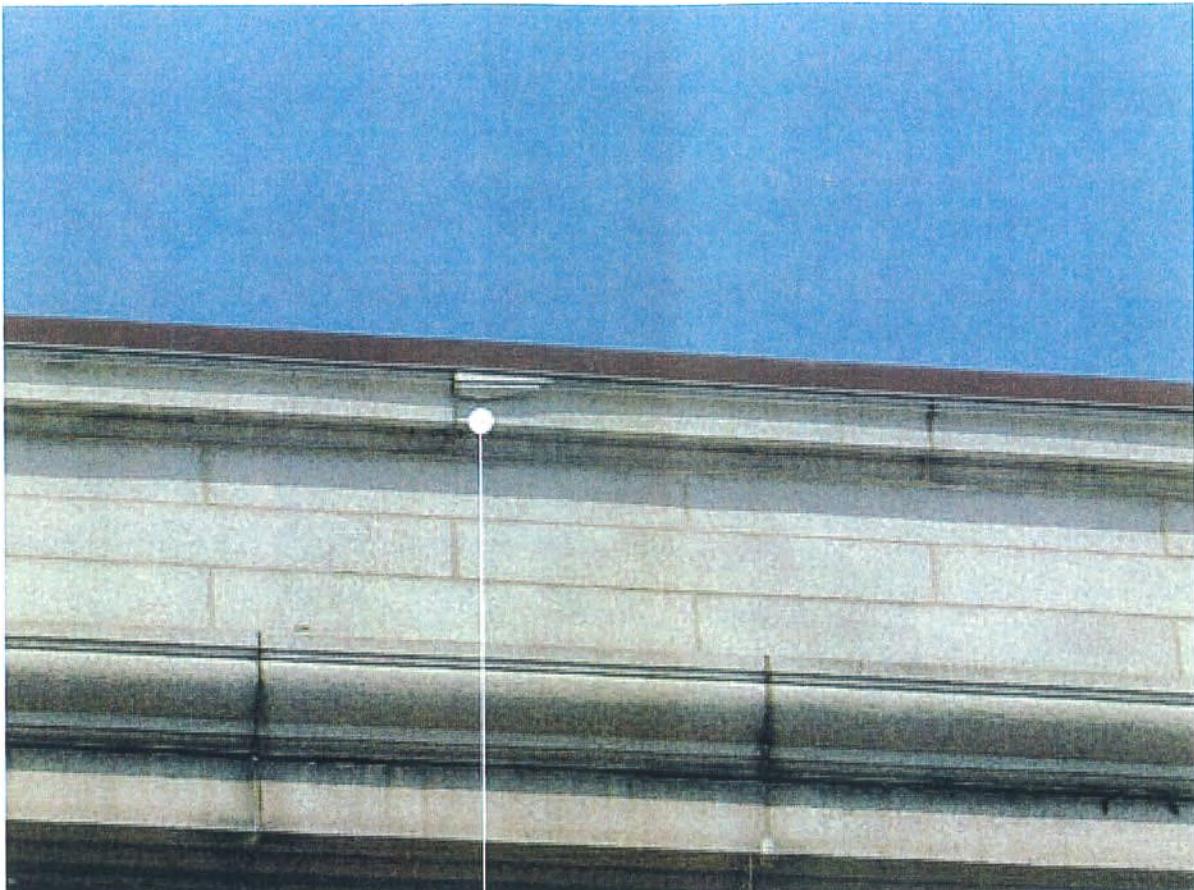

Loose Stone Fragments

Cornice: West Wing South Elevation

Photo #E-8



Missing Medallion

Cast Iron Light Standard

Photo #E-9




Court Room Session 1

Photo #I-1



Registry of Probate File Room

Photo # I-2

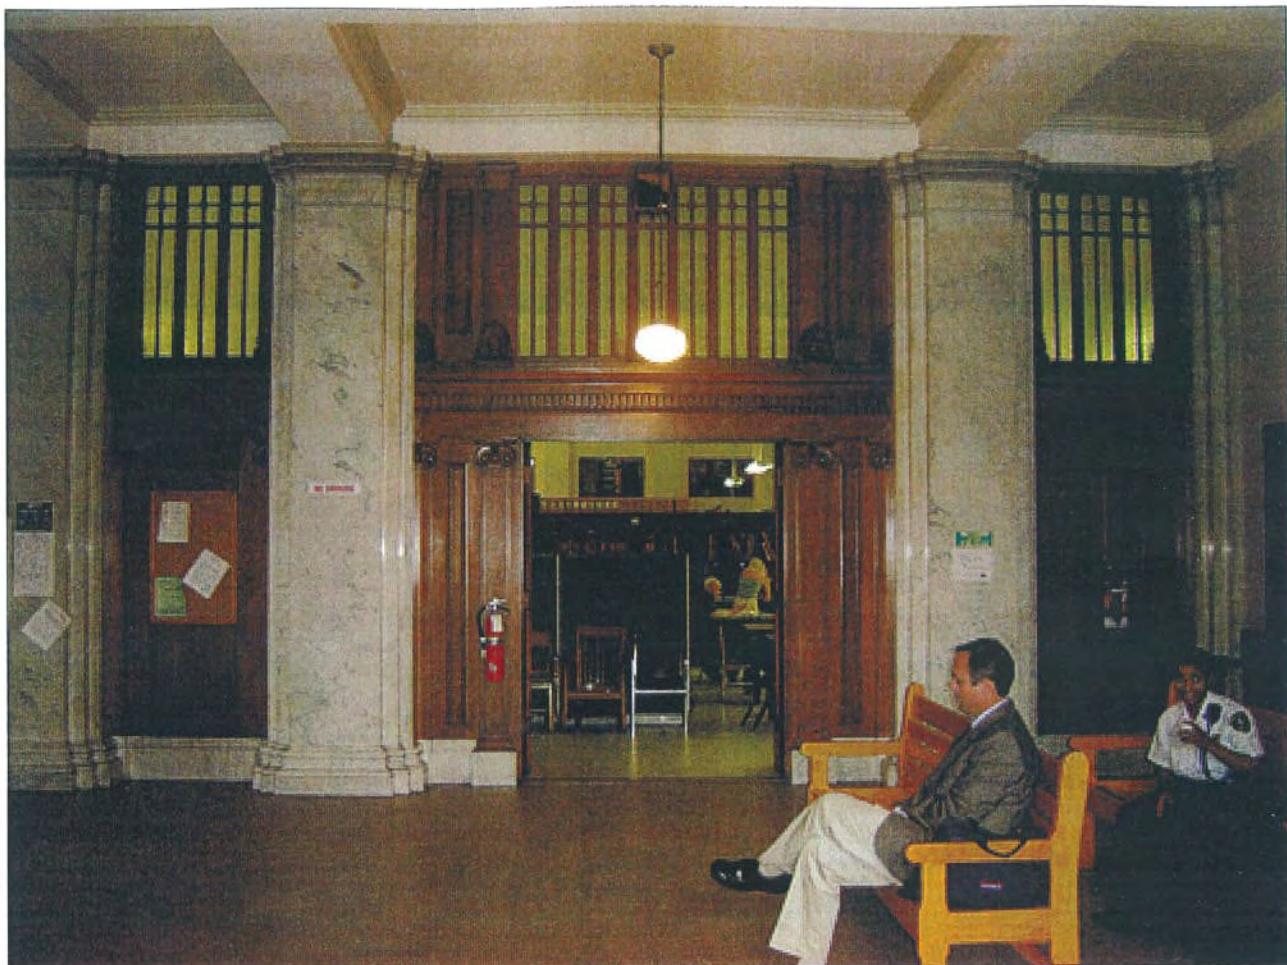


Second Floor Lobby

Photo #I-3



Second Floor Lobby

Photo # I-4

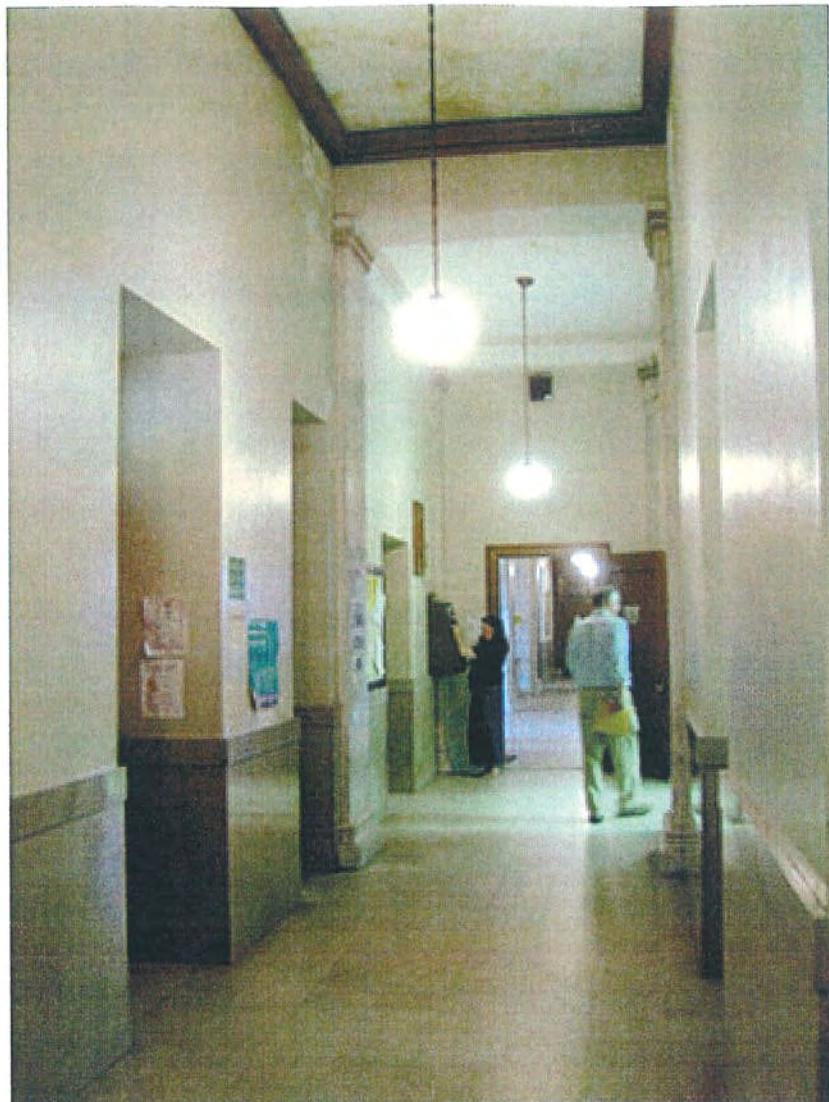


Main Public Corridor

Photo #I-5



Elevator Cage

Photo #I-6

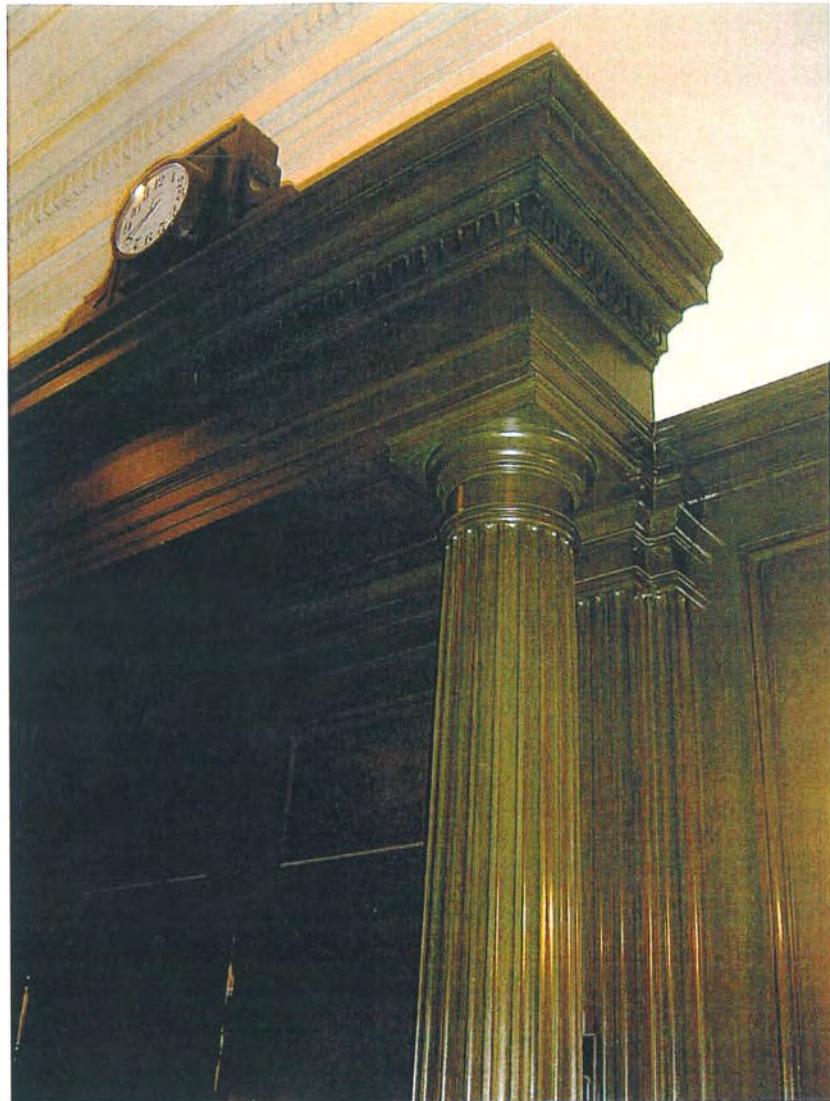


Entry Court Room Session 1

Photo #I-7



Brass Chandelier/Sconce

Photo #1-8

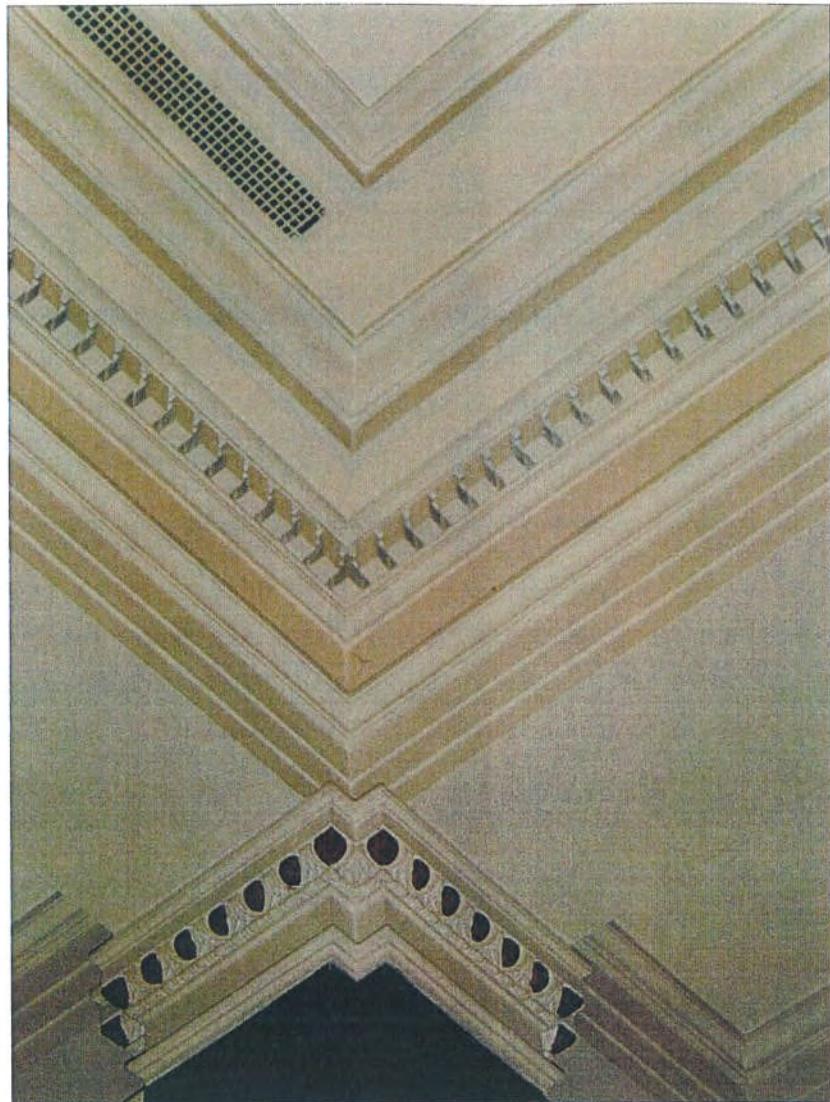

Coffered Plaster Ceiling


Photo #I-9



Water Damage Plaster Ceiling


Second Floor West End Corridor

Photo #I-10

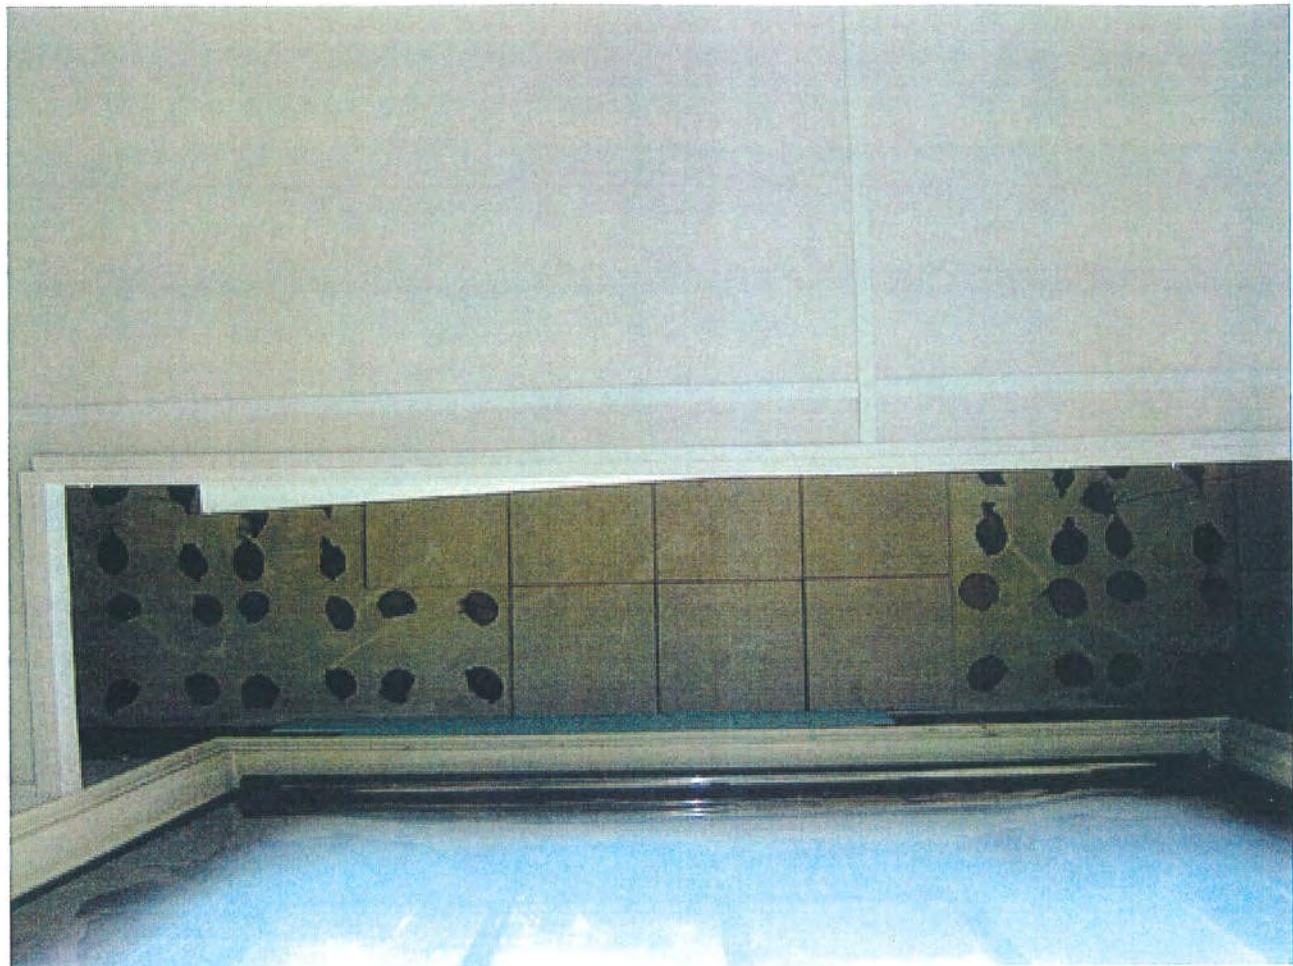

Multiple Ceilings

Photo #I-11

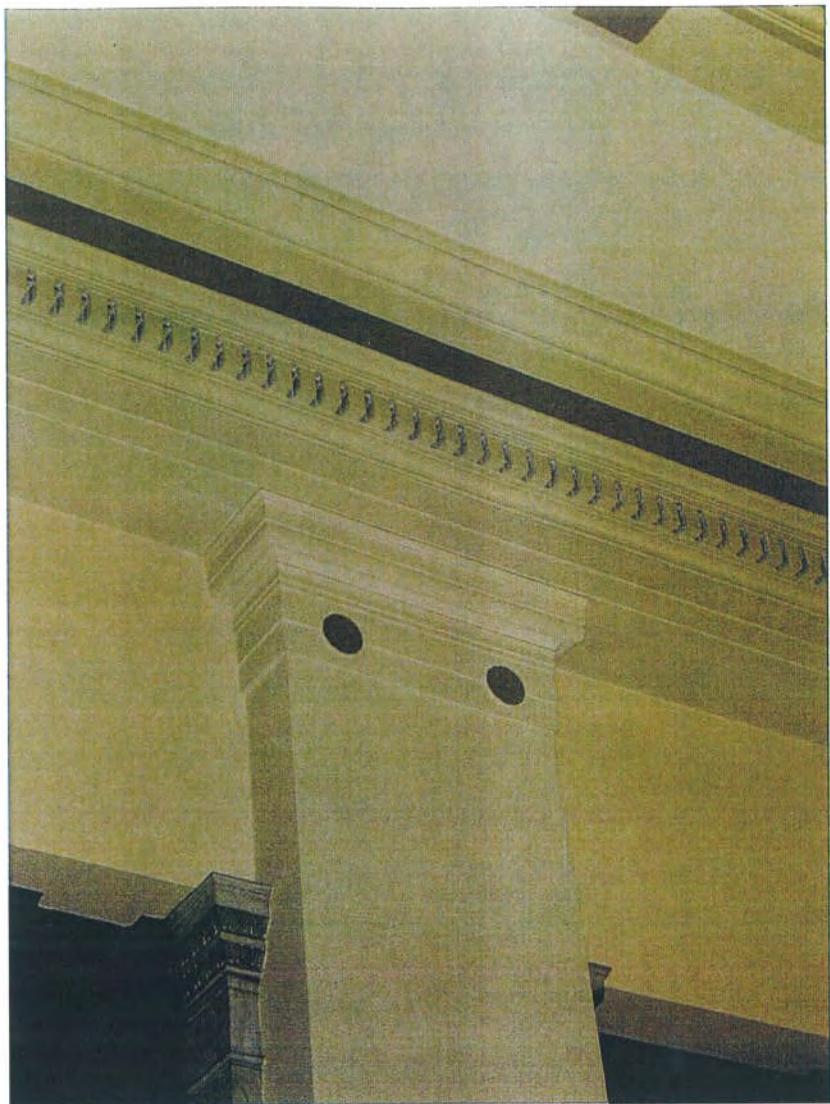

Plaster Pilasters


Photo #I-12



Open Joint

MARBLE PILASTER

Photo #I-13

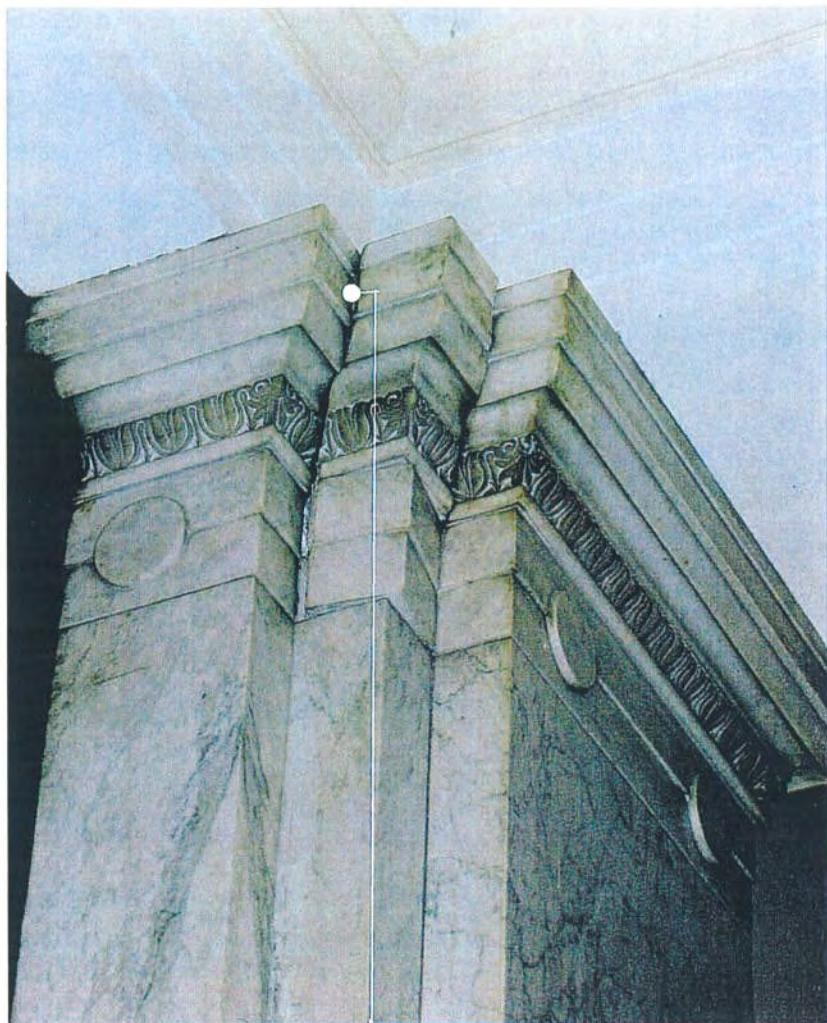

Open Joint

MARBLE PILASTER

Photo #I-14




Pendant Lantern Fixture

Photo #I-15



Glazed Ceiling Panel


Photo #I-16

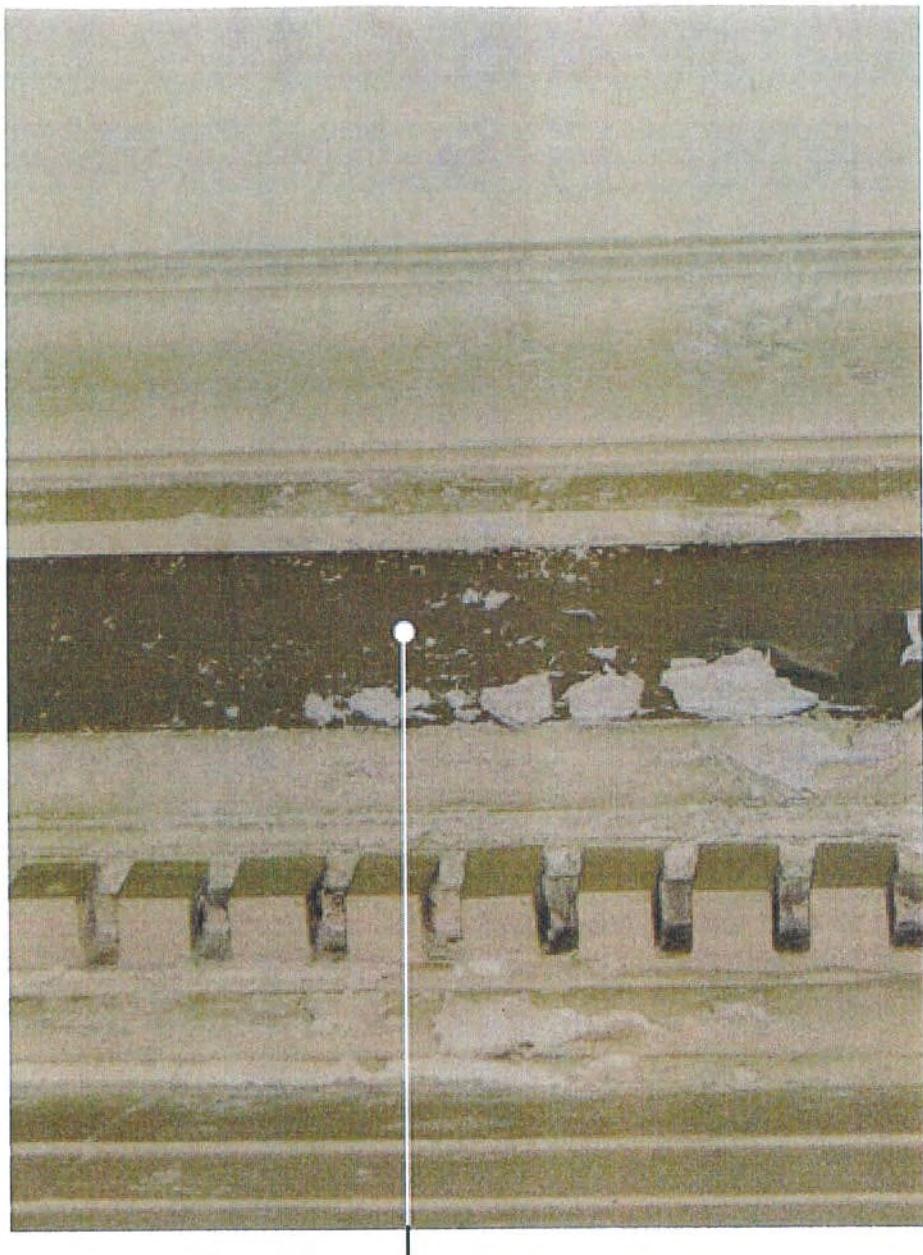

Water Damage to Plaster Details
at face of wall/coffer ceiling


Second Floor - Lobby

Photo #I-17

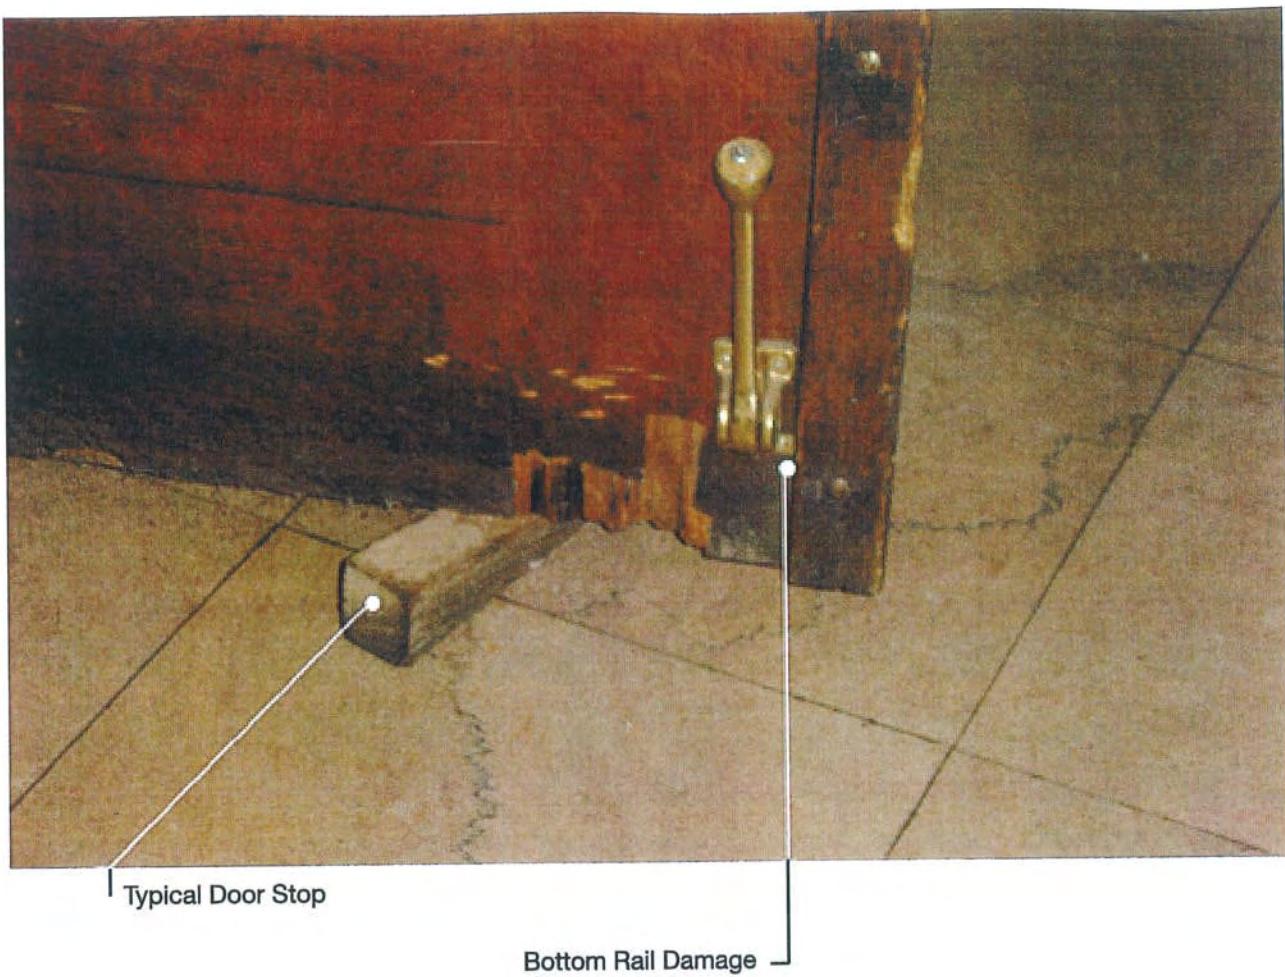


Detail at Door Bottom

Photo #I-18

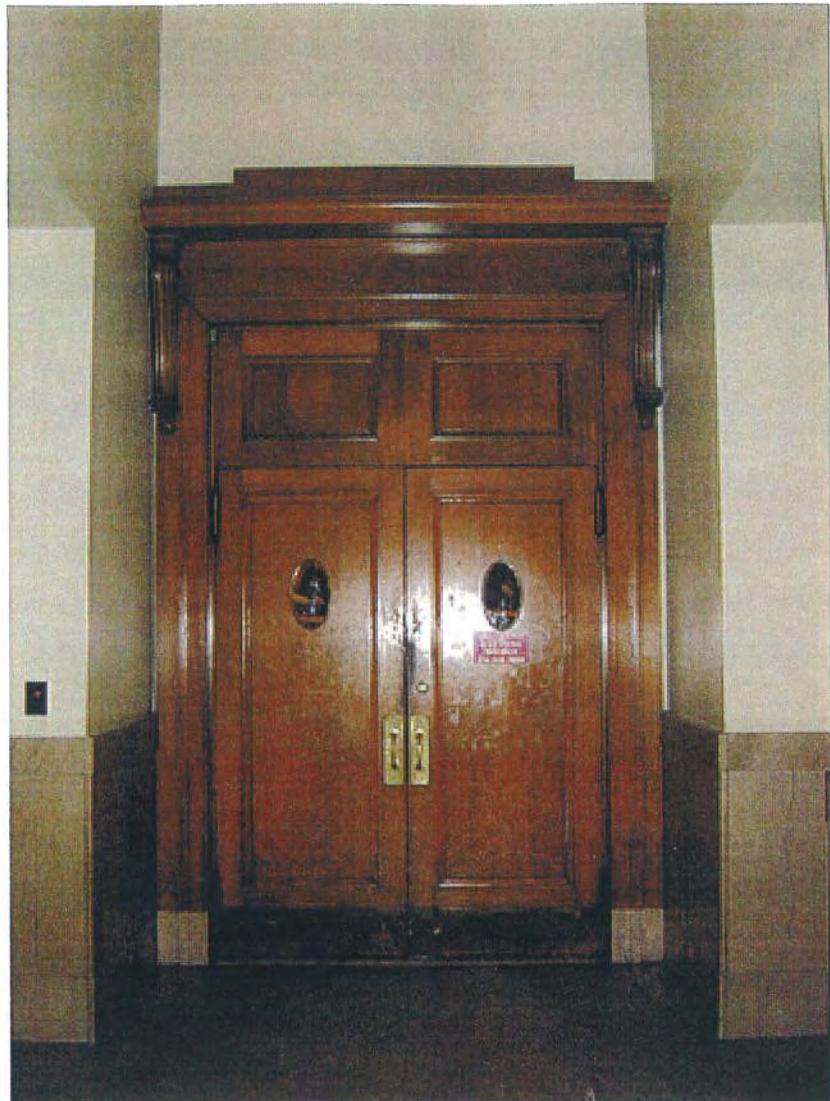

Courtroom Entry Doors

Photo #I-19

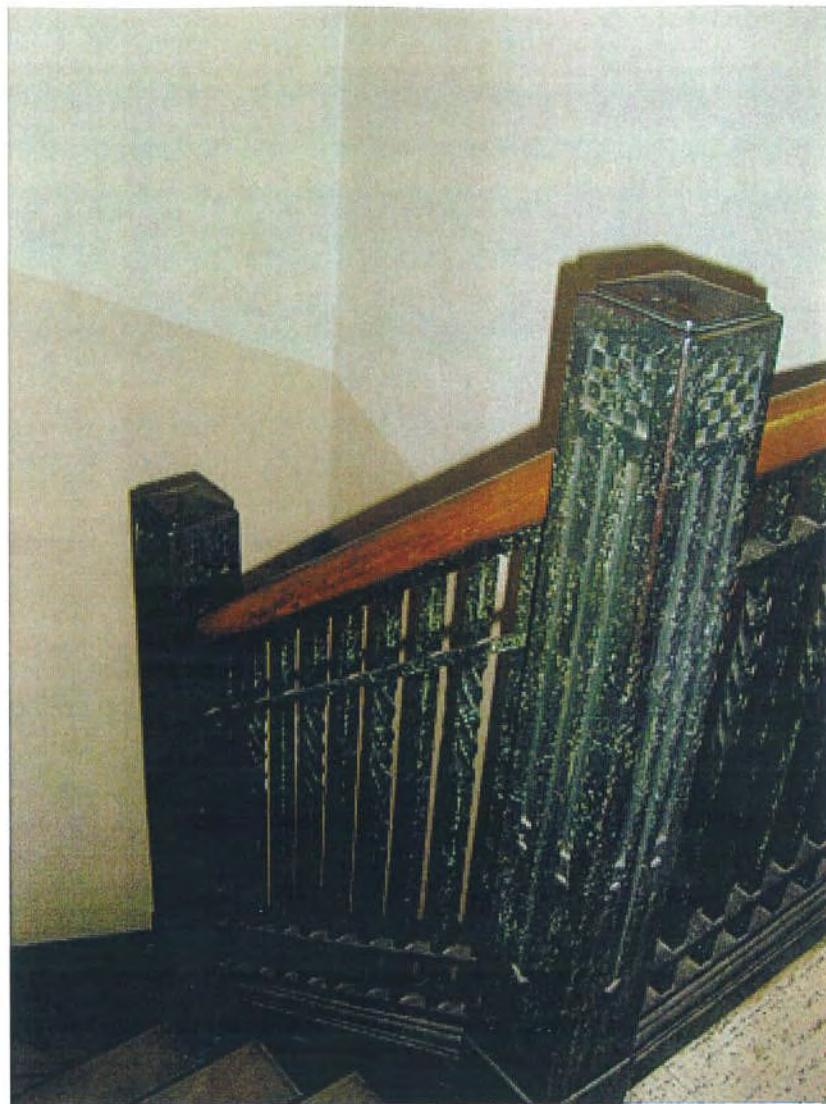

Wrought Iron Balustrade


Photo #I-20



Water Damage


Plaster, Coffered Ceiling


Photo #I-21

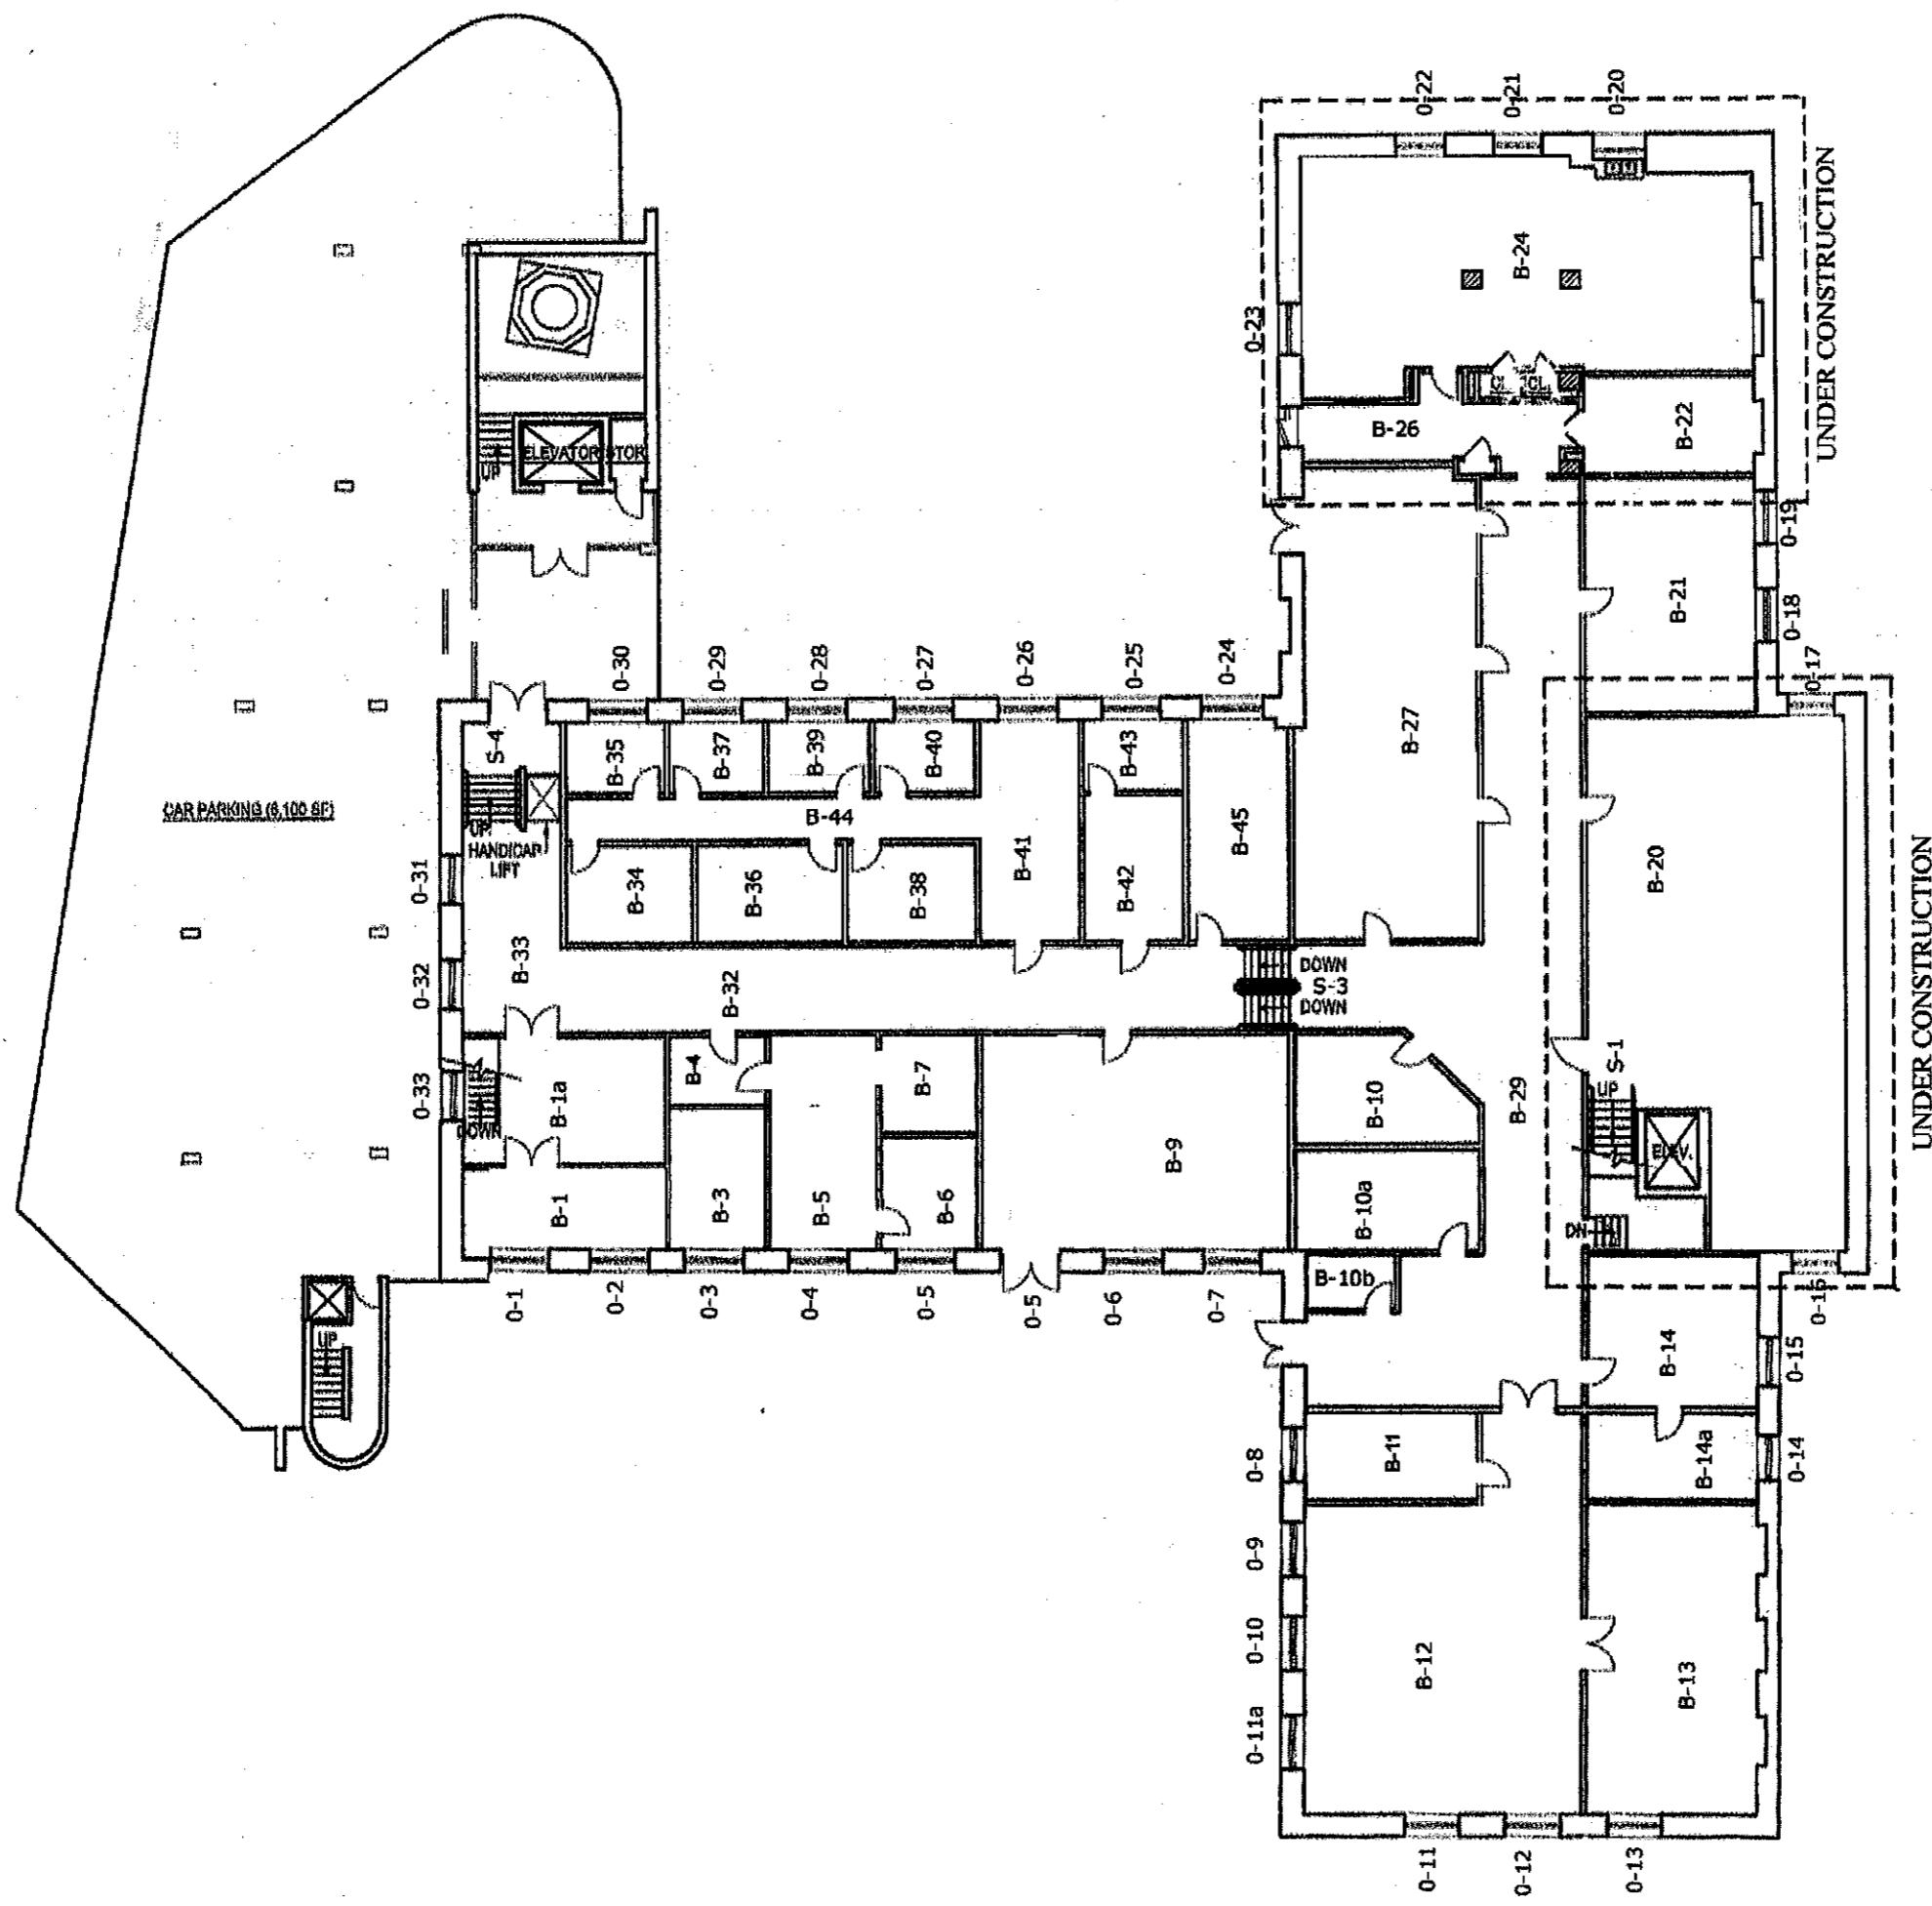

BASEMENT FLOOR PLAN

FIRST FLOOR PLAN

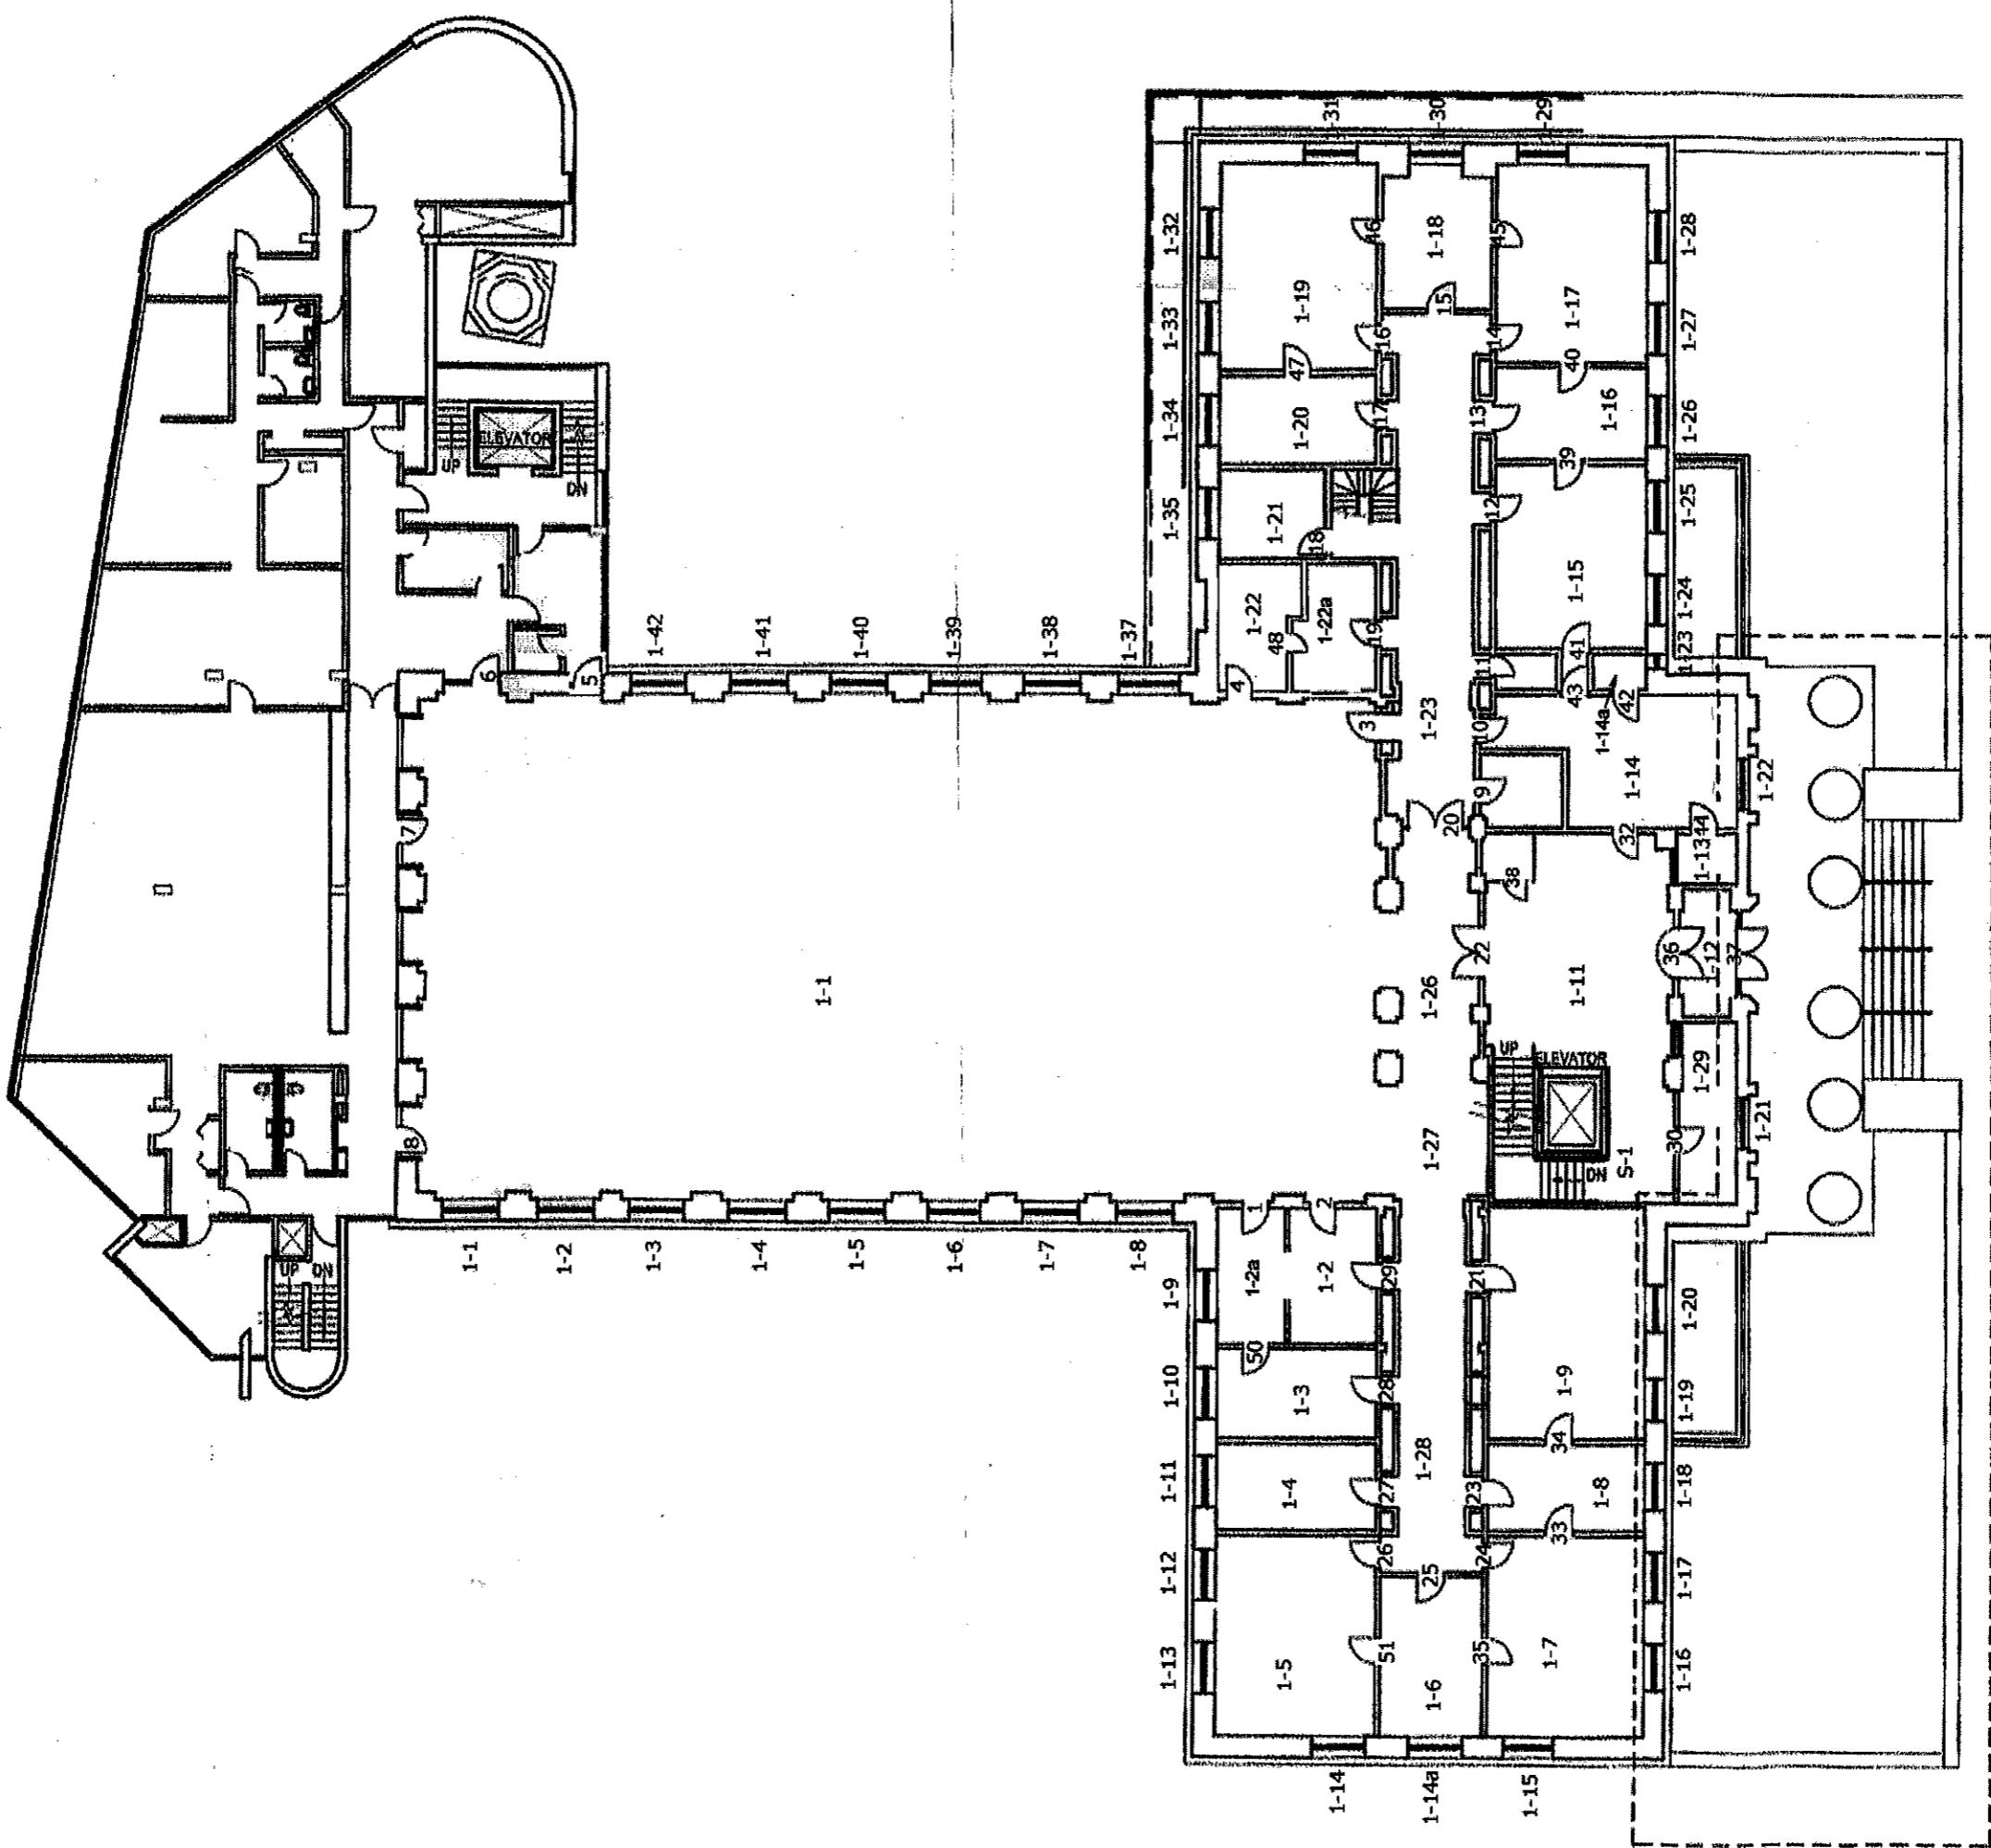

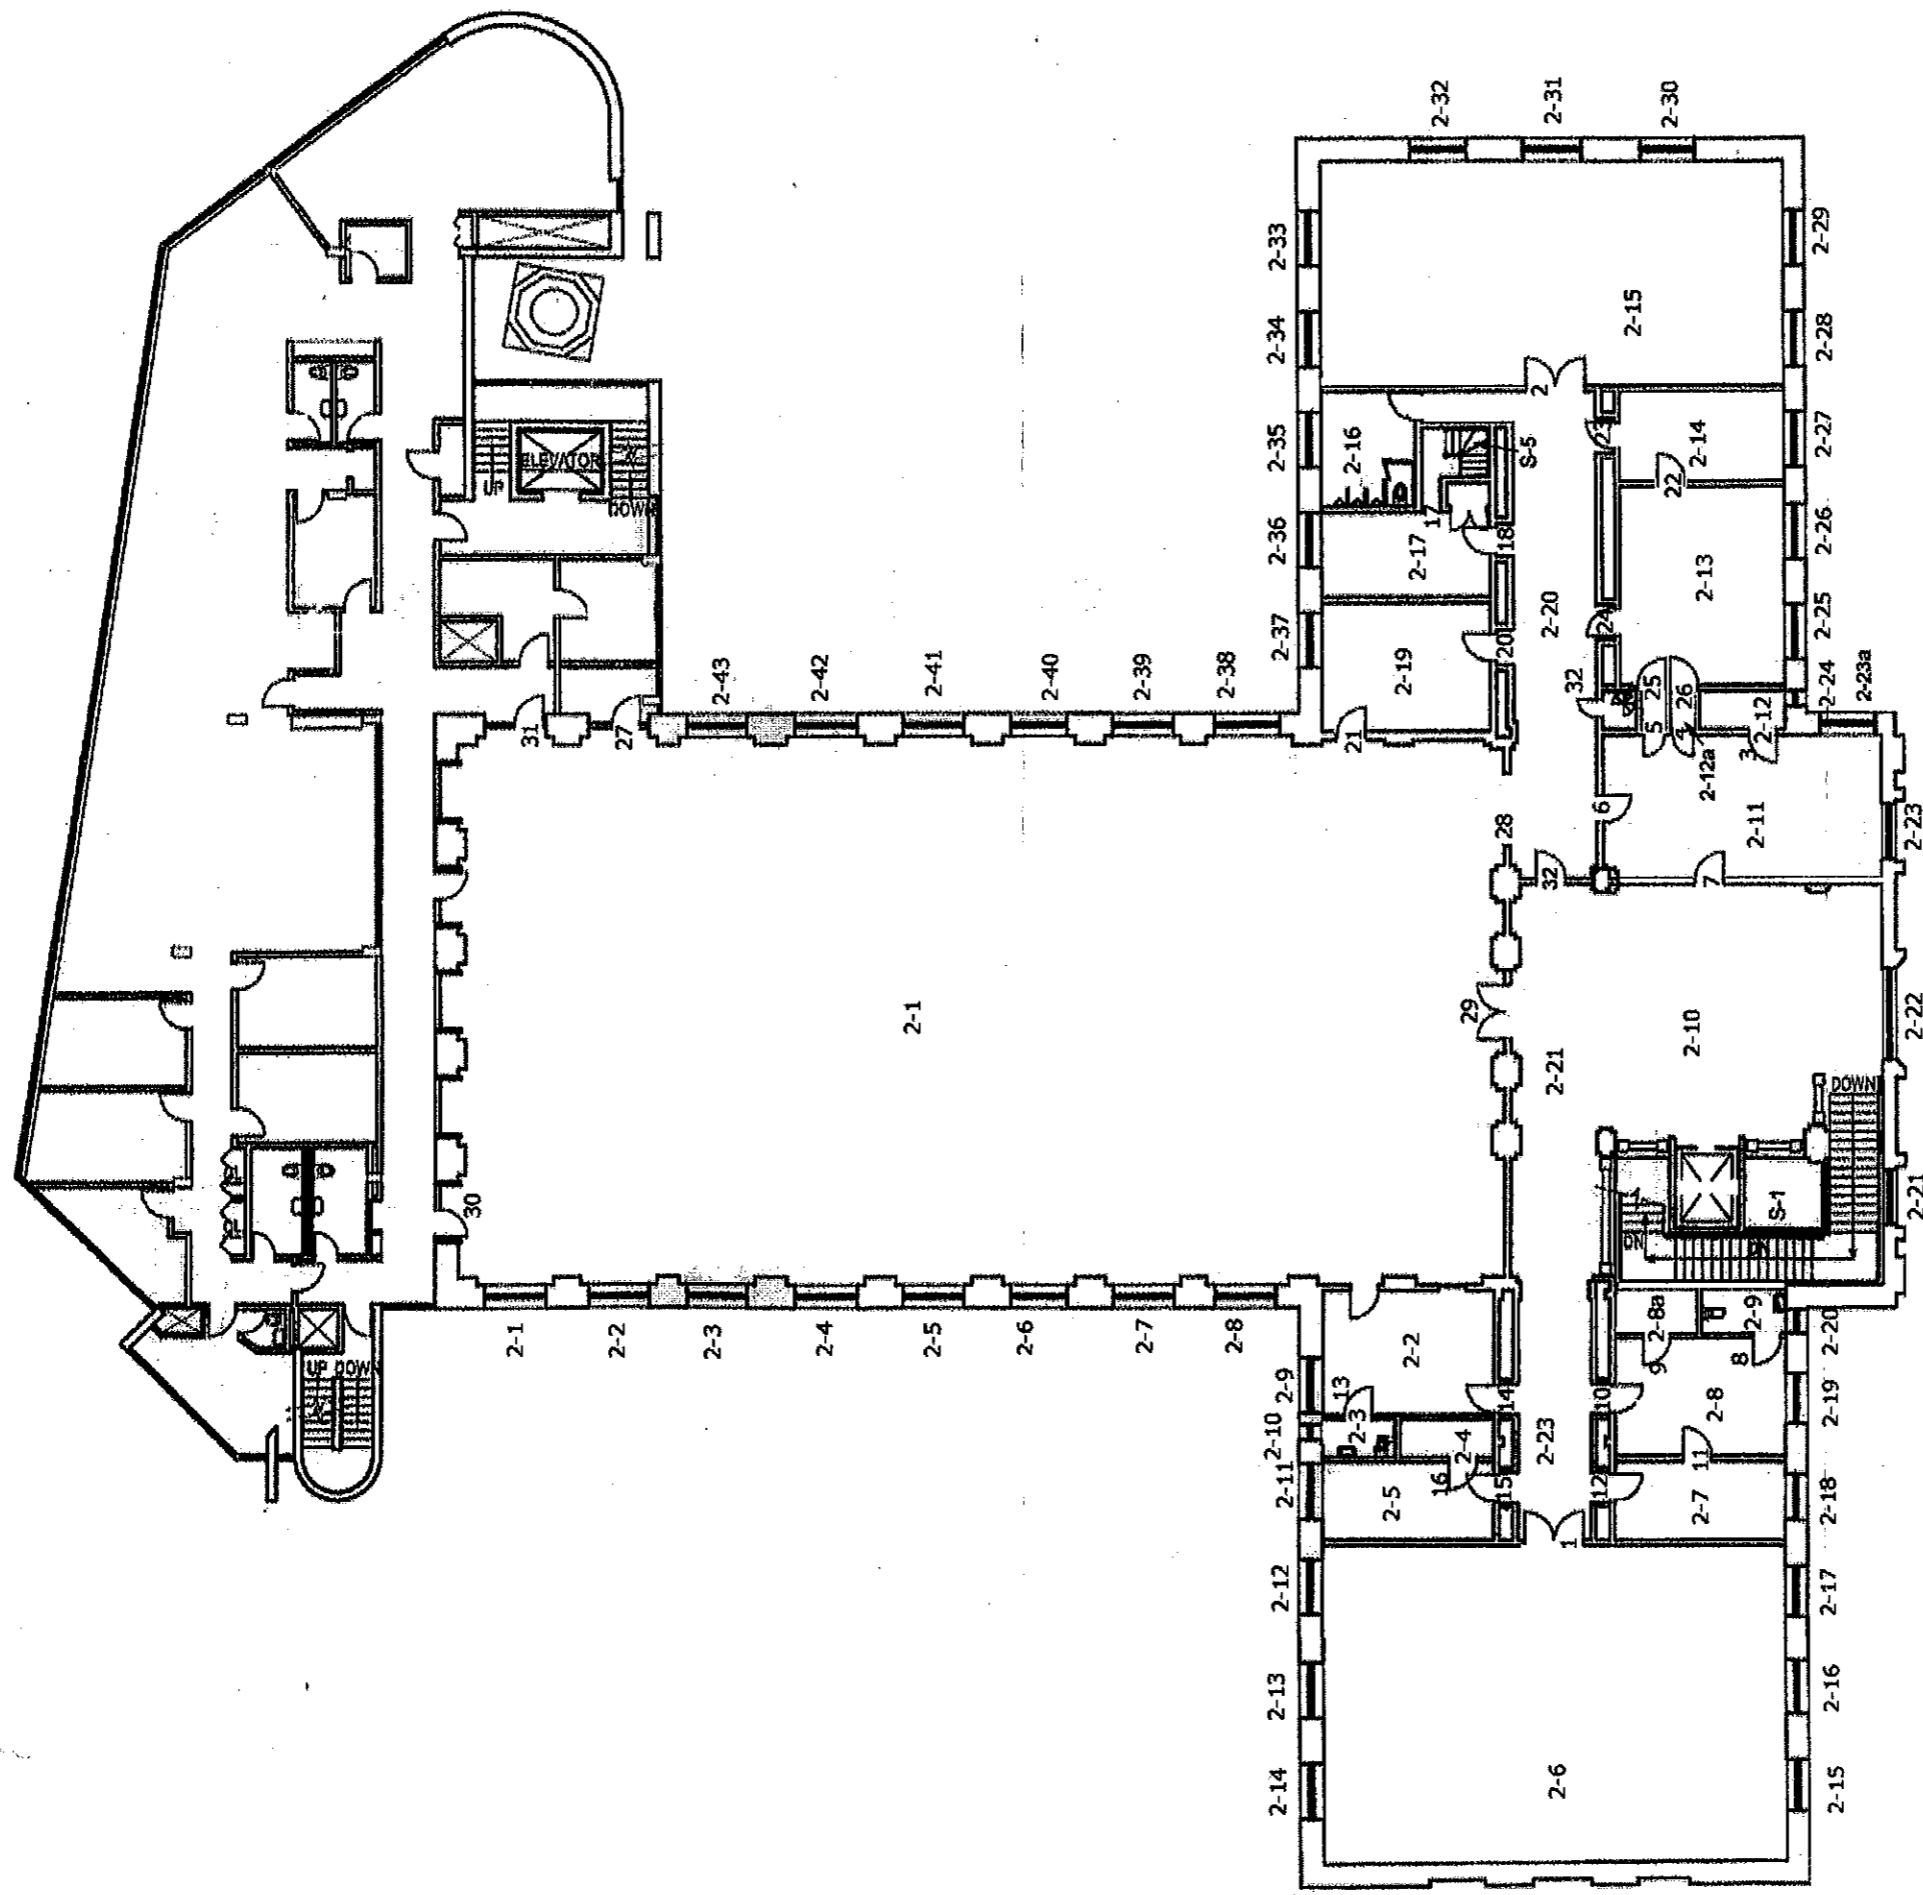

SECOND FLOOR PLAN

SALEM TRIAL COURT
EXISTING CONDITION SURVEY - Window & Frame Analysis
 Goody Clancy Project Number 6290

Date Aug 9&10, 2005 Surveyor: Jonathan Tudan

Condition Rating:

	Materials - Finishes - Trim:		
	M Metal	WS Wood Stained	P Plaster
	WP Wood Painted	CT Ceramic Tile	MB Marble
	V Verdigris	A Anodized Aluminum	
1 Good/Minor Repair			
2 Major Repair			
3 Total Replacement			

- 1 Good/Minor Repair
- 2 Major Repair
- 3 Total Replacement

Room Number R o o m N u m b e r s .	Size/finish opening WxH P r o j e c t o n s .	Sash C o n d i t i o n .	Stool C o n d i t i o n .	Condition				Comments	
				Frame F i n i s h .	Head H a d .	Jamb J a m b .	Misc. M i s c .		
FIRST FLOOR									
1-1 1-A	36" x 114"	1 1 Wv 1 45" Wv	1 1 1 2 Wv						1/2 Thermopane glass. Transom w/single pane gl
1-1 1-B	36" x 114"	1 1 Wv 1 45" Wv	1 1 1 3 Wv						1/2 Thermopane glass. Transom w/single pane gl
1-1 1-2A	36" x 114"	1 1 Wv 1 45" Wv	1 1 1 2 Wv						1/2 Thermopane glass. Transom w/single pane gl
1-1 1-2B	36" x 114"	1 1 Wv 1 45" Wv	1 1 1 3 Wv						1/2 Thermopane glass. Transom w/single pane gl
1-1 1-3A	36" x 114"	1 1 Wv 1 45" Wv	1 1 1 2 Wv						1/2 Thermopane glass. Transom w/single pane gl
1-1 1-3B	36" x 114"	1 1 Wv 1 45" Wv	1 1 1 2 Wv						1/2 Thermopane glass. Transom w/single pane gl
1-1 1-4A	36" x 114"	1 1 Wv 1 45" Wv	1 1 1 1 Wv						1/2 Thermopane glass. Transom w/single pane gl
1-1 1-4B	36" x 114"	1 1 Wv 1 45" Wv	1 1 1 2 Wv						1/2 Thermopane glass. Transom w/single pane gl
1-1 1-5A	36" x 114"	1 1 Wv 1 45" Wv	1 1 1 2 Wv						1/2 Thermopane glass. Transom w/single pane gl
1-1 1-5B	36" x 114"	1 1 Wv 1 45" Wv	1 1 1 2 Wv						1/2 Thermopane glass. Transom w/single pane gl
1-1 1-6A	36" x 114"	1 1 Wv 1 45" Wv	1 1 1 1 Wv						1/2 Thermopane glass. Transom w/single pane gl
1-1 1-6B	36" x 114"	1 1 Wv 1 45" Wv	1 1 1 3 Wv						1/2 Thermopane glass. Transom w/single pane gl
1-1 1-7A	36" x 114"	1 1 Wv 1 45" Wv	1 1 1 3 Wv						1/2 Thermopane glass. Transom w/single pane gl
1-1 1-7B	36" x 114"	1 1 Wv 1 45" Wv	1 1 1 3 Wv						1/2 Thermopane glass. Transom w/single pane gl
1-1 1-8A	36" x 114"	1 1 Wv 1 45" Wv	1 1 1 1 Wv						1/2 Thermopane glass. Transom w/single pane gl

**SALEM TRIAL COURT
EXISTING CONDITION SURVEY - Window & Frame Analysis
Goody Clancy Project Number 6290**

Date Aug 9&10, 2005 Surveyor: Jonathan Tudan

Materials - Finishes - Trim:

- 1 Good/Minor Repair
2 Major Repair
3 Total Replacement

SALEM TRIAL COURT
EXISTING CONDITION SURVEY - Window & Frame Analysis
Goody Clancy Project Number 6290

Date Aug 9&10, 2005 Surveyor: Jonathan Tudan

Condition Rating:
1 Good/Minor Repair
2 Major Repair
3 Total Replacement

Materials - Finishes - Trim:
M Metal
WS Wood Stained
WP Wood Painted
V Verdigris

P Plaster
CT Ceramic Tile
MB Marble
AA Anodized Aluminum

Room Number R#	Op. g. No.	Size/finish opening WxH	Sash		Stool	Condition			Comments
			Finish	Hardware		Condition	Frame	Misc.	
1-1	1-46								No Review
1-2A	1-9	62" x 114"	1 X 1	Wp 1 45"	Wp 1	Wp 1	1 1	Wp	A/C window unit @ lower sash
1-3	1-10	62" x 114"	1 X 1	Wp 1 45"	Wp 1	Wp 1	1 1	Wp	A/C window unit @ lower sash
1-4	1-11	62" x 114"	1 1 1	Wp 1 45"	Wp 1	Wp 1	1 1	Wp	
1-5	1-12	62" x 114"	1 1 1	Wp 1 45"	Wp 1	Wp 1	1 2	1 Wp	
1-5	1-13	62" x 114"	1 1 1	Wp 1 45"	Wp 1	Wp 1	1 1	1 Wp	
1-5	1-14	62" x 114"	1 X 1	Wp 1 45"	Wp 1	Wp 1	1 1	1 Wp	
1-6	1-14A	62" x 114"	1 X 1	Wp 1 45"	Wp 1	Wp 1	1 1	Wp	A/C window unit @ lower sash
1-7	1-15	62" x 114"	1 X 1	Wp 1 45"	Wp 1	Wp 1	1 1	2 Wp	A/C window unit @ lower sash
1-7	1-16	62" x 114"	1 1 1	Wp 1 45"	Wp 1	Wp 1	1 1	3 Wp	A/C window unit @ lower sash
1-7	1-17	62" x 114"	1 1 1	Wp 1 45"	Wp 1	Wp 1	1 1	3 Wp	
1-8	1-18	62" x 114"	1 1 1	Wv 1 45"	Wp 1	Wv 1	1 1	3 Wv	
1-9	1-19	62" x 114"	1 X 1	Wp 1 45"	Wp 1	Wp 1	1 1	1 Wp	A/C window unit @ lower sash
1-9	1-20	62" x 114"	2 no 1	Wp 1 45"	Wp 1	Wp 1	1 1	1 Wp	
1-14	1-22	68" x 114"	1 no 1	Wp 1 45"	Wp 1	Wp 1	1 1	1 Wp	
1-14	1-22A	62" x 114"	1 X 1	Wp 1 45"	Wp 1	Wp 1	1 1	1 Wp	A/C window unit @ lower sash