



NEW ENGLAND CIVIL ENGINEERING CORP.

120 WASHINGTON STREET, SUITE 202E, P.O. BOX 3026, SALEM, MA 01970
PH: 978.741.7401 - FAX: 978.741.7402 - WWW.ENGINEERINGCORPORATION.COM

City of Salem Municipal Street Tree Assessment Project - Pilot Program

TASK ORDER No. 2
On-Call Civil Engineering Support Services
City of Salem RFQ R-50



August 2016

TABLE OF CONTENTS

Letter Report

Attachment

Map of Entrance Corridor Pilot Area	Attachment A
Maps of GPS Located and Assessed Tree Types	
Maps of Tree Maintenance Needs	
Photos of All GPS Located Trees	Attachment B
Database Table of All GPS Located Trees & Tree Warden Excel Sheet Incorporated to Database	Attachment C
Tree Identification Key	Attachment D





NEW ENGLAND CIVIL ENGINEERING CORP.

120 WASHINGTON STREET, SUITE 202E, P.O. BOX 3026, SALEM, MA 01970
PH: 978.741.7401 - FAX: 978.741.7402 – WWW.ENGINEERINGCORPORATION.COM

City of Salem Municipal Street Tree Assessment Project Pilot Program

Project Understanding

The City of Salem retained New England Civil Engineering Corp (NECE) to GPS locate and evaluate the condition of the street trees along four major corridors in the city. This pilot project was funded by a grant through Mass in Motion and facilitated through the Engineering Department. The following streets were included in the survey: Bridge Street from the Beverly Bridge to Howard Street, Lafayette Street from the Marblehead Town line to Loring Avenue, Boston Street from the Peabody City line to Essex Street, and North Street from the Peabody City line to the North Street Bridge. Refer to Attachment A for map depicting survey extent. As each street tree was GPS located, an overall photo was taken, and various attributes on the tree condition and the surrounding sidewalk were populated into the database. See Figure 1 for description of data collected. See attachment B for photos of the GIS linked photos of all the trees surveyed. See Attachment C for table of all data collected. In addition to the survey, a spreadsheet provided by the Tree Warden was incorporated into the database. Although the dataset is not as robust as the survey, the data was valuable in determining the extent of current needs such as pruning needs and empty pit locations throughout the city.

Field	Value
ID	Boston-22
Street Number	110
Street Name	Boston Street
Common Name	Bradford Pear
Genus	Pyrus
Species	calleryana
Quantity	1
Management	Insect Damage
Tree Present	Yes
Diameter	30
Height	35
Condition	Fair
Wires	Yes
Trunk Injury	No
Sidewalk Condition	Good
Surrounding Sidewalk Material	Concrete
Comments	overlapping branches w/ ash tree
Priority	3
Action Taken	
Land Use	Commercial
Owner	Municipality
Ward	4
Install Date	1/1/1111
Last Update	8/15/2016
Last Editor	NECE
GPS Date	8/15/2016
Photo Link	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0531.JPG

Figure 1: GPS Data Collected

Maintenance Needs

In total, 348 trees were GPS located and assessed as part of the pilot study. The Tree Warden provided some limited information on an additional 376 trees or tree pit locations bringing the total number of trees in the current database to 724 trees or tree pit locations. No action is needed on 124 or 36% of the locations. The majority of maintenance needed is either deadwood removal or pruning of 245 trees. Open tree pits or stumps comprise 244 of the recommended maintenance. See Figures 2 and 3 for a breakdown of maintenance needs. See Attachment A for maps of each entrance corridor tree coded by maintenance need.

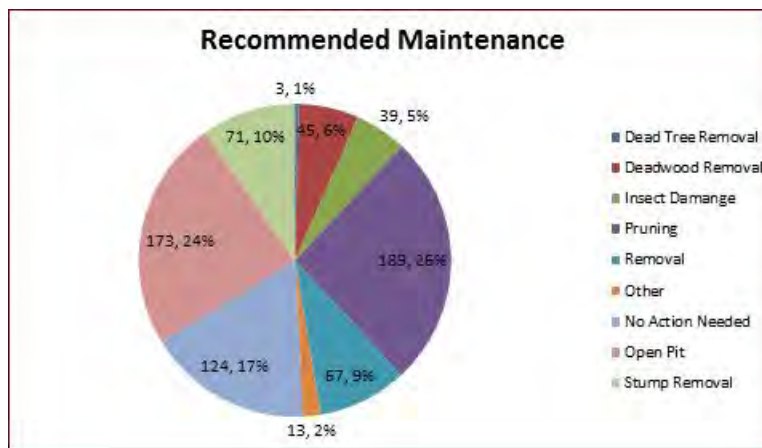


Figure 2

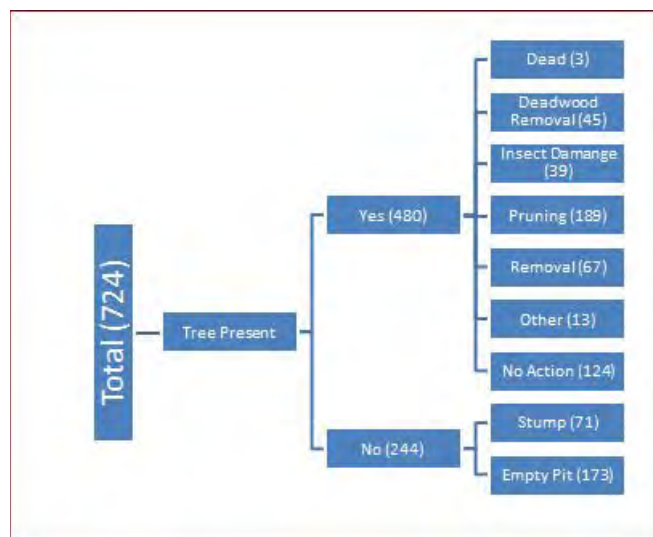


Figure 3



Tree Species

The majority of the trees surveyed are Bradford pear, Norway maple and Ash. The lifespan of the Bradford pear is 20-30 years. The branches tend to break easily in winter storms and often are caught in power lines. The Norway maple is now listed as an invasive species. The emerald ash borer and Asian longhorned beetle have already been observed in nearby communities. These invasive insects target many types of trees but have been reported to affect the Norway maple and Ash more often than other tree species. Refer to Figure 4, 5, and 6 for tables depicting the types of trees observed as well as diameters and heights. A tree identification key was created depicting the trees observed during the survey and can be found in Attachment D. The free app “Leaf Snap” was also utilized to help identify trees. This reference guide and application can also be utilized

for the future City program to work with homeowners to identify and assess the trees in their neighborhoods.

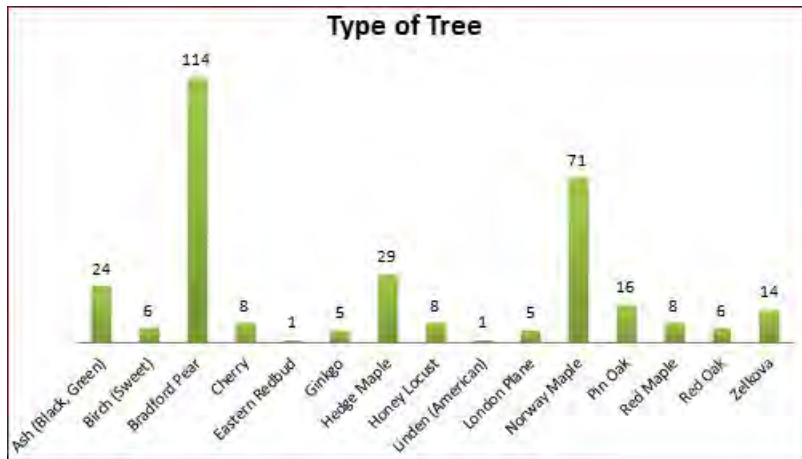


Figure 6

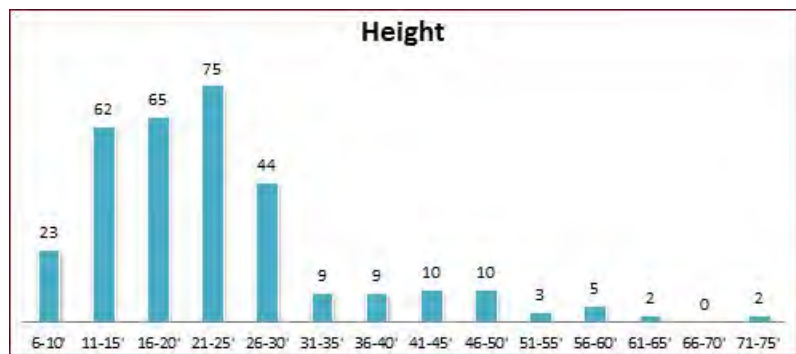


Figure 5

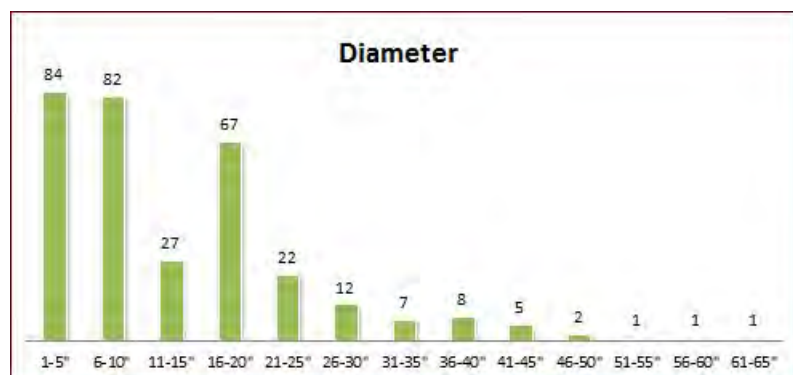


Figure 4




Attachment A

Maps

Map of Entrance Corridor Pilot Area
Maps of GPS Located and Assessed Tree Types
Maps of Tree Maintenance Needs





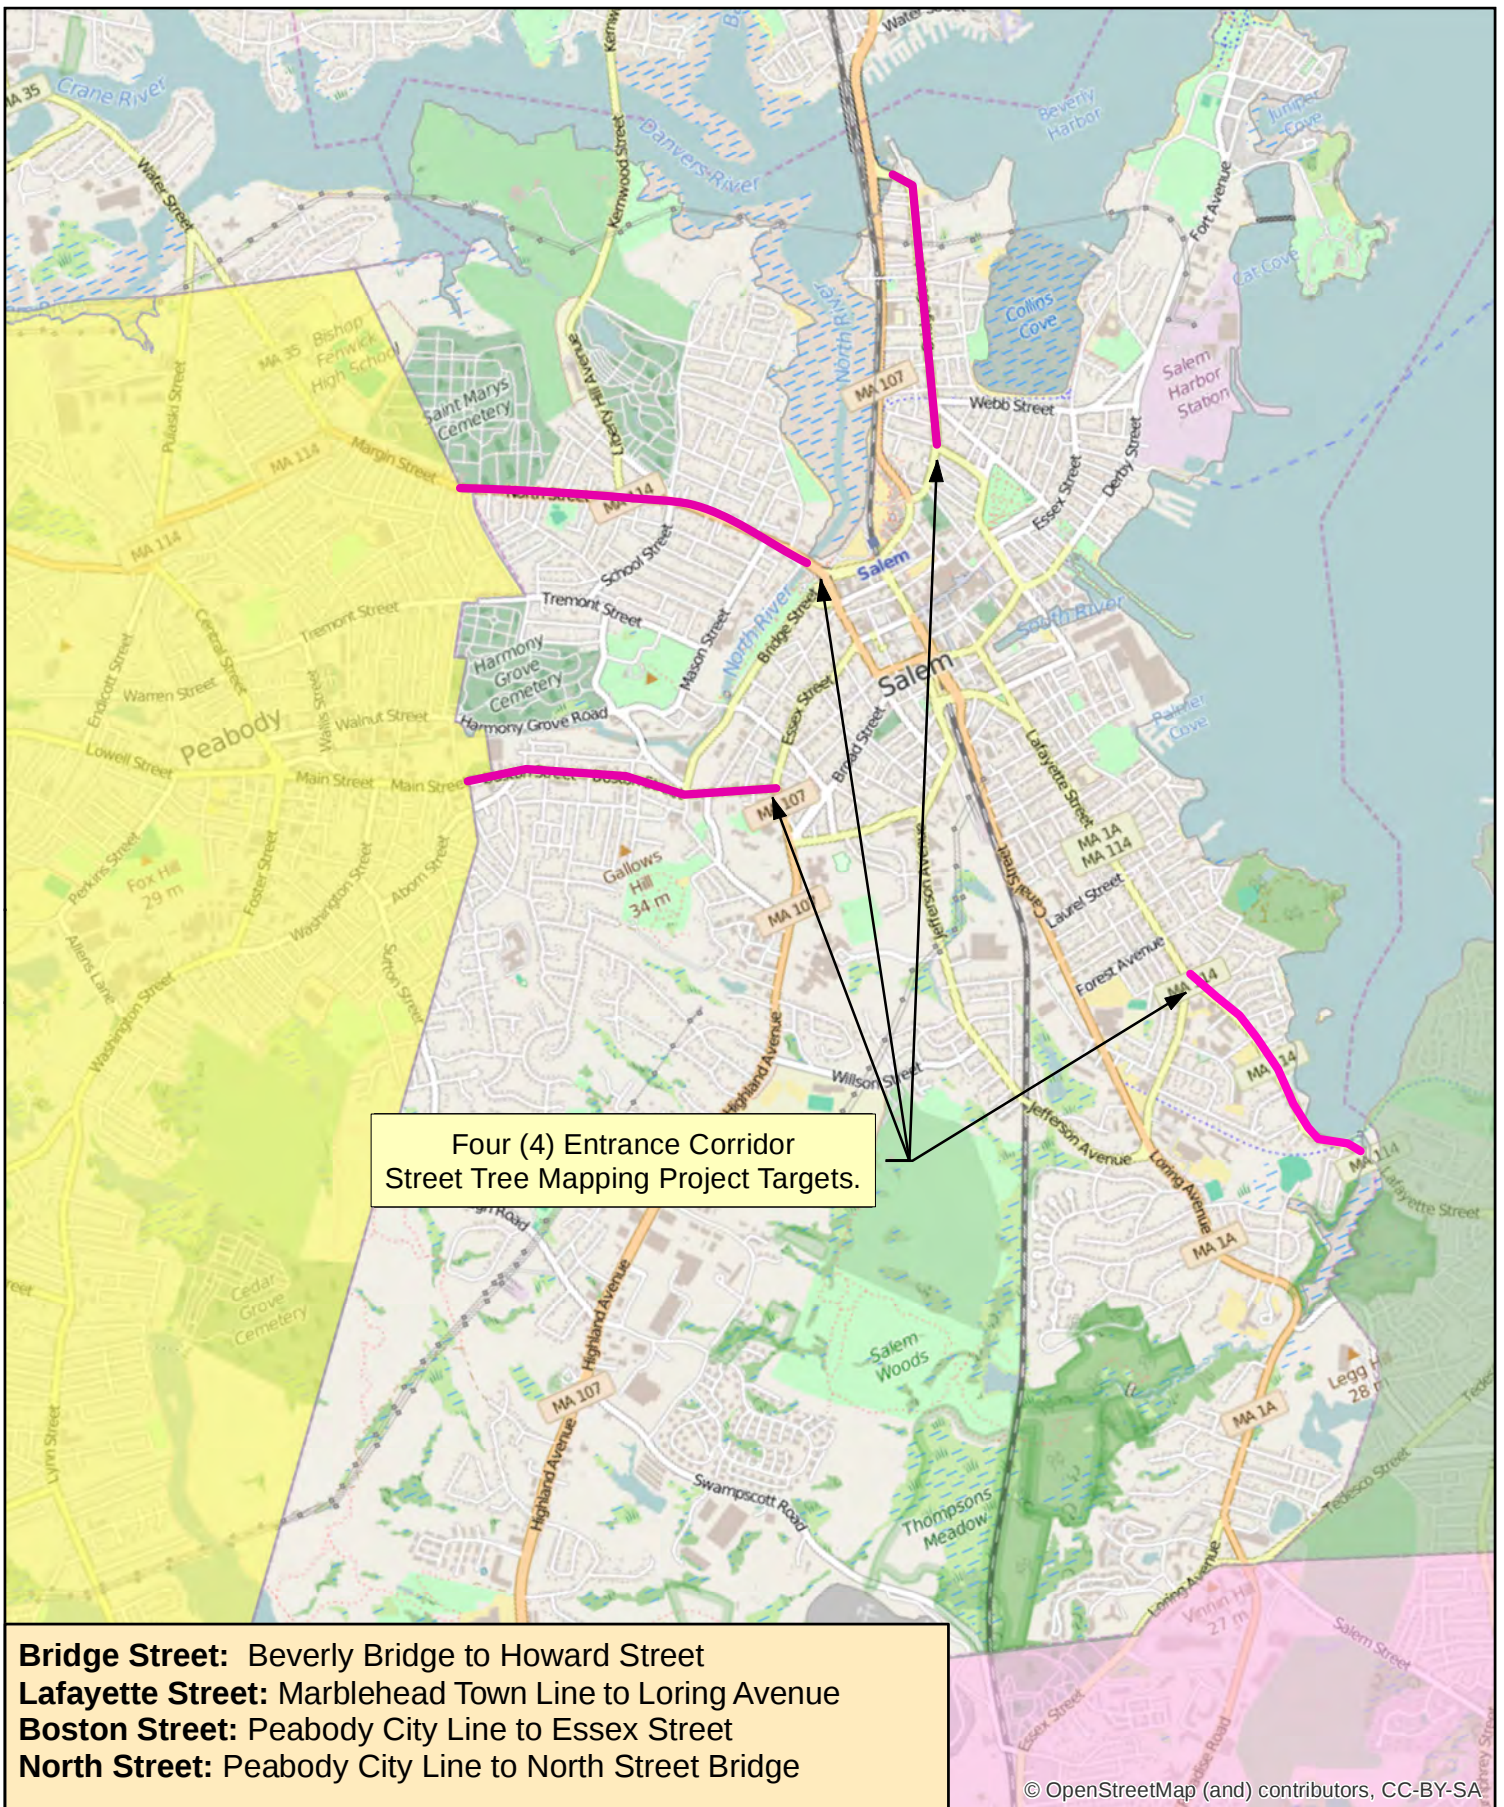

Entrance Corridor Street Tree Mapping Pilot Salem, MA

Tuesday, August 09, 2016



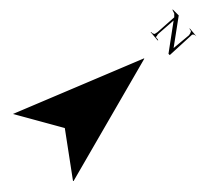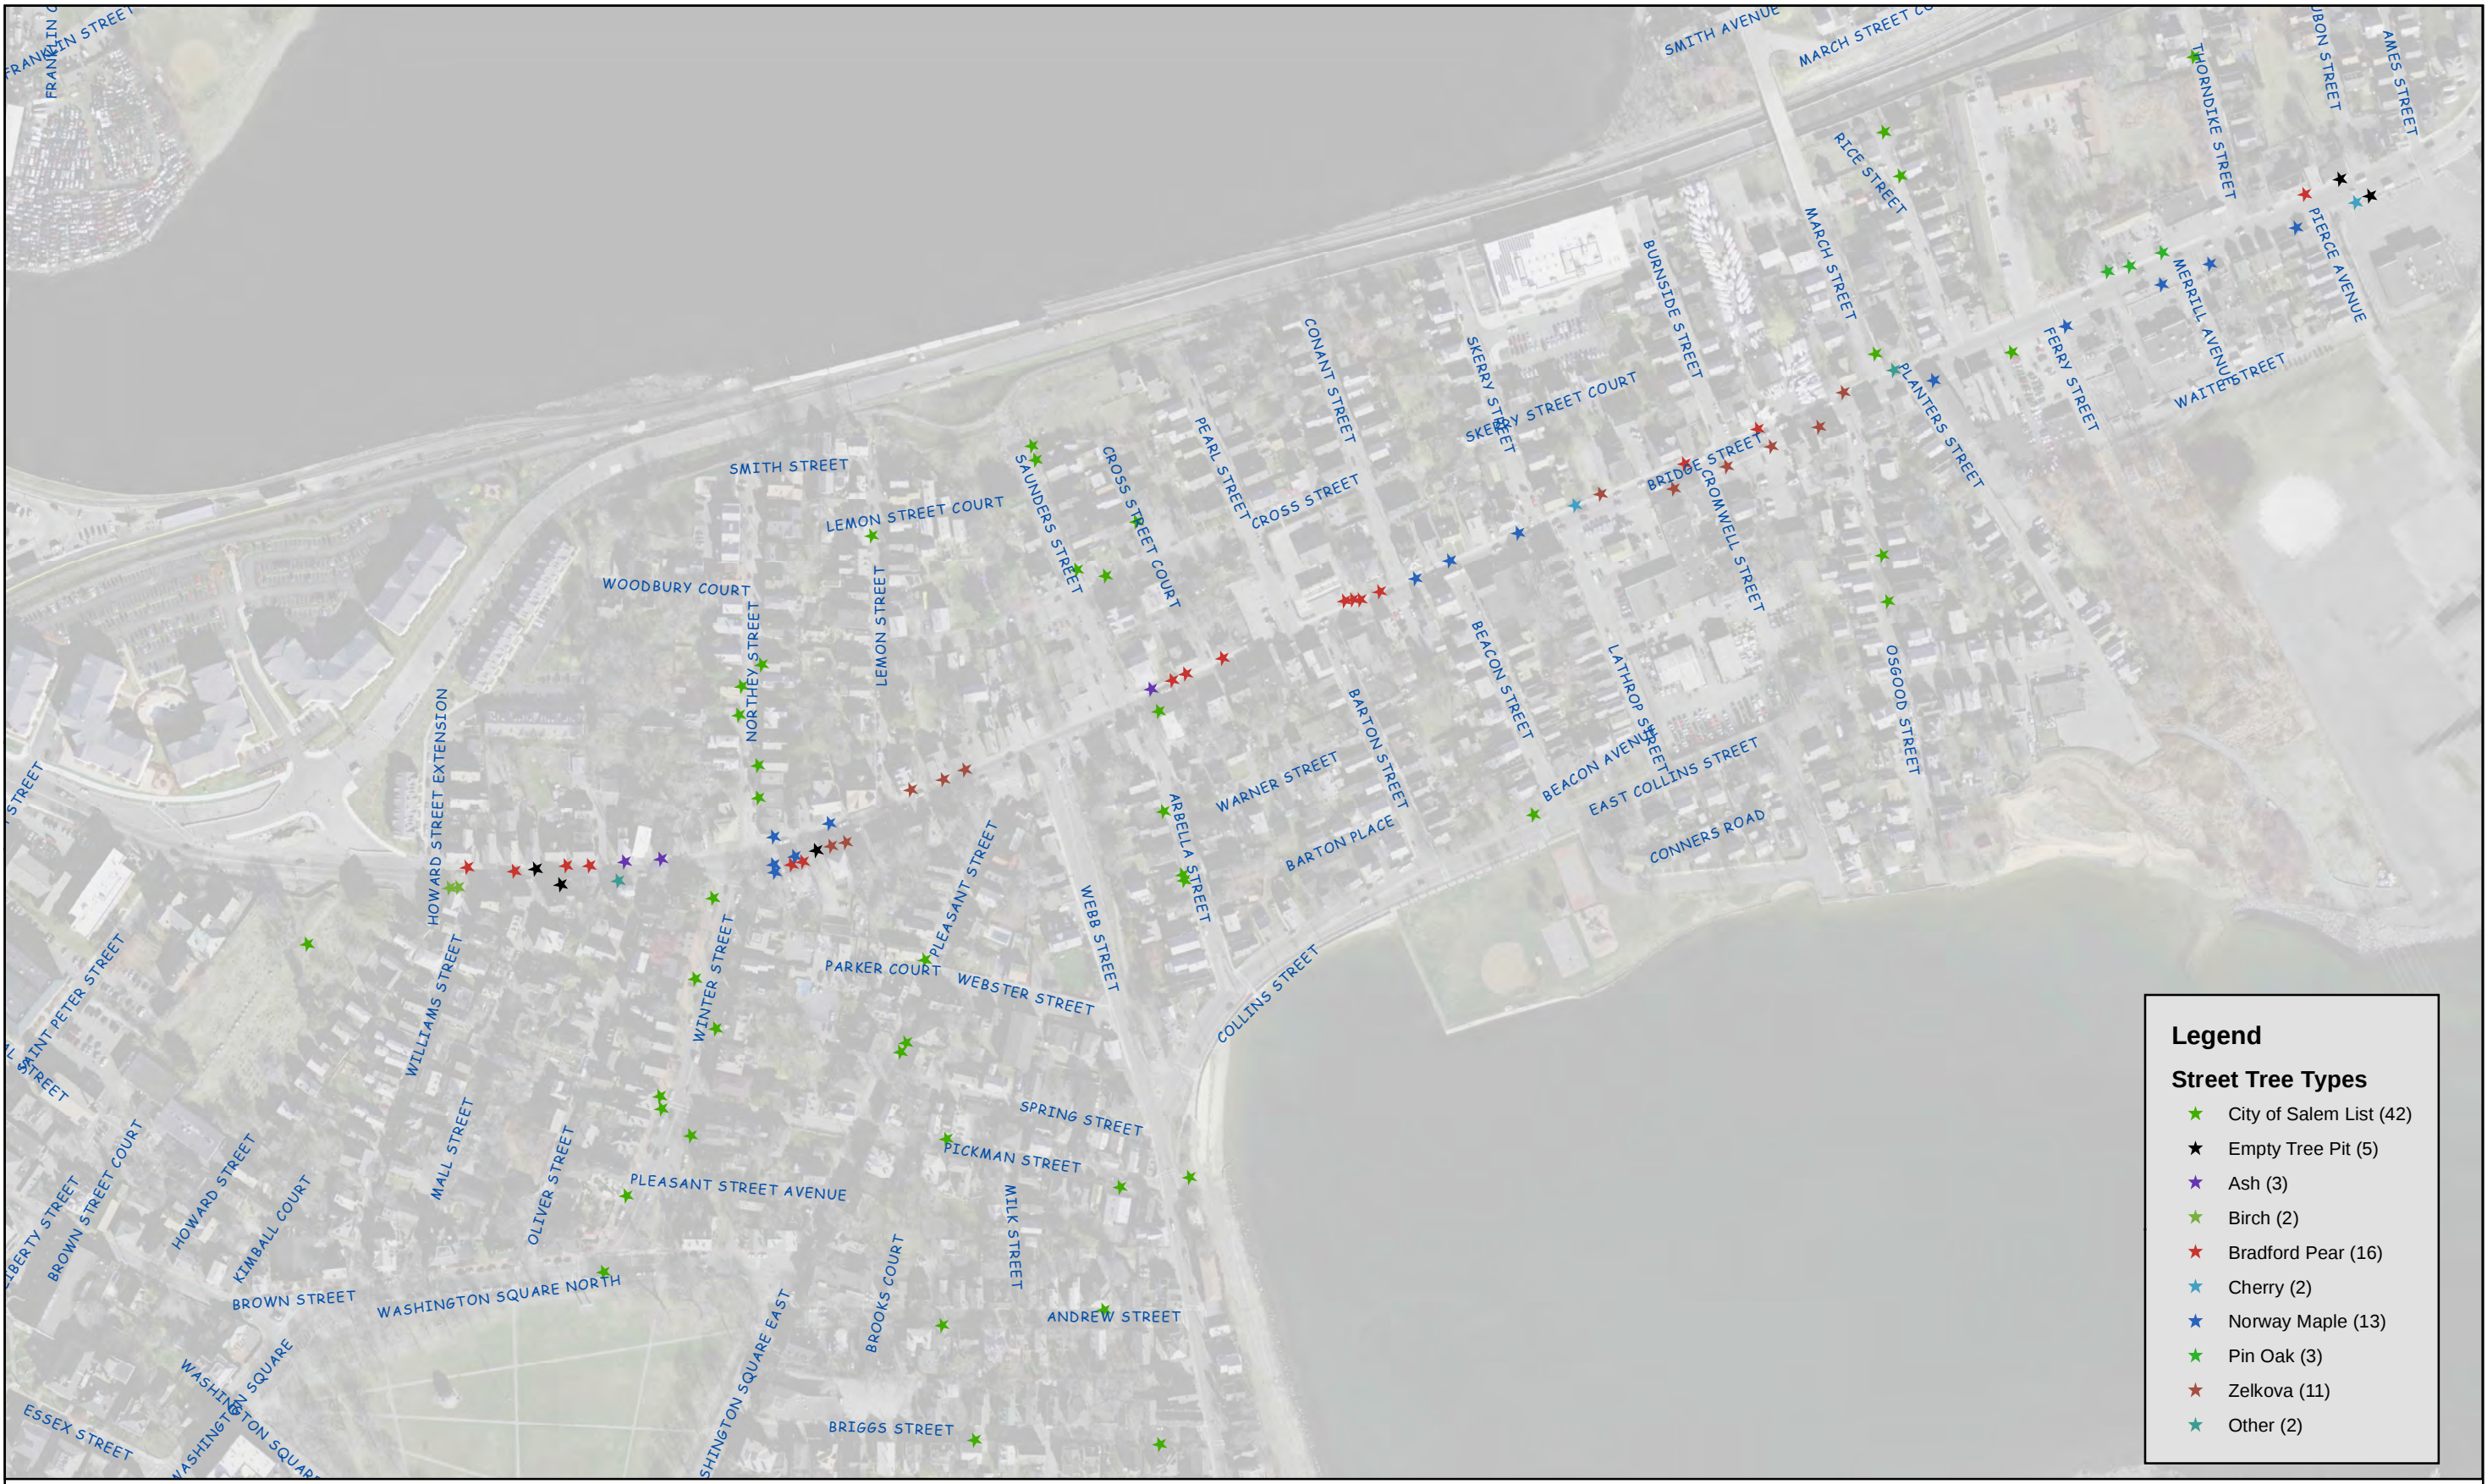


Corridor Street Tree Mapping Pilot - Bridge Street Salem, MA

Tuesday, August 23, 2016


0 150 300
Feet

1 inch = 300 feet

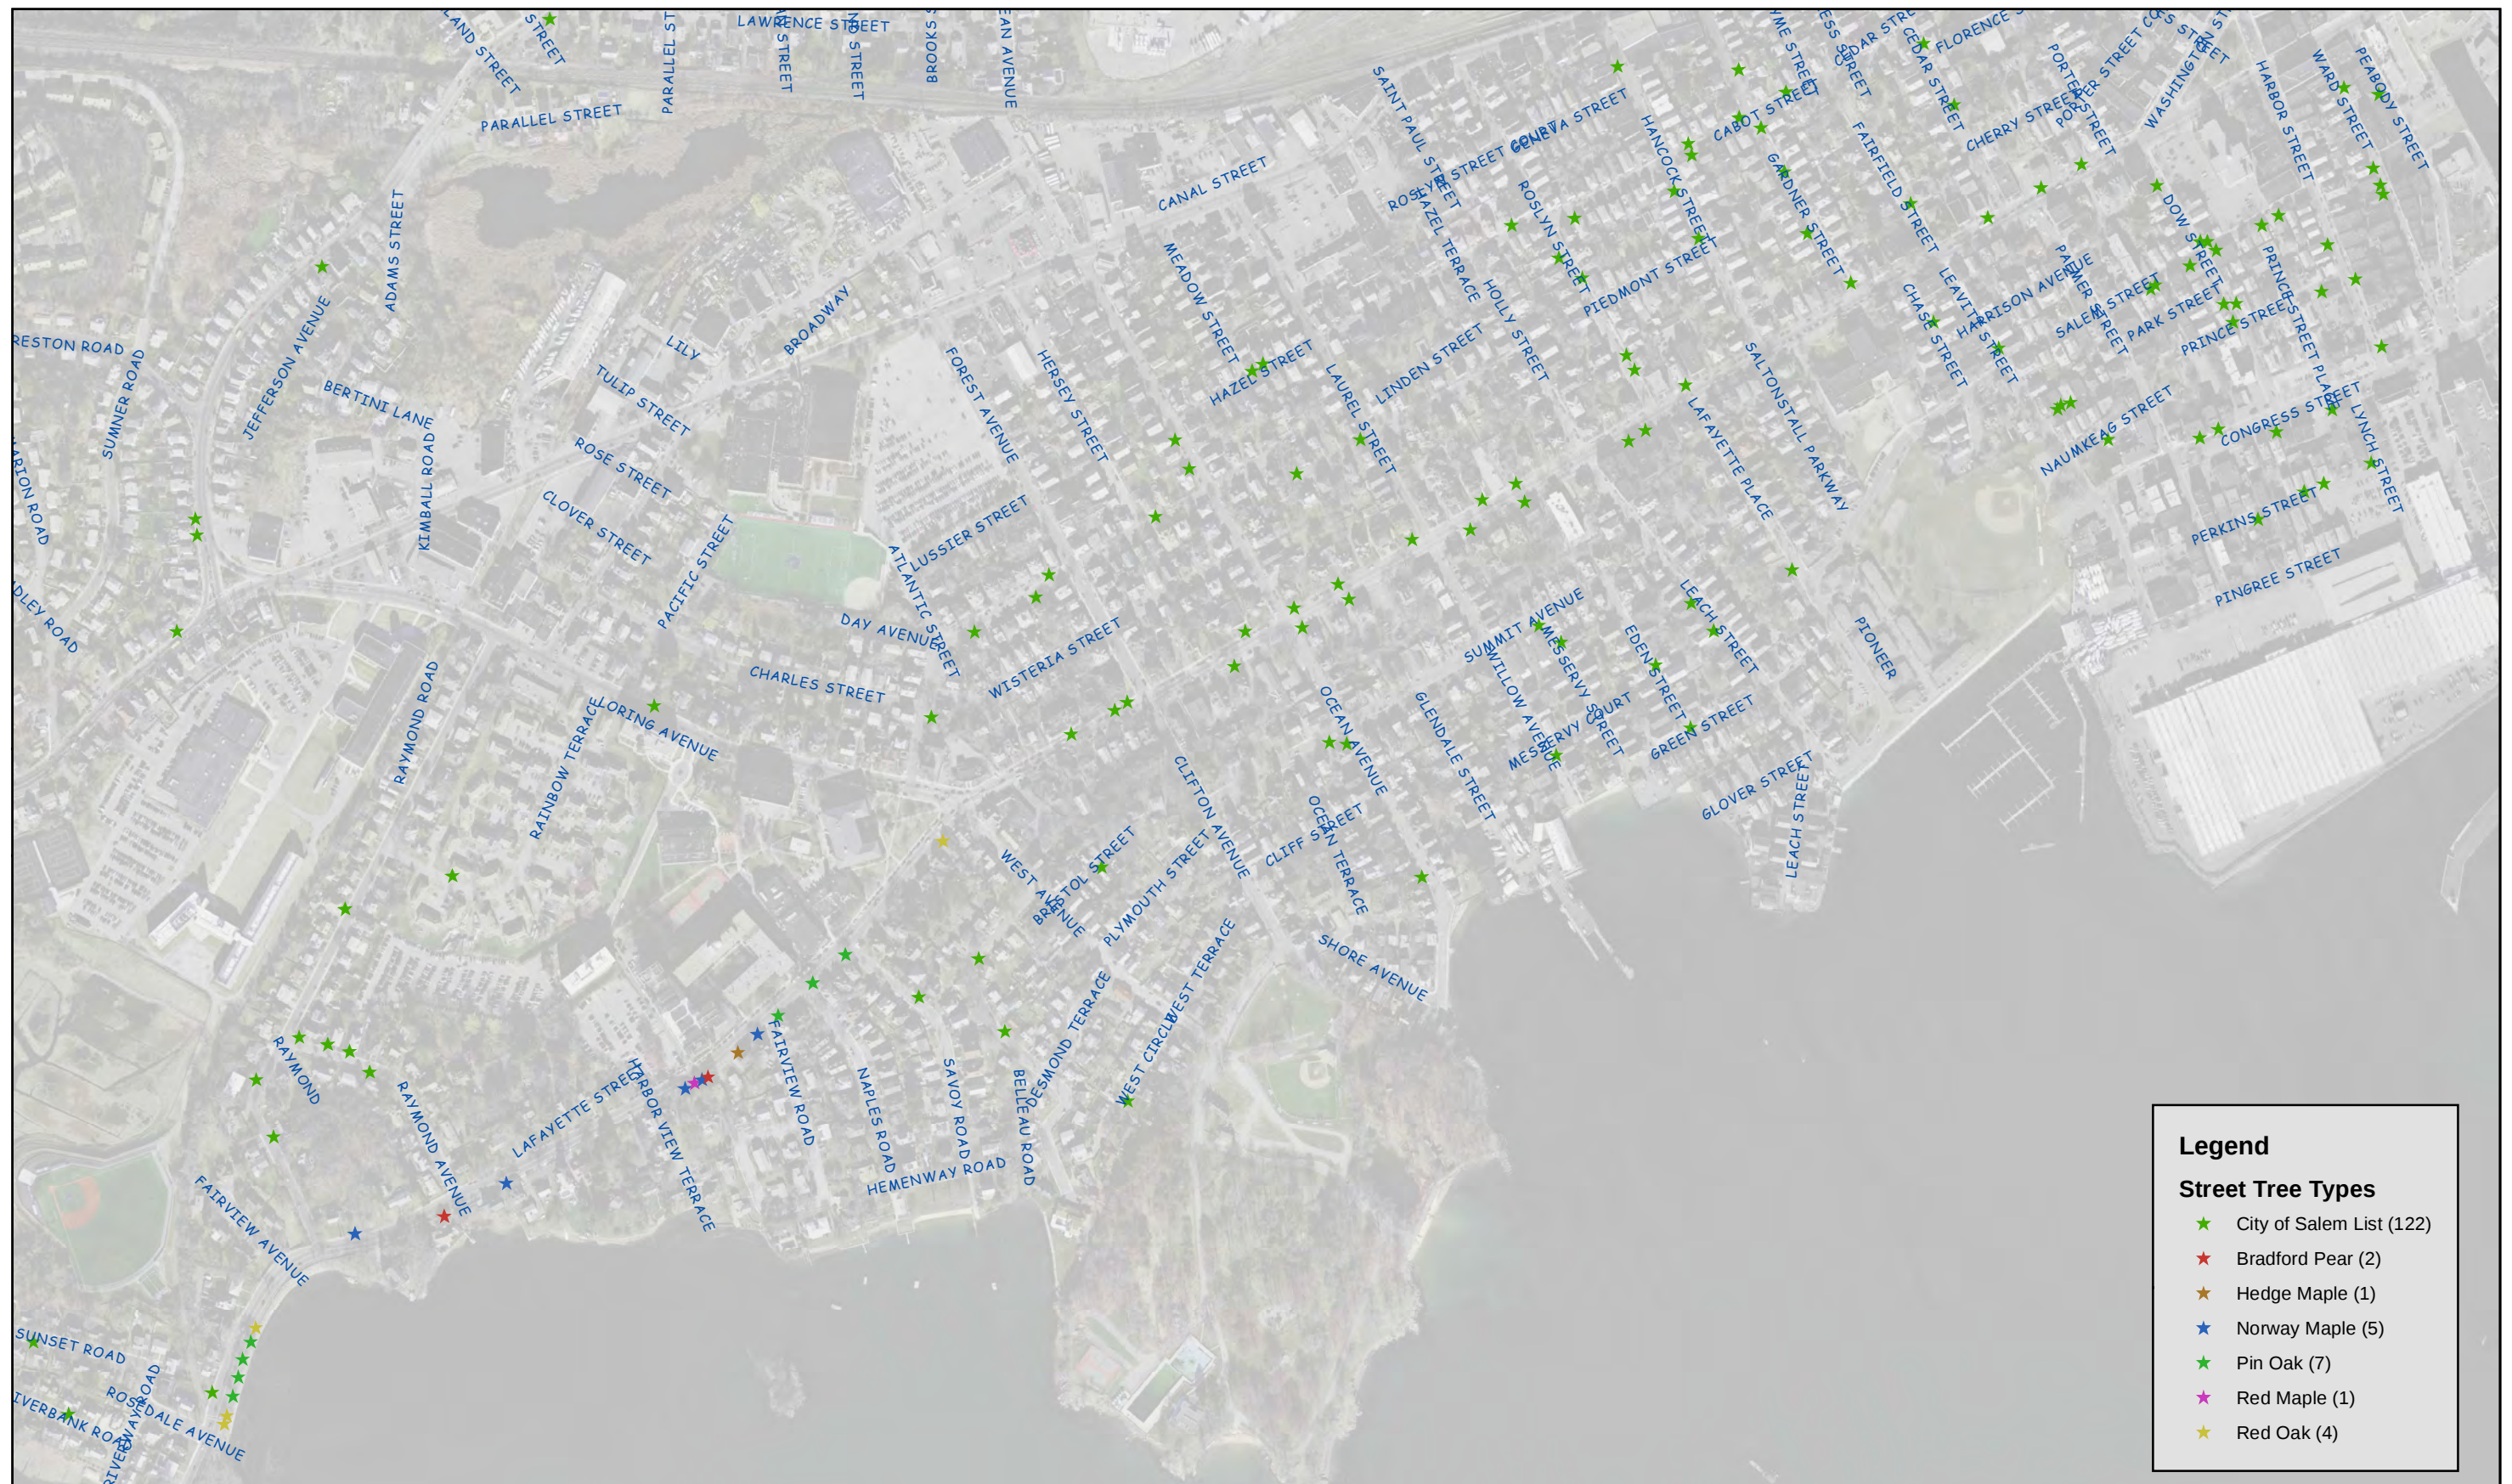


Corridor Street Tree Mapping Pilot - Lafayette Street Salem, MA

Tuesday, August 23, 2016

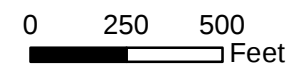


1 inch = 500 feet

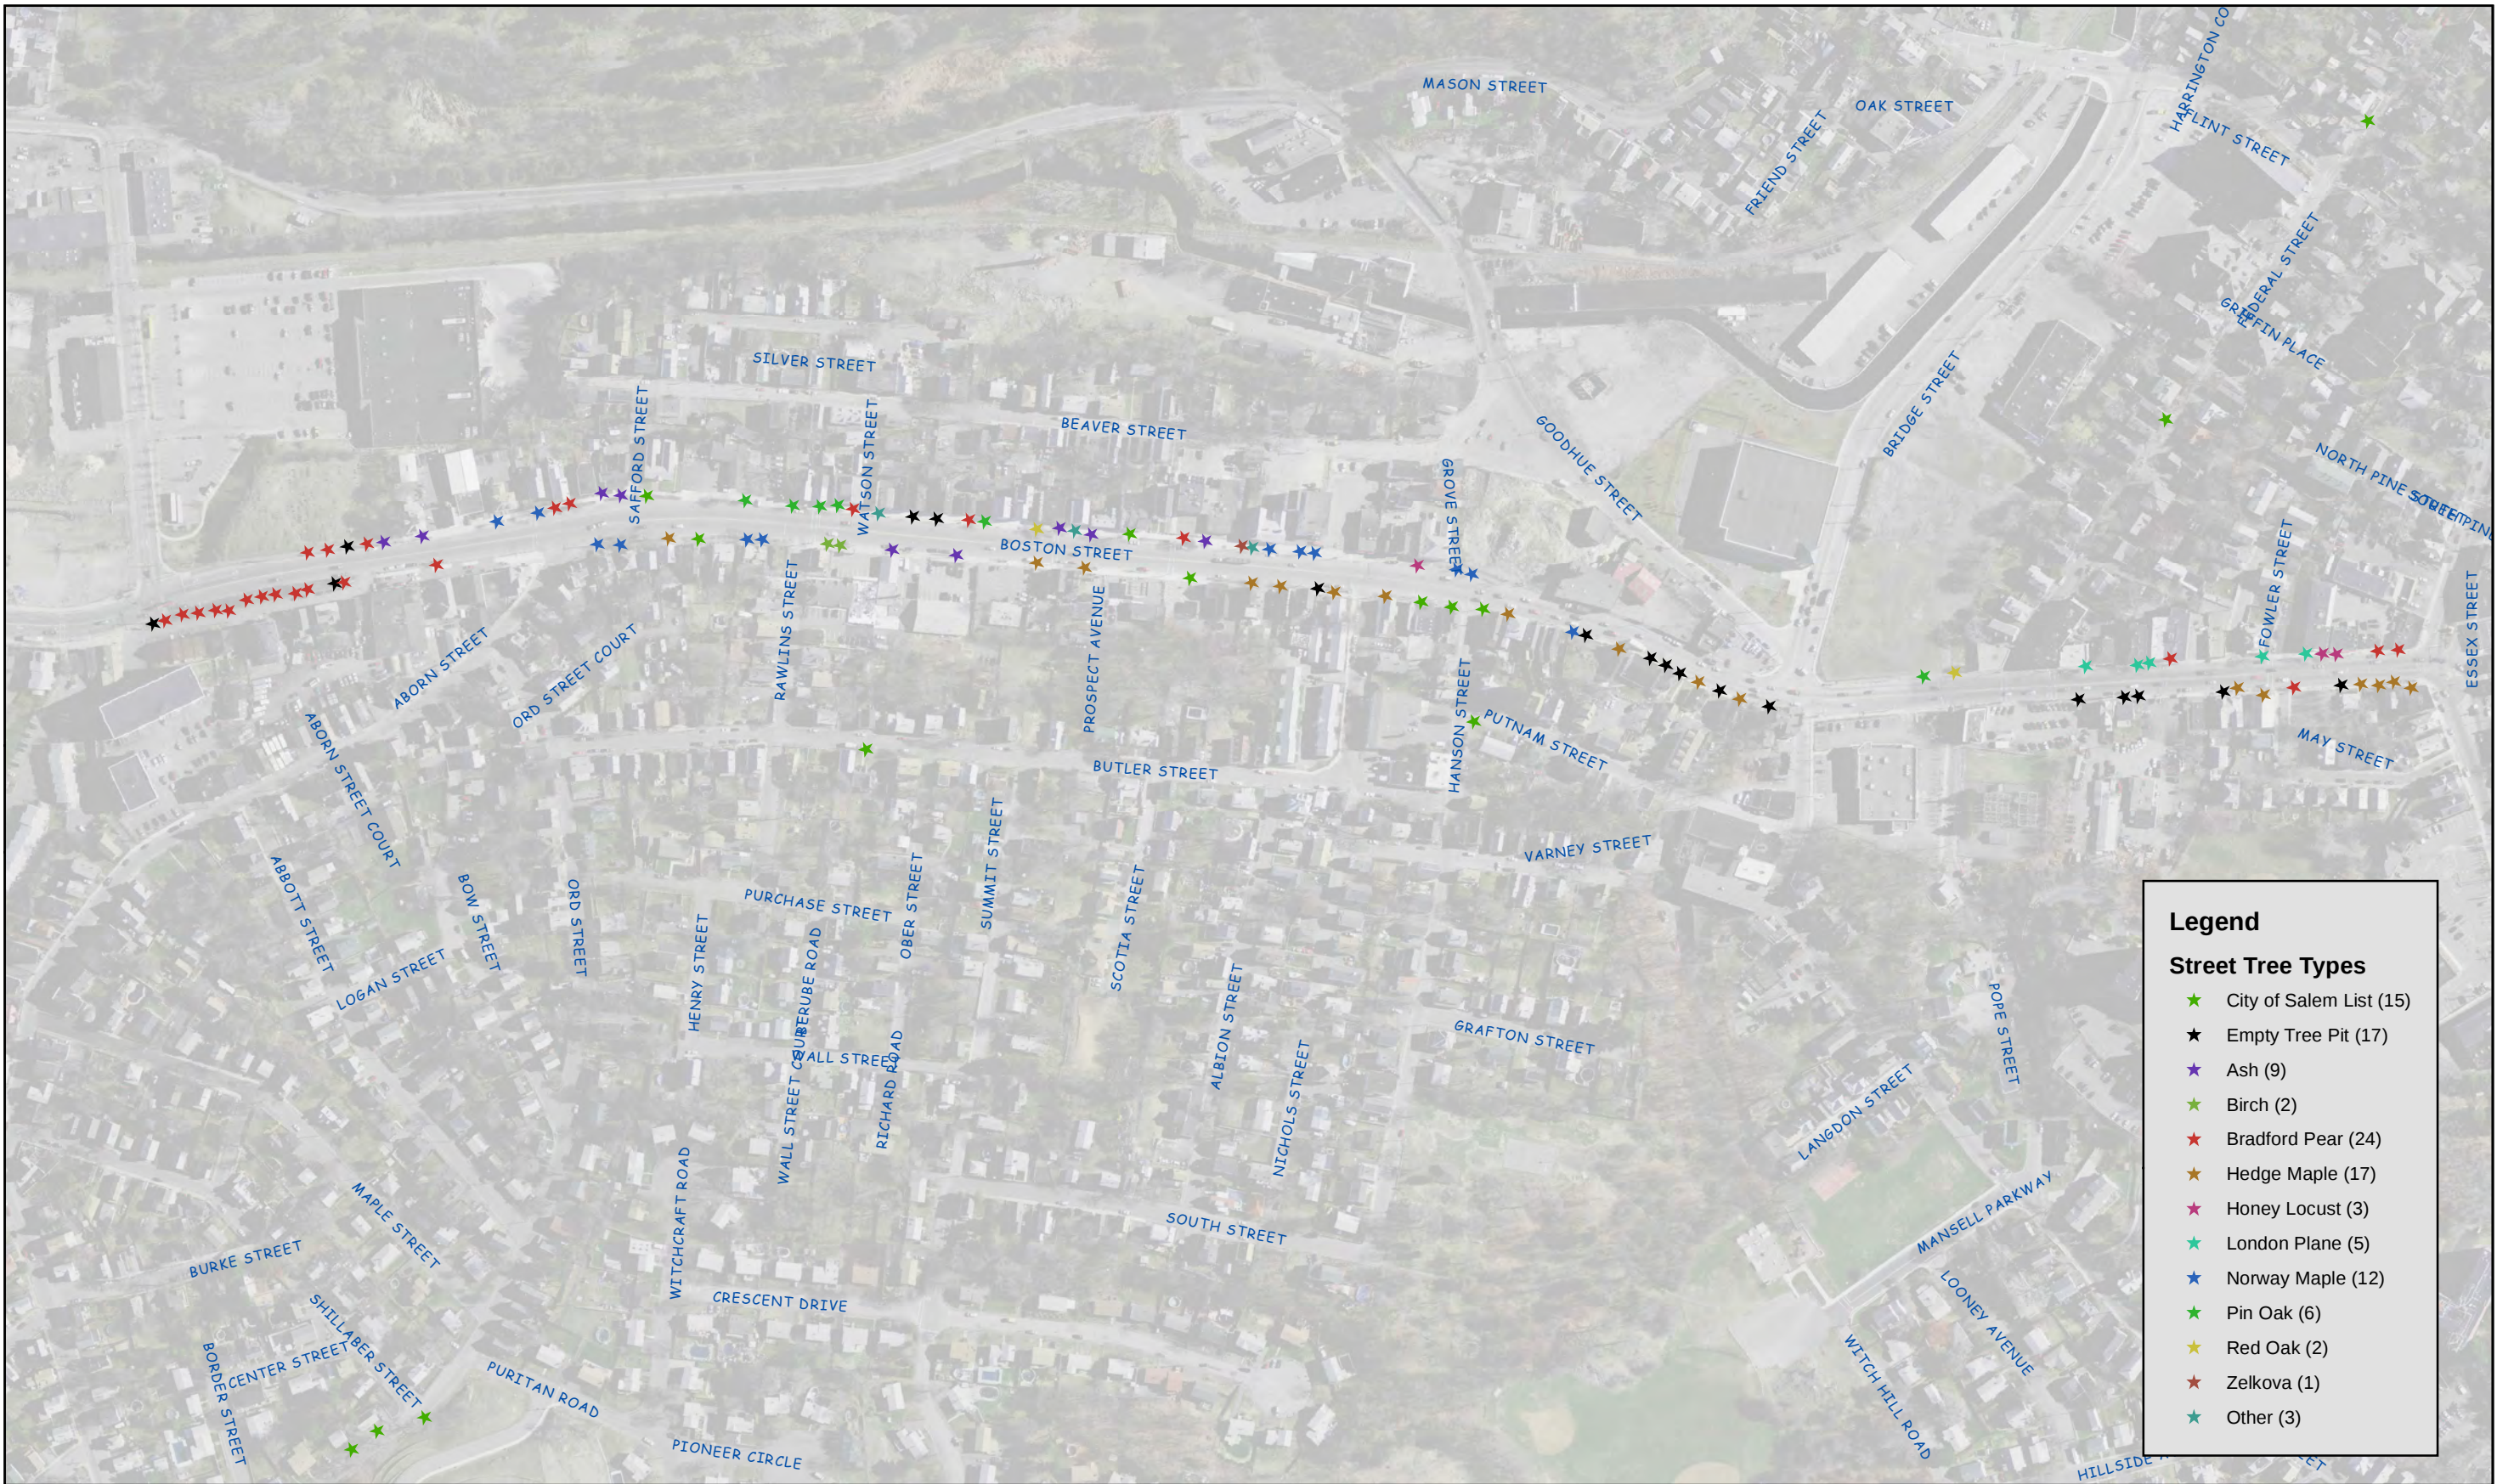

Legend

Street Tree Types

- ★ City of Salem List (15)
- ★ Empty Tree Pit (17)
- ★ Ash (9)
- ★ Birch (2)
- ★ Bradford Pear (24)
- ★ Hedge Maple (17)
- ★ Honey Locust (3)
- ★ London Plane (5)
- ★ Norway Maple (12)
- ★ Pin Oak (6)
- ★ Red Oak (2)
- ★ Zelkova (1)
- ★ Other (3)


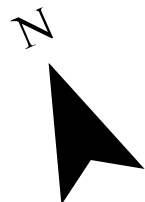


Corridor Street Tree Mapping Pilot - Boston Street Salem, MA

Tuesday, August 23, 2016

0 150 300
Feet

1 inch = 300 feet

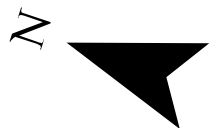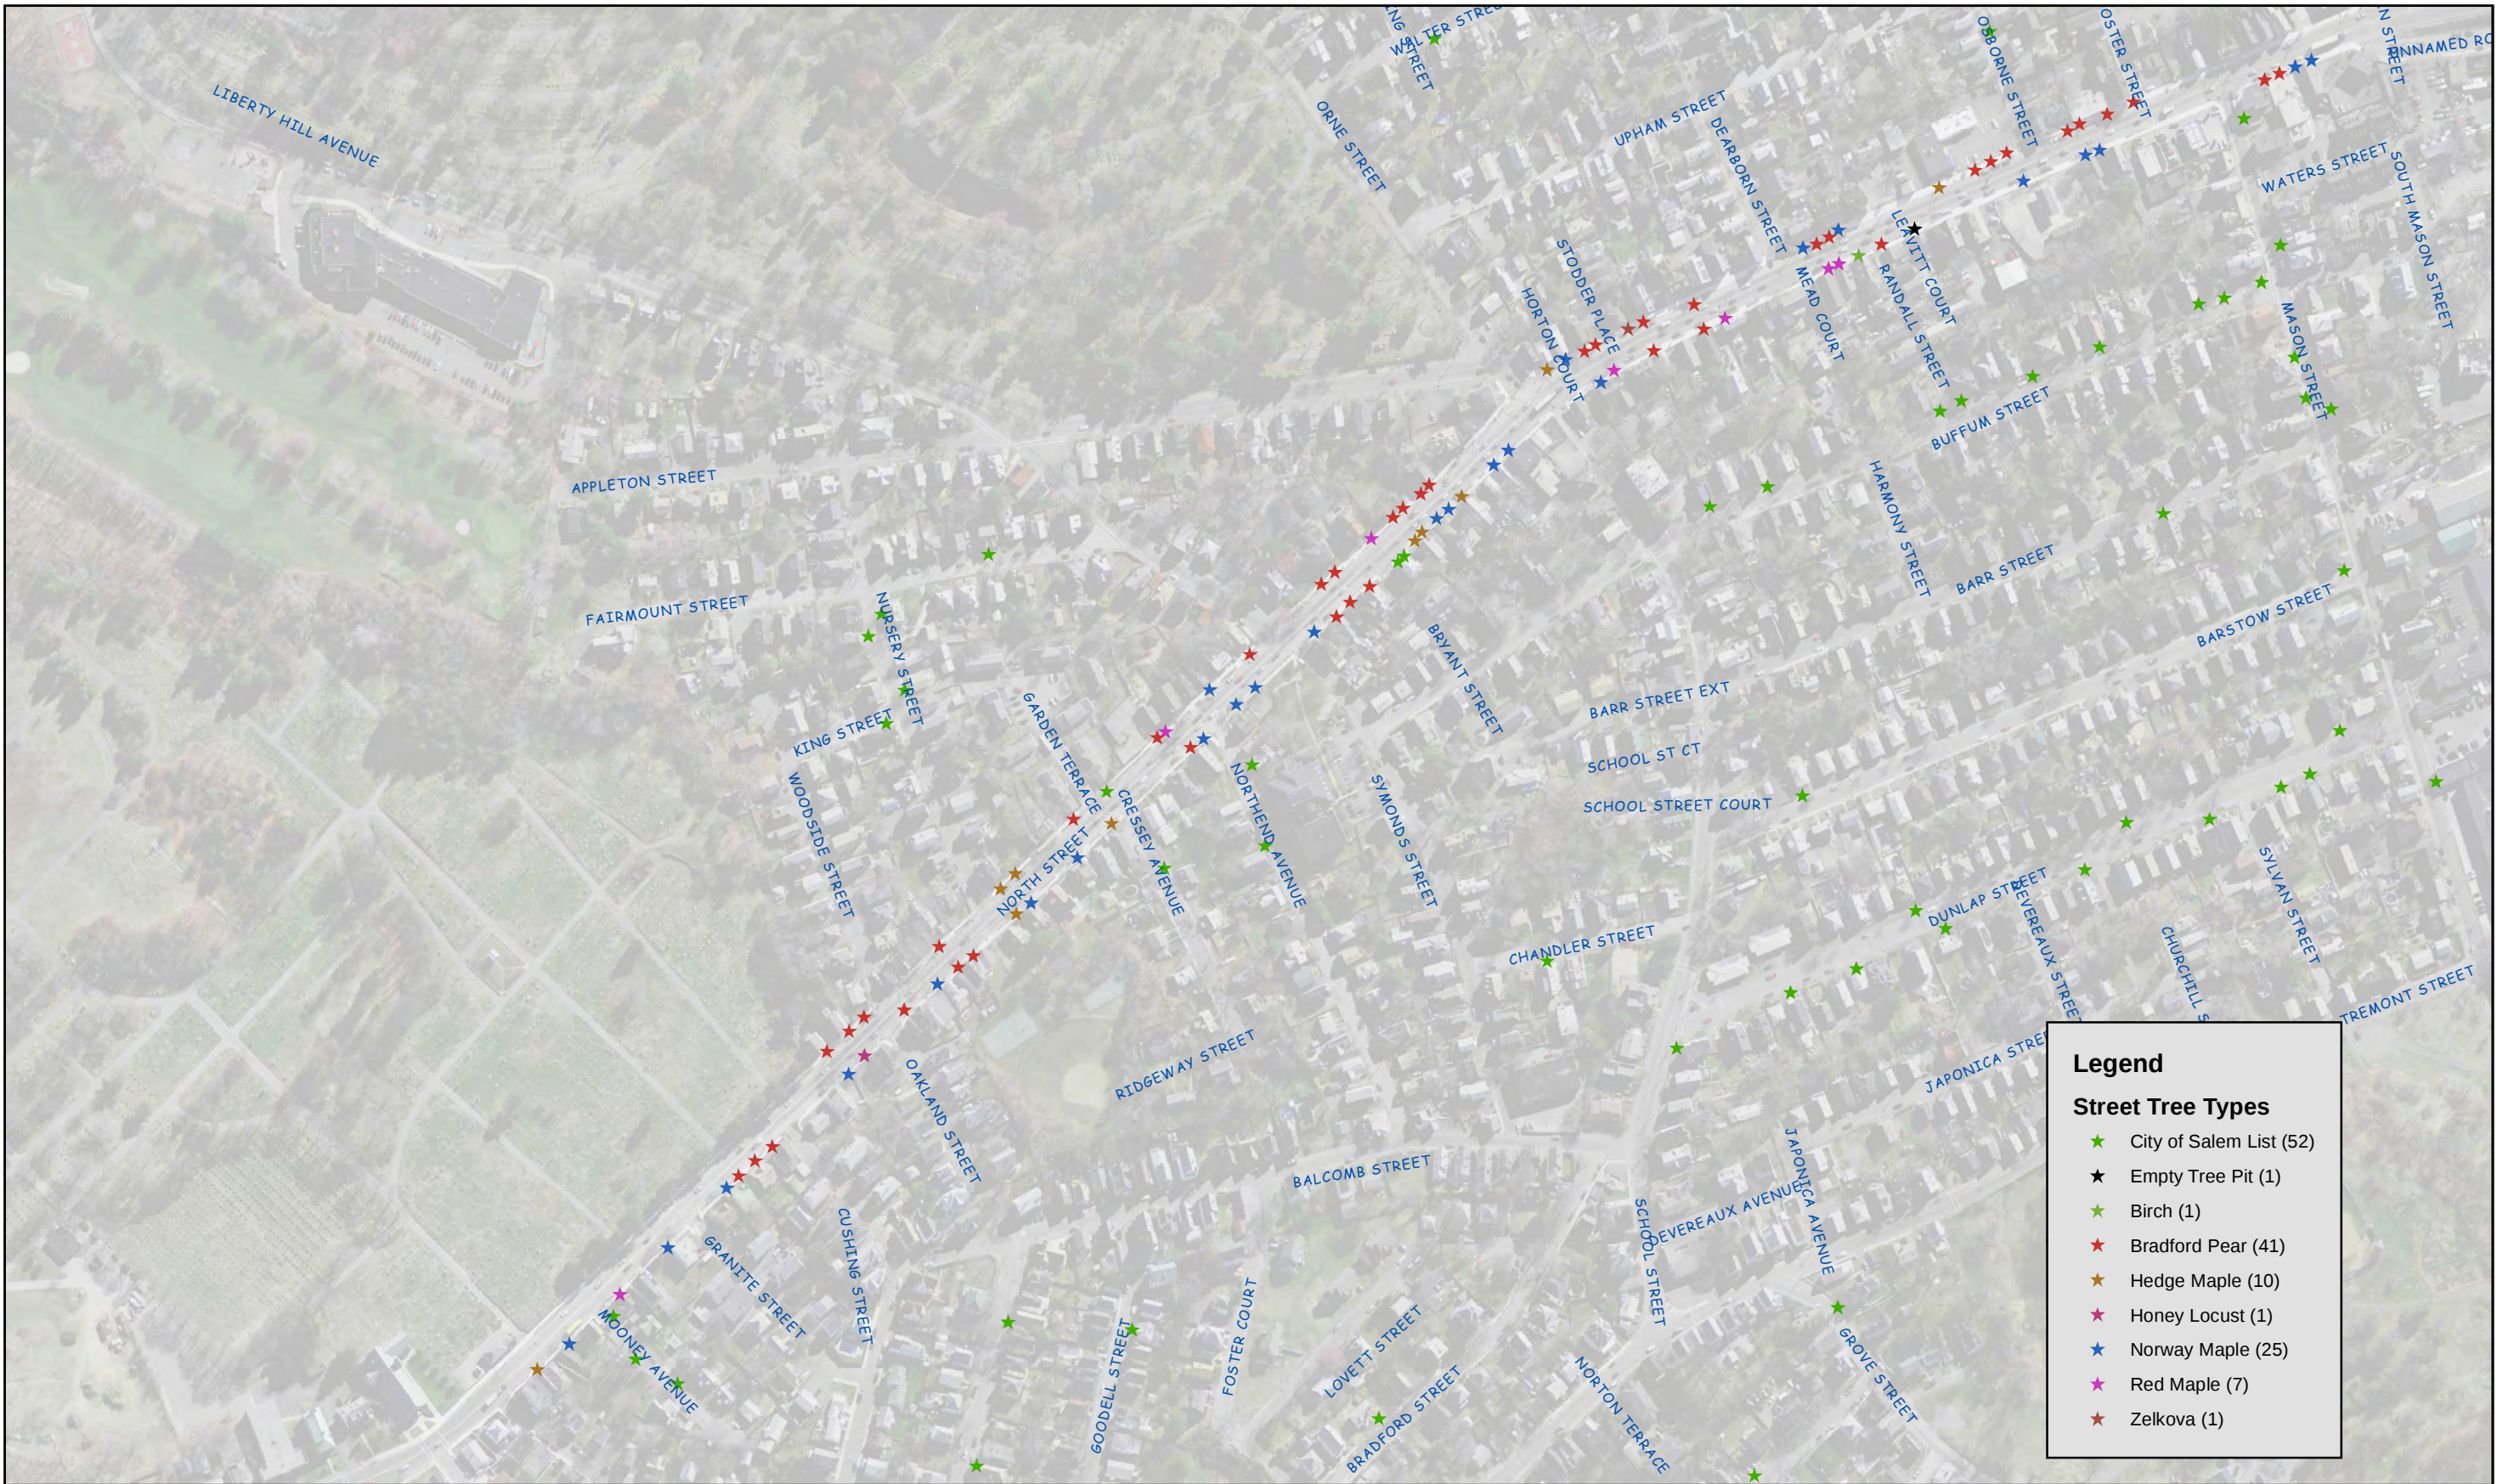

Corridor Street Tree Mapping Pilot - North Street Salem, MA

Tuesday, August 23, 2016

0 150 300
Feet


1 inch = 300 feet



Legend

Street Tree Needs Assessment


- Open Tree Pit (61)
- Stump Removal (16)
- ★ Removal (20)
- ★ Pruning (33)
- ★ Deadwood Removal (7)
- ★ Insect Damage (3)
- ★ No Action Needed (2)

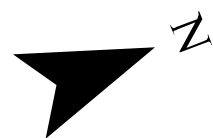

Corridor Street Tree Mapping Pilot - Lafayette Street Salem, MA

Thursday, August 25, 2016


0 250 500
Feet
1 inch = 500 feet

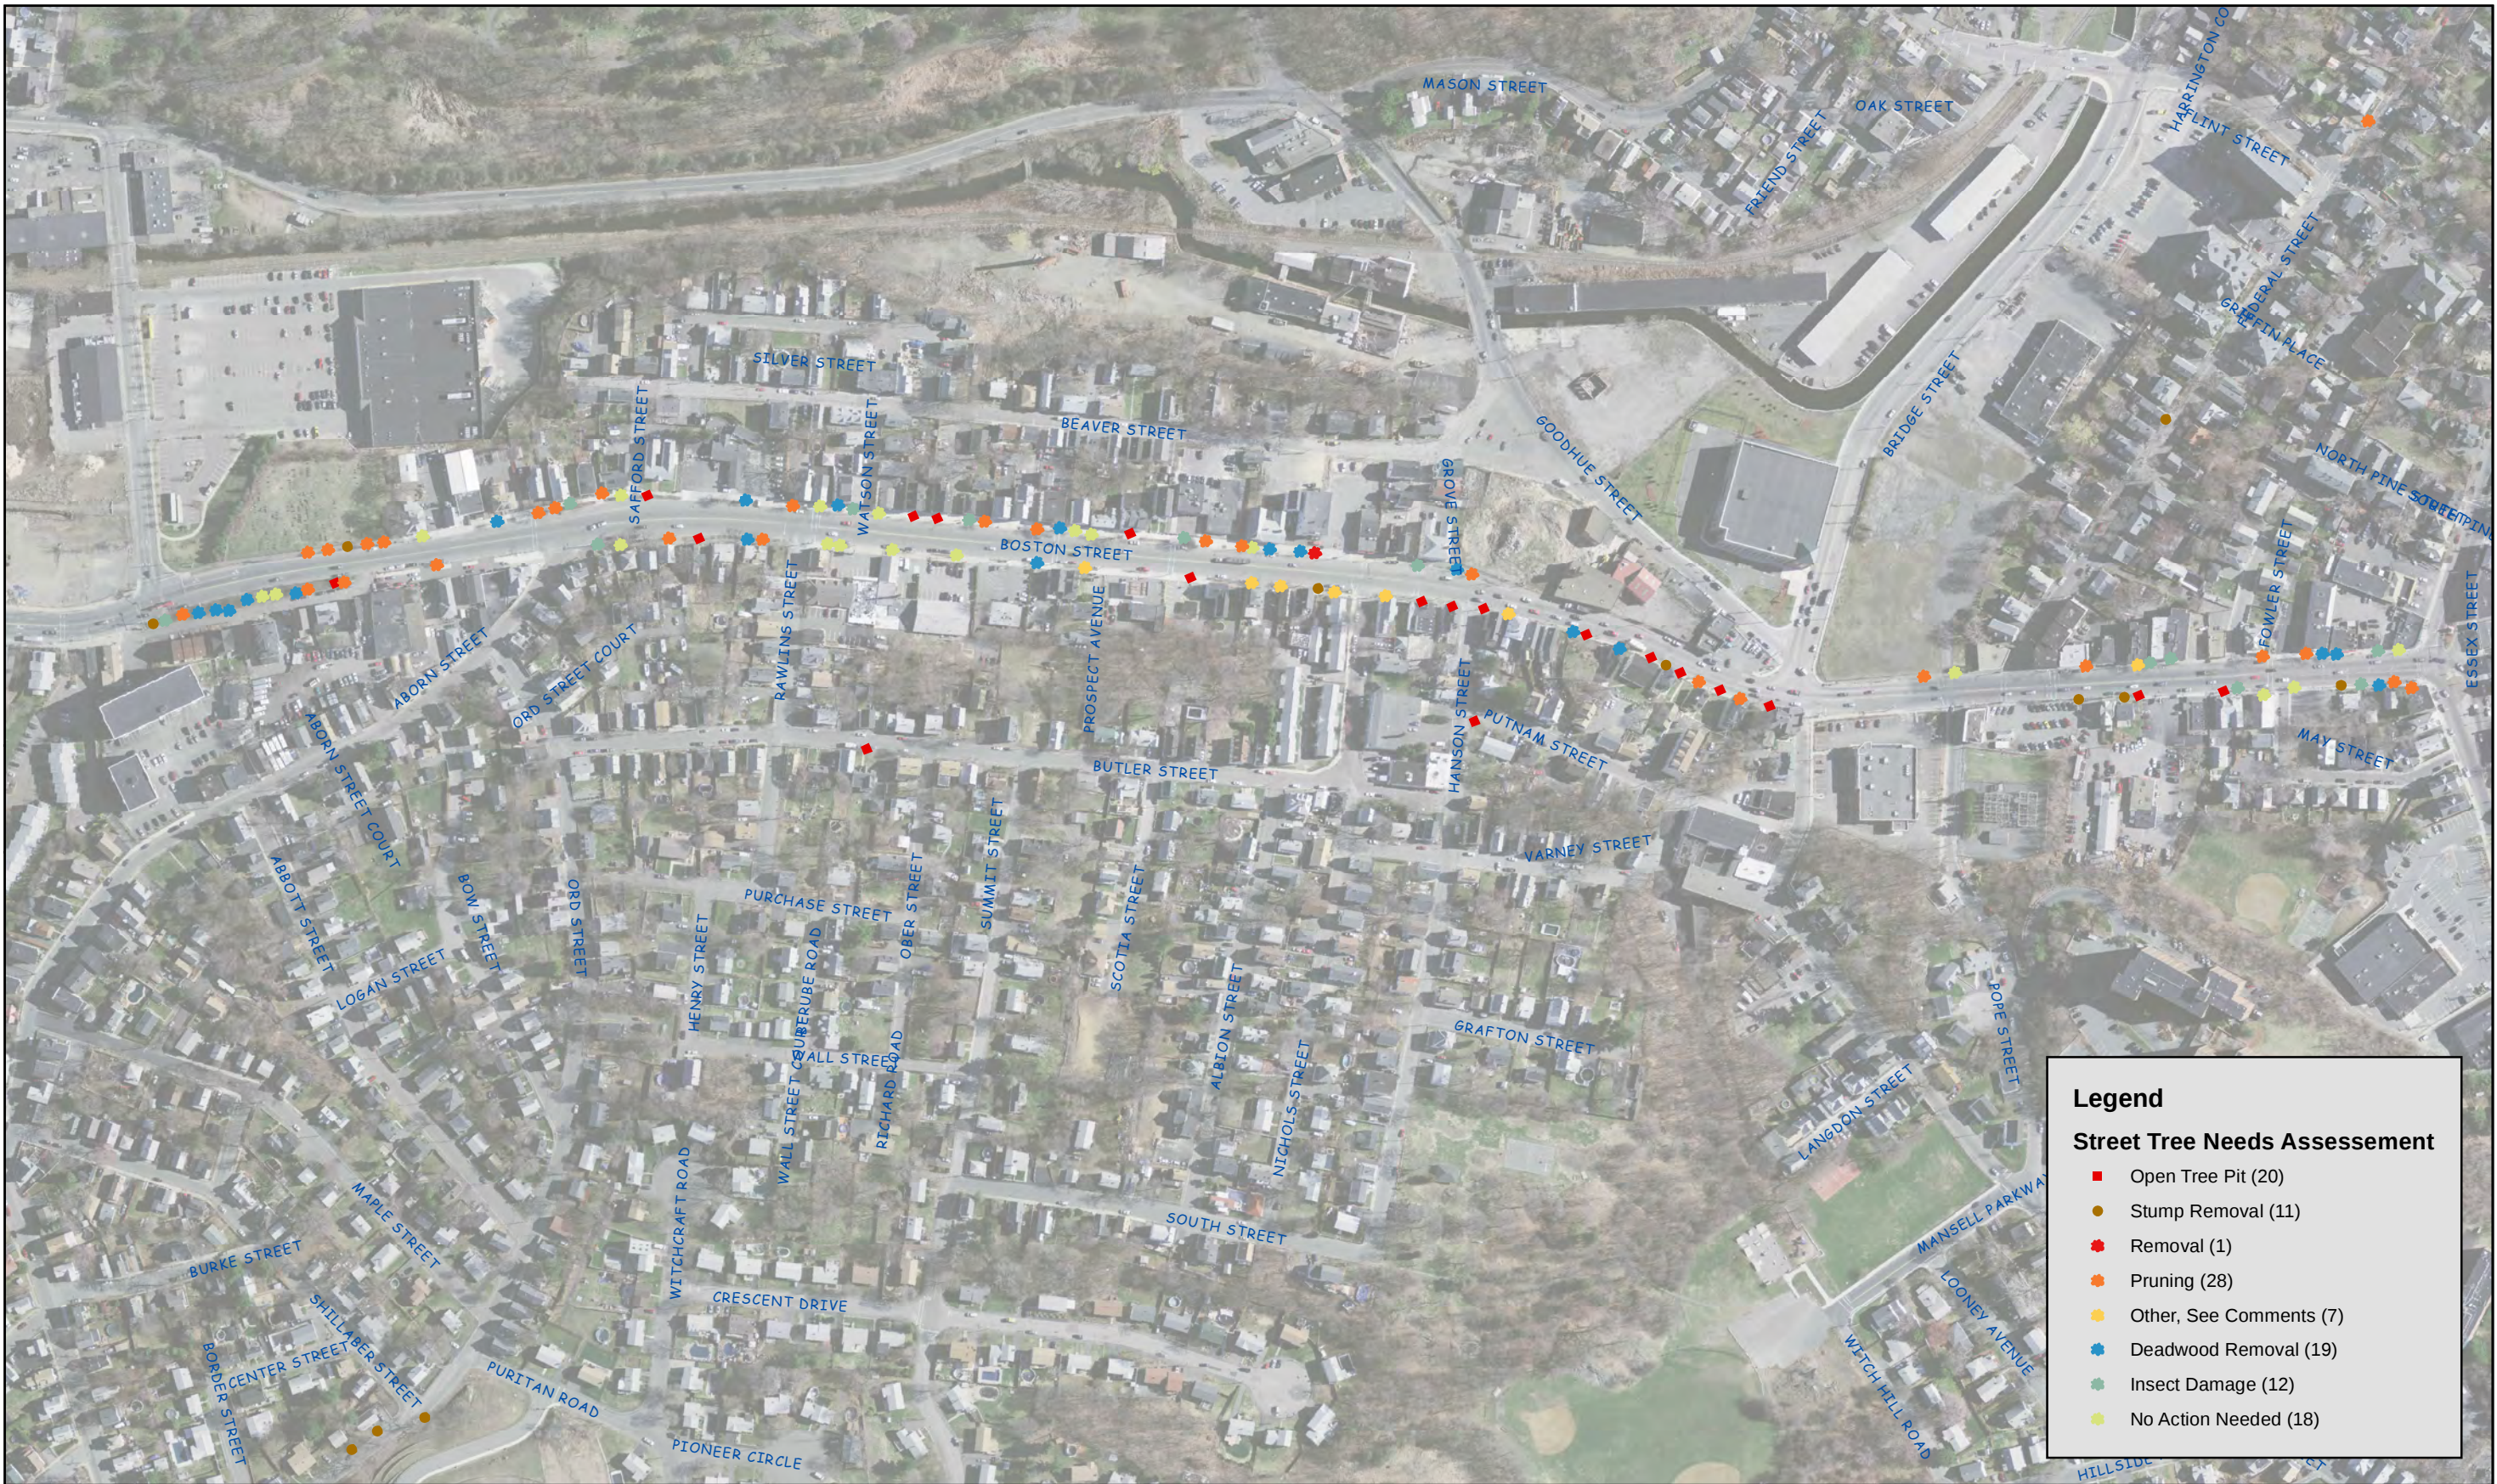


Legend


Street Tree Needs Assessement

- Open Tree Pit (20)
- Stump Removal (11)
- Removal (1)
- Pruning (28)
- Other, See Comments (7)
- Deadwood Removal (19)
- Insect Damage (12)
- No Action Needed (18)

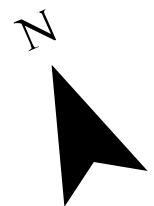

Corridor Street Tree Mapping Pilot - Boston Street
Salem, MA
Thursday, August 25, 2016

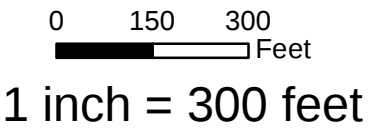

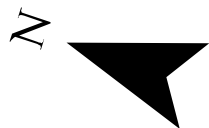

Corridor Street Tree Mapping Pilot - North Street Salem, MA

Thursday, August 25, 2016

0 150 300
Feet

1 inch = 300 feet

Attachment B

Photos of All GPS Located Trees*

*Photos can be accessed through hyperlink in GIS database or cross-referenced through table in Attachment C, column: “Photo Link”





IMG_0413.JPG



IMG_0414.JPG



IMG_0415.JPG



IMG_0416.JPG



IMG_0417.JPG



IMG_0418.JPG



IMG_0419.JPG



IMG_0420.JPG



IMG_0421.JPG



IMG_0422.JPG



IMG_0423.JPG



IMG_0424.JPG



IMG_0425.JPG



IMG_0426.JPG



IMG_0427.JPG



IMG_0428.JPG



IMG_0429.JPG



IMG_0430.JPG



IMG_0431.JPG



IMG_0432.JPG



IMG_0433.JPG



IMG_0434.JPG



IMG_0435.JPG



IMG_0436.JPG



IMG_0438.JPG



IMG_0439.JPG



IMG_0440.JPG



IMG_0441.JPG



IMG_0442.JPG



IMG_0443.JPG



IMG_0444.JPG



IMG_0445.JPG



IMG_0446.JPG



IMG_0447.JPG



IMG_0448.JPG



IMG_0449.JPG




IMG_0450.JPG



IMG_0451.JPG



IMG_0452.JPG

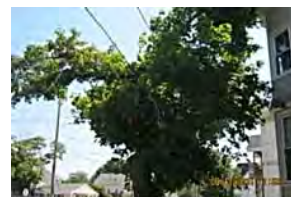

IMG_0453.JPG



IMG_0454.JPG



IMG_0455.JPG



IMG_0456.JPG



IMG_0457.JPG



IMG_0458.JPG



IMG_0459.JPG



IMG_0460.JPG



IMG_0461.JPG



IMG_0462.JPG



IMG_0463.JPG



IMG_0464.JPG



IMG_0465.JPG



IMG_0466.JPG



IMG_0467.JPG



IMG_0468.JPG



IMG_0469.JPG



IMG_0470.JPG



IMG_0471.JPG



IMG_0472.JPG



IMG_0473.JPG



IMG_0474.JPG



IMG_0475.JPG



IMG_0476.JPG



IMG_0477.JPG



IMG_0478.JPG



IMG_0479.JPG



IMG_0480.JPG



IMG_0481.JPG



IMG_0482.JPG



IMG_0483.JPG



IMG_0484.JPG



IMG_0485.JPG



IMG_0486.JPG



IMG_0487.JPG



IMG_0488.JPG



IMG_0489.JPG



IMG_0490.JPG



IMG_0491.JPG



IMG_0492.JPG



IMG_0493.JPG



IMG_0494.JPG



IMG_0495.JPG



IMG_0496.JPG



IMG_0497.JPG



IMG_0498.JPG



IMG_0499.JPG



IMG_0500.JPG



IMG_0501.JPG



IMG_0502.JPG



IMG_0503.JPG



IMG_0504.JPG



IMG_0505.JPG



IMG_0506.JPG



IMG_0507.JPG



IMG_0508.JPG



IMG_0509.JPG



IMG_0510.JPG



IMG_0511.JPG



IMG_0512.JPG



IMG_0513.JPG



IMG_0514.JPG



IMG_0515.JPG



IMG_0516.JPG



IMG_0517.JPG



IMG_0518.JPG



IMG_0519.JPG



IMG_0520.JPG



IMG_0521.JPG



IMG_0522.JPG



IMG_0523.JPG



IMG_0524.JPG



IMG_0525.JPG



IMG_0526.JPG



IMG_0527.JPG



IMG_0528.JPG



IMG_0529.JPG



IMG_0530.JPG



IMG_0531.JPG



IMG_0532.JPG



IMG_0533.JPG



IMG_0534.JPG



IMG_0535.JPG



IMG_0536.JPG



IMG_0537.JPG



IMG_0538.JPG



IMG_0539.JPG



IMG_0540.JPG



IMG_0541.JPG



IMG_0542.JPG



IMG_0543.JPG



IMG_0544.JPG



IMG_0545.JPG



IMG_0546.JPG



IMG_0547.JPG



IMG_0548.JPG



IMG_0549.JPG



IMG_0550.JPG



IMG_0551.JPG



IMG_0552.JPG



IMG_0553.JPG



IMG_0554.JPG



IMG_0555.JPG



IMG_0556.JPG



IMG_0557.JPG



IMG_0558.JPG



IMG_0559.JPG



IMG_0560.JPG



IMG_0561.JPG



IMG_0562.JPG



IMG_0563.JPG



IMG_0564.JPG



IMG_0565.JPG



IMG_0566.JPG



IMG_0567.JPG



IMG_0568.JPG



IMG_0569.JPG



IMG_0570.JPG



IMG_0571.JPG



IMG_0572.JPG



IMG_0573.JPG



IMG_0574.JPG



IMG_0575.JPG



IMG_0576.JPG



IMG_0577.JPG



IMG_0578.JPG



IMG_0579.JPG



IMG_0580.JPG



IMG_0581.JPG



IMG_0582.JPG



IMG_0583.JPG



IMG_0584.JPG



IMG_0585.JPG



IMG_0586.JPG



IMG_0587.JPG



IMG_0588.JPG



IMG_0659.JPG




IMG_0660.JPG



IMG_0661.JPG



IMG_0662.JPG

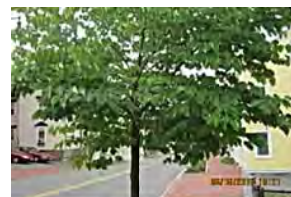

IMG_0663.JPG



IMG_0664.JPG



IMG_0665.JPG



IMG_0666.JPG



IMG_0667.JPG



IMG_0668.JPG



IMG_0669.JPG




IMG_0670.JPG



IMG_0671.JPG



IMG_0672.JPG

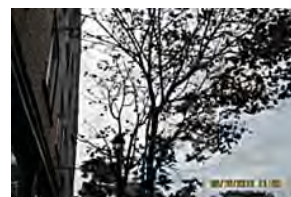

IMG_0673.JPG



IMG_0675.JPG



IMG_0676.JPG



IMG_0677.JPG



IMG_0678.JPG



IMG_0679.JPG



IMG_0680.JPG



IMG_0681.JPG



IMG_0682.JPG



IMG_0683.JPG



IMG_0684.JPG



IMG_0685.JPG



IMG_0686.JPG



IMG_0687.JPG



IMG_0688.JPG



IMG_0689.JPG



IMG_0690.JPG



IMG_0691.JPG




IMG_0692.JPG



IMG_0693.JPG



IMG_0694.JPG

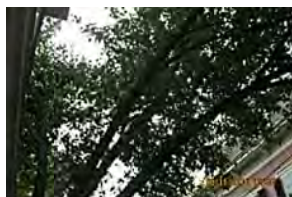

IMG_0730.JPG



IMG_0731.JPG



IMG_0732.JPG



IMG_0734.JPG



IMG_0735.JPG



IMG_0736.JPG



IMG_0737.JPG



IMG_0738.JPG



IMG_0739.JPG



IMG_0740.JPG



IMG_0741.JPG



IMG_0742.JPG



IMG_0743.JPG



IMG_0744.JPG



IMG_0745.JPG



IMG_0746.JPG



IMG_0747.JPG



IMG_0748.JPG



IMG_0749.JPG



IMG_0750.JPG



IMG_0751.JPG



IMG_0753.JPG



IMG_0754.JPG



IMG_0398.JPG



IMG_0400.JPG



IMG_0401.JPG



IMG_0402.JPG



IMG_0403.JPG



IMG_0404.JPG



IMG_0405.JPG



IMG_0406.JPG



IMG_0407.JPG



IMG_0408.JPG



IMG_0409.JPG



IMG_0410.JPG



IMG_0411.JPG



IMG_0412.JPG

Attachment C

Database Table of All GPS Located Trees
&
Tree Warden Excel Sheet Incorporated into
Database



Street Number	Street Name	Ward	ID	Tree Present	Name	Genus	Species	Photo Link	Diameter	Height	Quantity	Condition	Trunk Injury	Surrounding Sidewalk Material	Sidewalk Condition	Wires	Comments	Priority	Resolution	Action Taken	Land Use	Owner	Install Date	Last Update	Last Editor
22	Beckford Street	0	Beckford-01	Yes	Norway Maple	Acer	platanoides	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0729.JPG	5	15	0	Fair	No	Brick	Fair	No		0	None		Residential	Municipality	Unknown	8/16/2016	NECE
22	Beckford Street	0	Beckford-02	Yes	Bradford Pear	Pyrus	calleryana	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0730.JPG	24	25	1	Good	No	Brick	Fair	Yes		0	None		Residential	Municipality	Unknown	8/16/2016	NECE
20	Beckford Street	0	Beckford-03	Yes	Norway Maple	Acer	platanoides	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0731.JPG	22	30	1	Good	No	Brick	Heaving	Yes		0	None		Residential	Municipality	Unknown	8/16/2016	NECE
20	Beckford Street	0	Beckford-04	No	Other - See Comments			H:\Clients\Salem\Street Tree Survey\Photos\IMG_0732.JPG	0	0	1	Other/Unknown		Brick	Fair	No	empty tree pit	0	Other - See Comments		Residential	Municipality	Unknown	8/16/2016	NECE
18	Beckford Street	0	Beckford-05	Yes	Bradford Pear	Pyrus	calleryana	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0733.JPG	24	25	1	Good	No	Brick	Heaving	Yes		0	None		Residential	Municipality	Unknown	8/16/2016	NECE
14	Beckford Street	0	Beckford-06	No	Other - See Comments			H:\Clients\Salem\Street Tree Survey\Photos\IMG_0734.JPG	0	0	1	Other/Unknown		Brick	issing Cobble/Bri	No	empty tree pit	0	Other - See Comments		Residential	Municipality	Unknown	8/16/2016	NECE
4	Beckford Street	0	Beckford-07	Yes	Norway Maple	Acer	platanoides	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0735.JPG	46	70	1	Poor	No	Bit. Pavement	Good	Yes		0	None		Residential	Municipality	Unknown	8/16/2016	NECE
3	Beckford Street	0	Beckford-08	Yes	Norway Maple	Acer	platanoides	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0736.JPG	10	25	1	Fair	No	Brick	Fair	Yes	missing tree box; roots still square	0	Pruning		Residential	Municipality	Unknown	8/16/2016	NECE
0	Boston Street	0	Boston-01	Yes	Bradford Pear	Pyrus	calleryana	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0510.JPG	7	14	1	Good	No	Concrete	Good	No		0	None		Commercial	Municipality	Unknown	8/12/2016	NECE
4	Boston Street	0	Boston-02	Yes	Bradford Pear	Pyrus	calleryana	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0511.JPG	8	20	1	Fair	Yes	Concrete	Good	No	maybe bradford pear; see leaf pic; tape around middle of tree	0	Insect Damage		Commercial	Municipality	Unknown	8/12/2016	NECE
6	Boston Street	0	Boston-03	Yes	Honey Locust	Gleditsia	triacanthos	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0512.JPG	16	30	1	Poor	No	Concrete	Good	No	many dead banches; leaves are sparse	0	Deadwood Removal		Commercial	Municipality	Unknown	8/12/2016	NECE
10	Boston Street	0	Boston-04	Yes	Honey Locust	Gleditsia	triacanthos	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0513.JPG	18	30	1	Fair	No	Concrete	Good	No	many dead branches; leaves are sparse	0	Deadwood Removal		Commercial	Municipality	Unknown	8/12/2016	NECE
10	Boston Street	0	Boston-05	Yes	London Plane	Platanus	acerifolia	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0514.JPG	16	30	1	Fair	No	Concrete	Good	Yes		0	Pruning		Commercial	Municipality	Unknown	8/12/2016	NECE
16	Boston Street	0	Boston-06	Yes	London Plane	Platanus	acerifolia	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0515.JPG	20	35	1	Fair	No	Bit. Pavement	Good	No		0	Pruning		Residential	Municipality	Unknown	8/12/2016	NECE
22	Boston Street	0	Boston-07	Yes	Bradford Pear	Pyrus	calleryana	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0516.JPG	18	30	1	Fair	No	Concrete	Fair	Yes		0	Insect Damage		Residential	Municipality	Unknown	8/12/2016	NECE
24	Boston Street	4	Boston-08	Yes	London Plane	Platanus	acerifolia	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0517.JPG	22	40	3	Fair	No	Concrete	Heaving	Yes		2	Insect Damage		Residential	Municipality	Unknown	8/12/2016	NECE
26	Boston Street	0	Boston-09	Yes	London Plane	Platanus	acerifolia	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0518.JPG	18	40	1	Fair	No	Concrete	Fair	Yes	dry	0	Other - See Comments		Residential	Municipality	Unknown	8/12/2016	NECE
36	Boston Street	4	Boston-10	Yes	London Plane	Platanus	acerifolia	H:\Clients\Salem\Street Tree Survey\Photos\IMG_5170.JPG	24	30	1	Fair	No	Concrete	Heaving	Yes		3	Pruning		Residential	Municipality	Unknown	8/12/2016	NECE
3	Boston Street	0	Boston-100	Yes	Hedge Maple	Acer	campestre	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0609.JPG	10	20	1	Fair	No	Concrete	Good	Yes	dead branches	0	Deadwood Removal		Residential	Municipality	Unknown	8/15/2016	NECE
3	Boston Street	0	Boston-101	Yes	Hedge Maple	Acer	campestre	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0610.JPG	12	25	1	Fair	No	Concrete	Good	Yes		0	Pruning		Residential	Municipality	Unknown	8/15/2016	NECE
1	Boston Street	0	Boston-102	Yes	Hedge Maple	Acer	campestre	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0611.JPG	12	25	1	Fair	No	Concrete	Fair	Yes	flowers in tree box	0	Pruning		Commercial	Municipality	Unknown	8/15/2016	NECE
44	Boston Street	0	Boston-11	Yes	Red Oak	Quercus	rubra	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0520.JPG	16	45	1	Good	No	Bit. Pavement	Heaving	No		0	None		Commercial	Municipality	Unknown	8/12/2016	NECE
44	Boston Street	0	Boston-12	Yes	Pin Oak	Quercus	palustris	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0521.JPG	10	25	1	Fair	No	Bit. Pavement	Fair	No	street sign falling onto tree	0	Pruning		Commercial	Municipality	Unknown	8/12/2016	NECE
92	Boston Street	0	Boston-13	Yes	Norway Maple	Acer	platanoides	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0522.JPG	10	25	1	Fair	No	Bit. Pavement	Fair	No		0	Pruning		Commercial	Municipality	Unknown	8/15/2016	NECE
92	Boston Street	0	Boston-14	Yes	Norway Maple	Acer	platanoides	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0523.JPG	12	25	1	Fair	Yes	Bit. Pavement	Fair	No	dead branches on 1/2 of tree	0	Deadwood Removal		Commercial	Municipality	Unknown	8/15/2016	NECE
96	Boston Street	4	Boston-15	Yes	Honey Locust	Gleditsia	triacanthos	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0524.JPG	14	30	1	Fair	Yes	Bit. Pavement	Fair	No	trunk injury on sidewalk side	3	Insect Damage		Commercial	Municipality	Unknown	8/15/2016	NECE
104	Boston Street	0	Boston-16	Yes	Norway Maple	Acer	platanoides	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0525.JPG	5	15	1	Poor	No	Concrete	Fair	No	many dead branches; sparse leaves; dry	0	Removal		Commercial	Municipality	Unknown	8/15/2016	NECE
104	Boston Street	0	Boston-17	Yes	Norway Maple	Acer	platanoides	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0526.JPG	16	25	1	Fair	No	Concrete	Fair	Yes	dead branches; leaves are dark red	0	Deadwood Removal		Commercial	Municipality	Unknown	8/15/2016	NECE
106	Boston Street	0	Boston-18	Yes	Norway Maple	Acer	platanoides	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0527.JPG	16	25	1	Poor	No	Concrete	Fair	Yes	many large dead branches	0	Deadwood Removal		Residential	Municipality	Unknown	8/15/2016	NECE
108	Boston Street	0	Boston-19	Yes	Other - See Comments	Ginkgo	biloba	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0528.JPG	18	30	1	Good	No	Concrete	Good	Yes	Ginkgo	0	None		Commercial	Municipality	Unknown	8/15/2016	NECE
108	Boston Street	0	Boston-20	Yes	Zelkova	Zelkova	serrata	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0529.JPG	5	13	1	Fair	No	Concrete	Good	No		0	Pruning		Commercial	Municipality	Unknown	8/15/2016	NECE
110	Boston Street	0	Boston-21	Yes	Ash	Fraxinus		H:\Clients\Salem\Street Tree Survey\Photos\IMG_0530.JPG	20	35	1	Good	No	Concrete	Good	Yes		0	Pruning		Commercial	Municipality	Unknown	8/15/2016	NECE
110	Boston Street	4	Boston-22	Yes	Bradford Pear	Pyrus	calleryana	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0531.JPG	30	35	1	Fair	No	Concrete	Good	Yes	overlapping branches w/ ash tree	3	Insect Damage		Commercial	Municipality	Unknown	8/15/2016	NECE
118	Boston Street	0	Boston-23	Yes	Ash	Fraxinus	pennsylvanica	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0532.JPG	16	30	1	Good	No	Concrete	Fair	No	green ash	0	None		Commercial	Municipality	Unknown	8/15/2016	NECE
120	Boston Street	0	Boston-24	Yes	Other - See Comments	Ginkgo	biloba	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0533.JPG	10	20	1	Good	No	Concrete	Good	No	Ginkgo; weeds	0	None		Residential	Municipality	Unknown	8/15/2016	NECE
120	Boston Street	0	Boston-25	Yes	Ash	Fraxinus	nigra	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0534.JPG	36	40	1	Fair	No	Concrete	Fair	Yes	black ash; weeds	0	Deadwood Removal		Commercial	Municipality	Unknown	8/15/2016	NECE
122	Boston Street	0	Boston-26	Yes	Red Oak	Quercus	rubra	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0535.JPG	32	45	1	Fair	No	Concrete	Good	Yes	dead branches; weeds	0	Pruning		Commercial	Municipality	Unknown	8/15/2016	NECE
126	Boston Street	0	Boston-27	Yes	Pin Oak	Quercus	palustris	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0536.JPG	24	50	1	Good	No	Concrete	Good	No		0	Pruning		Residential	Municipality	Unknown	8/15/2016	NECE
128	Boston Street	0	Boston-28	Yes	Bradford Pear	Pyrus	calleryana	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0537.JPG	5	14	1	Fair	No	Concrete	Fair	No		0	Insect Damage		Residential	Municipality	Unknown	8/15/2016	NECE
130	Boston Street	0	Boston-29	No				H:\Clients\Salem\Street Tree Survey\Photos\IMG_0538.JPG	0	0	1	Other/Unknown		Concrete	Good	No	tree pit	0	Other - See Comments		Residential	Municipality	Unknown	8/15/2016	NECE
132	Boston Street	0	Boston-30	No				H:\Clients\Salem\Street Tree Survey\Photos\IMG_0539.JPG	0	0	1	Other/Unknown		Concrete	Good	No	tree pit; currently planted w/ flowers	0	Other - See Comments		Residential	Municipality	Unknown	8/15/2016	NECE
134	Boston Street	0	Boston-31	Yes	Other - See Comments	Ginkgo	biloba	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0540.JPG	10	20	1	Good	No	Concrete	Good	No	Ginkgo	0	None		Residential	Municipality	Unknown	8/15/2016	NECE
136	Boston Street	0	Boston-32	Yes	Bradford Pear	Pyrus	calleryana	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0543.JPG	5	25	1	Fair	No	Concrete	Good	No		0	Insect Damage		Commercial	Municipality	Unknown	8/15/2016	NECE
136	Boston Street	0	Boston-33	Yes	Pin Oak	Quercus	palustris	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0542.JPG	18	30	1	Fair	No	Concrete	Good	No	tree pit very dry	0	Deadwood Removal		Commercial	Municipality	Unknown	8/15/2016	NECE
138	Boston Street	0	Boston-34	Yes	Pin Oak	Quercus	palustris	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0543.JPG	24	40	1	Fair	No	Concrete	Fair	Yes	branches only on one side due to house	0	None		Residential	Municipality	Unknown	8/15/2016	NECE
140	Boston Street	0	Boston-35	Yes	Pin Oak	Quercus	palustris	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0544.JPG	24	50	1	Good	No	Concrete	Good	Yes		0	Pruning		Residential	Municipality	Unknown	8/15/2016	NECE
146	Boston Street	4	Boston-36	Yes	Pin Oak	Quercus	palustris	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0545.JPG	30	50	1	Fair	No	Concrete	Good	No	dead branches	1	Deadwood Removal		Commercial	Municipality	Unknown	8/15/2016	NECE
152	Boston Street	0	Boston-37	Yes	Ash	Fraxinus	nigra	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0546.JPG	18	30	1	Good	No	Concrete	Good	No		0	None		Residential	Municipality	Unknown	8/15/2016	NECE
154	Boston Street	0	Boston-38	Yes	Ash	Fraxinus	nigra	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0547.JPG	18	30	1	Fair	Yes	Concrete	Good	No	black ash	0	Pruning		Residential	Municipality	Unknown	8/15/2016	NECE
156	Boston Street	0	Boston-39	Yes	Bradford Pear	Pyrus	calleryana	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0548.JPG	36	55	1	Fair	No	Concrete	Good	Yes		0	Insect Damage		Residential	Municipality	Unknown	8/15/2016	NECE
156	Boston Street	0	Boston-40	Yes	Bradford Pear	Pyrus	calleryana	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0549.JPG	40	55	1	Fair	No	Concrete	Good	No	no low branches	0	Pruning		Residential	Municipality	Unknown	8/15/2016	NECE
158	Boston Street	0	Boston-41	Yes	Norway Maple	Acer	platanoides	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0550.JPG	24	30	1	Fair	No	Concrete	Good	Yes		0	Pruning		Residential	Municipality	Unknown	8/15/2016	NECE
160	Boston Street	4	Boston-42	Yes	Norway Maple	Acer	platanoides	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0551.JPG	18	30	1	Fair	No	Concrete	Fair	No	dead branches	3	Deadwood Removal		Residential	Municipality	Unknown	8/15/2016	NECE
166	Boston Street	0	Boston-43	Yes	Ash	Fraxinus		H:\Clients\Salem\Street Tree Survey\Photos\IMG_0552.JPG	16	25	1	Good	No	Concrete	Fair	Yes		0	None		Residential	Municipality	Unknown	8/15/2016	NECE
0	Boston Street	0	Boston-44	Yes	Ash	Fraxinus		H:\Clients\Salem\Street Tree Survey\Photos\IMG_0553.JPG	18	20	1	Fair	No	Bit. Pavement	Heaving	No		0	Pruning		Residential	Municipality	Unknown	8/15/2016	NECE
171	Boston Street	4	Boston-45	Yes	Bradford Pear	Pyrus	calleryana	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0554.JPG	16	20	1	Fair	No	Bit. Pavement	Heaving	No		3	Pruning		Residential	Municipality	Unknown	8/15/2016	NECE
0	Boston Street	0	Boston-46	Stump	Other - See Comments			H:\Clients\Salem\Street Tree Survey\Photos\IMG_0555.JPG	0	0	1	Other/Unknown		Bit. Pavement	Fair	No	weeds growing out of stump	0	Other - See Comments		Residential	Municipality	Unknown	8/15/2016	NECE
0	Boston Street	0	Boston-47	Yes	Bradford Pear	Pyrus	calleryana	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0556.JPG	7	15	1	Fair	No	Bit. Pavement	Heaving	No	weeds at base of trunk	0	Pruning		Residential	Municipality	Unknown	8/15/2016	NECE
0	Boston Street	0	Boston-48	Yes	Bradford Pear	Pyrus	calleryana	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0557.JPG	8	15	1	Fair	No	Bit. Pavement	Heaving	No		0	Pruning		Residential	Municipality	Unknown	8/15/2016	NECE
0	Boston Street	0	Boston-50	Stump	Other - See Comments			H:\Clients\Salem\Street Tree Survey\Photos\IMG_0559.JPG	0	0	1	Other/Unknown		Bit. Pavement	Fair	Yes		0	Other - See Comments		Residential	Municipality	Unknown	8/15/2016	NECE
0	Boston Street	0	Boston-51	Yes	Bradford Pear	Pyrus	calleryana	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0560.JPG	20	25	1	Fair	No	Bit. Pavement	Fair	Yes		0	Insect Damage		Residential	Municipality	Unknown	8/15/2016	NECE
0	Boston Street	0	Boston-52	Yes	Bradford Pear	Pyrus																			

Street Number	Street Name	Ward	ID	Tree Present	Name	Genus	Species	Photo Link	Diameter	Height	Quantity	Condition	Trunk Injury	Surrounding Sidewalk Material	Sidewalk Condition	Wires	Comments	Priority	Resolution	Action Taken	Land Use	Owner	Install Date	Last Update	Last Editor
135	Boston Street	0	Boston-72	Yes	Ash	Fraxinus	pennsylvanica	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0581.JPG	6	20	1	Good	No	Concrete	Good	Yes	green ash	0	None		Residential	Municipality	Unknown	8/15/2016	NECE
123	Boston Street	0	Boston-73	Yes	Hedge Maple	Acer	campestre	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0582.JPG	8	20	1	Poor	No	Concrete	Fair	Yes	many dead branches	0	Deadwood Removal		Commercial	Municipality	Unknown	8/15/2016	NECE
123	Boston Street	0	Boston-74	Yes	Hedge Maple	Acer	campestre	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0583.JPG	18	20	1	Fair	No	Concrete	Good	Yes	ver dry	0	Other - See Comments		Residential	Municipality	Unknown	8/15/2016	NECE
113	Boston Street	0	Boston-75	Yes	Hedge Maple	Acer	campestre	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0584.JPG	16	20	1	Poor	No	Bit. Pavement	Fair	Yes	very dry	0	Other - See Comments		Residential	Municipality	Unknown	8/15/2016	NECE
109	Boston Street	0	Boston-76	Yes	Hedge Maple	Acer	campestre	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0585.JPG	18	20	1	Fair	No	Bit. Pavement	Fair	Yes	trash and weeds	0	Other - See Comments		Residential	Municipality	Unknown	8/15/2016	NECE
107	Boston Street	0	Boston-77	Stump	Other - See Comments			H:\Clients\Salem\Street Tree Survey\Photos\IMG_0586.JPG	10	0	1	Other/Unknown		Concrete	Fair	No	stump removal	0	Other - See Comments		Residential	Municipality	Unknown	8/15/2016	NECE
107	Boston Street	0	Boston-78	Yes	Hedge Maple	Acer	campestre	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0587.JPG	18	20	1	Poor	No	Concrete	Good	Yes	very dry	0	Other - See Comments		Residential	Municipality	Unknown	8/15/2016	NECE
103	Boston Street	0	Boston-79	Yes	Hedge Maple	Acer	campestre	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0588.JPG	10	20	1	Fair	No	Bit. Pavement	Fair	Yes	dry; trash	0	Other - See Comments		Residential	Municipality	Unknown	8/15/2016	NECE
87	Boston Street	0	Boston-80	Yes	Hedge Maple	Acer	campestre	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0589.JPG	8	20	1	Fair	No	Bit. Pavement	Heaving	Yes	dry; trash	0	Other - See Comments		Residential	Municipality	Unknown	8/15/2016	NECE
79	Boston Street	0	Boston-81	Yes	Norway Maple	Acer	platanoides	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0590.JPG	8	20	1	Poor	No	Concrete	Fair	Yes	dry; insect damage; weeds; trash	0	Deadwood Removal		Residential	Municipality	Unknown	8/15/2016	NECE
79	Boston Street	0	Boston-82	No	Other - See Comments			H:\Clients\Salem\Street Tree Survey\Photos\IMG_0591.JPG	0	0	1	Other/Unknown		Concrete	Good	Yes	tree pit	0	Other - See Comments		Residential	Municipality	Unknown	8/15/2016	NECE
79	Boston Street	4	Boston-83	Yes	Hedge Maple	Acer	campestre	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0592.JPG	8	15	1	Fair	Yes	Concrete	Good	Yes	dry; weeds; trash	2	Deadwood Removal		Residential	Municipality	Unknown	8/15/2016	NECE
75	Boston Street	4	Boston-84	No	Other - See Comments			H:\Clients\Salem\Street Tree Survey\Photos\IMG_0593.JPG	0	0	1	Other/Unknown		Concrete	Good	Yes	tree pit	3	Other - See Comments		Residential	Municipality	Unknown	8/15/2016	NECE
73	Boston Street	0	Boston-85	Stump	Other - See Comments			H:\Clients\Salem\Street Tree Survey\Photos\IMG_0594.JPG	5	0	1	Other/Unknown		Concrete	Good	Yes	tree stump	0	Other - See Comments		Residential	Municipality	Unknown	8/15/2016	NECE
71	Boston Street	0	Boston-86	No	Other - See Comments			H:\Clients\Salem\Street Tree Survey\Photos\IMG_0595.JPG	0	0	1	Other/Unknown	No	Concrete	Fair	Yes	tree pit	0	Other - See Comments		Residential	Municipality	Unknown	8/15/2016	NECE
69	Boston Street	4	Boston-87	Yes	Hedge Maple	Acer	campestre	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0596.JPG	6	15	1	Fair	No	Concrete	Fair	Yes	dry	3	Pruning		Residential	Municipality	Unknown	8/15/2016	NECE
67	Boston Street	0	Boston-88	No	Other - See Comments			H:\Clients\Salem\Street Tree Survey\Photos\IMG_0597.JPG	0	0	1	Other/Unknown		Concrete	Fair	Yes	tree pit	0	Other - See Comments		Residential	Municipality	Unknown	8/15/2016	NECE
67	Boston Street	0	Boston-89	Yes	Hedge Maple	Acer	campestre	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0598.JPG	7	15	1	Fair	No	Concrete	Good	Yes	dry	0	Pruning		Residential	Municipality	Unknown	8/15/2016	NECE
65	Boston Street	0	Boston-90	No	Other - See Comments			H:\Clients\Salem\Street Tree Survey\Photos\IMG_0599.JPG	0	0	1	Other/Unknown		Concrete	Fair	Yes	tree pit	0	Other - See Comments		Residential	Municipality	Unknown	8/15/2016	NECE
35	Boston Street	0	Boston-91	Stump	Other - See Comments			H:\Clients\Salem\Street Tree Survey\Photos\IMG_0600.JPG	10	0	1	Other/Unknown		Bit. Pavement	Fair	Yes	stump removal	0	Other - See Comments		Commercial	Municipality	Unknown	8/15/2016	NECE
27	Boston Street	0	Boston-92	Stump	Other - See Comments			H:\Clients\Salem\Street Tree Survey\Photos\IMG_0601.JPG	20	0	1	Other/Unknown		Concrete	Good	Yes	stump removal	0	Other - See Comments		Residential	Municipality	Unknown	8/15/2016	NECE
27	Boston Street	0	Boston-93	No	Other - See Comments			H:\Clients\Salem\Street Tree Survey\Photos\IMG_0602.JPG	0	0	1	Other/Unknown		Concrete	Good	Yes	tree pit	0	Other - See Comments		Residential	Municipality	Unknown	8/15/2016	NECE
17	Boston Street	0	Boston-94	No	Other - See Comments			H:\Clients\Salem\Street Tree Survey\Photos\IMG_0603.JPG	0	0	1	Other/Unknown		Concrete	Fair	Yes	empty tree pit	0	Other - See Comments		Residential	Municipality	Unknown	8/15/2016	NECE
15	Boston Street	0	Boston-95	Yes	Hedge Maple	Acer	campestre	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0604.JPG	10	20	1	Fair	No	Concrete	Good	Yes		0	Insect Damage		Residential	Municipality	Unknown	8/15/2016	NECE
11	Boston Street	0	Boston-96	Yes	Hedge Maple	Acer	campestre	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0605.JPG	12	20	1	Good	No	Concrete	Fair	Yes	cigarette butts; trash	0	None		Residential	Municipality	Unknown	8/15/2016	NECE
9	Boston Street	0	Boston-97	Yes	Bradford Pear	Pyrus	calleryana	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0606.JPG	18	20	1	Good	No	Concrete	Good	Yes	weeds; trash	0	None		Residential	Municipality	Unknown	8/15/2016	NECE
7	Boston Street	0	Boston-98	Stump	Other - See Comments			H:\Clients\Salem\Street Tree Survey\Photos\IMG_0607.JPG	4	0	1	Other/Unknown		Concrete	Good	Yes	stump removal	0	Other - See Comments		Commercial	Municipality	Unknown	8/15/2016	NECE
7	Boston Street	0	Boston-99	Yes	Hedge Maple	Acer	campestre	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0608.JPG	6	20	1	Fair	No	Concrete	Good	Yes		0	Insect Damage		Commercial	Municipality	Unknown	8/15/2016	NECE
159	Bridge Street	0	Bridge-01	Yes	Birch	Betula	lenta	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0612.JPG	4	10	1	Good	No	Brick	Good	No		0	None		Residential	Municipality	Unknown	8/16/2016	NECE
0	Bridge Street	0	Bridge-02	Yes	Birch	Betula	lenta	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0613.JPG	5	10	1	Fair	No	Brick	Good	No	sweet birch	0	None		Residential	Municipality	Unknown	8/16/2016	NECE
151	Bridge Street	0	Bridge-03	Dead	Birch	Betula	lenta	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0614.JPG	3	10	1	Poor	No	Brick	Good	No	dead tree; rose bushes in tree pit	0	Removal		Residential	Municipality	Unknown	8/16/2016	NECE
0	Bridge Street	0	Bridge-04	Yes	Other - See Comments	Cercis	cercideae	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0615.JPG	4	12	1	Good	No	Brick	Good	No	new mulch; eastern redbud	0	None		Residential	Municipality	Unknown	8/16/2016	NECE
137	Bridge Street	0	Bridge-05	Yes	Norway Maple	Acer	platanoides	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0_616.JPG	26	40	0	Good	No	Brick	Good	No		0	None		Residential	Municipality	Unknown	8/16/2016	NECE
137	Bridge Street	0	Bridge-06	Yes	Norway Maple	Acer	platanoides	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0617.JPG	4	15	0	Good	No	Brick	Good	No	landscaping	0	None		Residential	Municipality	Unknown	8/16/2016	NECE
135	Bridge Street	0	Bridge-07	Yes	Norway Maple	Acer	platanoides	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0618.JPG	3	12	0	Poor	No	Brick	Good	No	dead branches; landscaping	0	Deadwood Removal		Residential	Municipality	Unknown	8/16/2016	NECE
135	Bridge Street	0	Bridge-08	Yes	Bradford Pear	Pyrus	calleryana	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0619.JPG	6	20	0	Fair	No	Brick	Good	No	landscaping	0	Pruning		Residential	Municipality	Unknown	8/16/2016	NECE
135	Bridge Street	0	Bridge-09	Yes	Bradford Pear	Pyrus	calleryana	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0620.JPG	5	15	0	Fair	No	Brick	Good	No	landscaping	0	None		Residential	Municipality	Unknown	8/16/2016	NECE
131	Bridge Street	0	Bridge-10	Dead				H:\Clients\Salem\Street Tree Survey\Photos\IMG_0621.JPG	2	10	0	Poor	No	Brick	Good	No	dead tree	0	Removal		Residential	Municipality	Unknown	8/16/2016	NECE
131	Bridge Street	0	Bridge-11	Yes	Zelkova	Zelkova	serrata	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0622.JPG	4	10	0	Good	No	Brick	Good	No		0	Pruning		Residential	Municipality	Unknown	8/16/2016	NECE
129	Bridge Street	0	Bridge-12	Yes	Zelkova	Zelkova	serrata	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0623.JPG	3	10	1	Fair	No	Brick	Good	No		0	Pruning		Residential	Municipality	Unknown	8/16/2016	NECE
63	Bridge Street	0	Bridge-13	Yes	Zelkova	Zelkova	serrata	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0624.JPG	5	12	1	Poor	No	Concrete	Good	No	dead branches	0	Deadwood Removal		Residential	Municipality	Unknown	8/16/2016	NECE
59	Bridge Street	2	Bridge-14	Yes	Zelkova	Zelkova	serrata	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0625.JPG	4	12	1	Fair	No	Concrete	Good	No	dead branches	2	Pruning	checked 4-16;	Residential	Municipality	Unknown	8/16/2016	NECE
53	Bridge Street	0	Bridge-15	Yes	Zelkova	Zelkova	serrata	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0626.JPG	3	8	0	Poor	No	Concrete	Good	No	lots of dead branches	0	Deadwood Removal		Residential	Municipality	Unknown	8/16/2016	NECE
49	Bridge Street	0	Bridge-16	Yes	Zelkova	Zelkova	serrata	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0627.JPG	3	10	0	Fair	No	Concrete	Good	No	dead branches; weeds in tree bed	0	Deadwood Removal		Residential	Municipality	Unknown	8/16/2016	NECE
43	Bridge Street	0	Bridge-17	Yes	Norway Maple	Acer	platanoides	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0628.JPG	3	10	0	Fair	No	Concrete	Good	No		0	None		Residential	Municipality	Unknown	8/16/2016	NECE
33	Bridge Street	0	Bridge-18	Yes	Norway Maple	Acer	platanoides	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0629.JPG	4	15	0	Fair	No	Concrete	Good	No	weeds in tree bed	0	None		Residential	Municipality	Unknown	8/16/2016	NECE
31	Bridge Street	0	Bridge-19	Yes	Norway Maple	Acer	platanoides	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0630.JPG	4	15	1	Good	No	Concrete	Good	No	red mulch	0	None		Commercial	Municipality	Unknown	8/16/2016	NECE
29	Bridge Street	0	Bridge-20	Yes	Norway Maple	Acer	platanoides	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0631.JPG	3	15	0	Good	No	Concrete	Good	No		0	None		Commercial	Municipality	Unknown	8/16/2016	NECE
19	Bridge Street	0	Bridge-21	Yes	Norway Maple	Acer	platanoides	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0632.JPG	4	15	0	Fair	No	Concrete	Good	No	weeds in tree bed	0	None		Commercial	Municipality	Unknown	8/16/2016	NECE
15	Bridge Street	0	Bridge-22	Yes	Cherry	Prunus	subhirtella	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0633.JPG	4	15	1	Fair	No	Concrete	Good	No	dead branches	0	Deadwood Removal		Commercial	Municipality	Unknown	8/16/2016	NECE
15	Bridge Street	0	Bridge-23	Stump	Other - See Comments			H:\Clients\Salem\Street Tree Survey\Photos\IMG_0634.JPG	6	0	1	Other/Unknown		Concrete	Good	No	stump removal	0	Other - See Comments		Commercial	Municipality	Unknown	8/16/2016	NECE
18	Bridge Street	0	Bridge-24	Stump	Other - See Comments			H:\Clients\Salem\Street Tree Survey\Photos\IMG_0635.JPG	6	0	1	Other/Unknown		Concrete	Good	No	stump removal; drain pipe in tree bed	0	Other - See Comments		Commercial	Municipality	Unknown	8/16/2016	NECE
22	Bridge Street	0	Bridge-25	Yes	Bradford Pear	Pyrus	calleryana	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0636.JPG	4	15	1	Fair	No	Concrete	Good	No		0	Pruning		Residential	Municipality	Unknown	8/16/2016	NECE
26	Bridge Street	0	Bridge-26	Yes	Pin Oak	Quercus	palustris	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0637.JPG	32	60	0	Good	No	Concrete	Good	No	red mulch; not sure if city tree	0	None		Commercial	Unknown	Unknown	8/16/2016	NECE
36	Bridge Street	0	Bridge-27	Yes	Pin Oak	Quercus	palustris	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0638.JPG	34	60	1	Good	No	Concrete	Good	No	not sure if city tree	0	None		Commercial	Unknown	Unknown	8/16/2016	NECE
38	Bridge Street	0	Bridge-28	Yes	Pin Oak	Quercus	palustris	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0639.JPG	30	60	1	Good	No	Concrete	Good	No	not sure if city tree	0	None		Commercial	Unknown	Unknown	8/16/2016	NECE
48	Bridge Street	0	Bridge-29	Yes	Other - See Comments	Tilla	americana	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0640.JPG	2	8	0	Fair	No	Concrete	Good	No	Linden tree; weeds in tree bed	0	None		Residential	Municipality	Unknown	8/16/2016	NECE
50	Bridge Street	0	Bridge-30	Yes	Zelkova	Zelkova	serrata	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0641.JPG	4	8	0	Fair	No	Concrete	Good	No	dead branches; weeds in tree bed	0	Pruning		Residential	Municipality	Unknown	8/16/2016	NECE
58	Bridge Street	0	Bridge-31	Yes	Bradford Pear	Pyrus	calleryana	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0642.JPG	5	15	0	Good	No	Concrete	Good	No	red mulch; tree bag	0	None		Residential	Municipality	Unknown	8/16/2016	NECE
62	Bridge Street	0	Bridge-32	Yes	Bradford Pear	Pyrus	calleryana	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0643.JPG	6	15	0	Fair	No	Concrete	Good	No	red mulch; tree bag; weeds	0	None		Residential	Municipality	Unknown	8/16/2016	NECE
64	Bridge Street	0	Bridge-33	Yes	Zelkova	Zelkova	serrata	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0644.JPG	5	10	1	Poor	No	Concrete	Good	No	dead branches	0	Pruning		Commercial	Municipality	Unknown	8/16/2016	NECE
70	Bridge Street	0	Bridge-34	Yes	Cherry	Prunus	subhirtella	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0645.JPG	3	10	1	Fair	No	Concrete											

Street Number	Street Name	Ward	ID	Tree Present	Name	Genus	Species	Photo Link	Diameter	Height	Quantity	Condition	Trunk Injury	Surrounding Sidewalk Material	Sidewalk Condition	Wires	Comments	Priority	Resolution	Action Taken	Land Use	Owner	Install Date	Last Update	Last Editor
156	Bridge Street	0	Bridge-54	Yes	Bradford Pear	Pyrus	calleryana	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0665.JPG	2	8	1	Poor	No	Brick	Good	No	landscaping	0	Deadwood Removal		Residential	Municipality	Unknown	8/16/2016	NECE
158	Bridge Street	0	Bridge-55	No	Other - See Comments	Cercis	circideae	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0666.JPG	0	0	1	Other/Unknown		Brick	Good	No	empty tree pit	0	Other - See Comments		Residential	Municipality	Unknown	8/16/2016	NECE
160	Bridge Street	0	Bridge-56	Yes		Bradford Pear	Pyrus	calleryana	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0667.JPG	4	15		1	Fair	No	Brick	Good	No		mulch	0	None	Residential	Municipality	Unknown
166	Bridge Street	0	Bridge-57	Yes	Bradford Pear	Pyrus	calleryana	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0668.JPG	4	15	1	Good	No	Brick	Good	No	weeds	0	None		Residential	Municipality	Unknown	8/16/2016	NECE
311	Essex Street	0	Essex-01	Yes	Bradford Pear	Pyrus	calleryana	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0676.JPG	16	25	1	Fair	No	Brick	Fair	No		0	None		Residential	Municipality	Unknown	8/16/2016	NECE
313	Essex Street	0	Essex-02	Yes	Bradford Pear	Pyrus	calleryana	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0677.JPG	12	25	1	Poor	No	Brick	Fair	No	dry	0	Pruning		Residential	Municipality	Unknown	8/16/2016	NECE
313	Essex Street	0	Essex-03	Yes	Bradford Pear	Pyrus	calleryana	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0678.JPG	14	20	1	Fair	No	Brick	Fair	No		0	Pruning		Residential	Municipality	Unknown	8/16/2016	NECE
315	Essex Street	0	Essex-04	Yes	Bradford Pear	Pyrus	calleryana	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0679.JPG	3	10	0	Fair	No	Brick	Good	No	mulch	0	Insect Damage		Residential	Municipality	Unknown	8/16/2016	NECE
317	Essex Street	0	Essex-05	Yes	Bradford Pear	Pyrus	calleryana	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0680.JPG	18	30	0	Good	No	Brick	Heaving	No	mulch	0		None	Residential	Municipality	Unknown	8/16/2016	NECE
319	Essex Street	0	Essex-06	Yes	Bradford Pear	Pyrus	calleryana	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0681.JPG	18	30	1	Good	No	Brick	Heaving	Yes	flowers in tree pit	0	None		Residential	Municipality	Unknown	8/16/2016	NECE
319	Essex Street	0	Essex-07	Yes	Norway Maple	Acer	platanoides	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0682.JPG	24	35	0	Good	No	Brick	Heaving	Yes	sidewalk needs to be fixed	0	None		Residential	Municipality	Unknown	8/16/2016	NECE
329	Essex Street	0	Essex-08	Yes	Bradford Pear	Pyrus	calleryana	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0683.JPG	5	12	0	Fair	No	Brick	Fair	Yes	tree bag	0	None		Residential	Municipality	Unknown	8/16/2016	NECE
329	Essex Street	0	Essex-09	Yes	Bradford Pear	Pyrus	calleryana	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0684.JPG	5	12	1	Fair	No	Brick	Fair	Yes	tree bag	0	Pruning		Residential	Municipality	Unknown	8/16/2016	NECE
333	Essex Street	0	Essex-10	Yes	Bradford Pear	Pyrus	calleryana	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0685.JPG	16	30	1	Fair	No	Brick	Fair	Yes	pebbles in tree pit	0	Pruning		Residential	Municipality	Unknown	8/16/2016	NECE
333	Essex Street	0	Essex-11	Yes	Bradford Pear	Pyrus	calleryana	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0686.JPG	18	25	1	Fair	No	Brick	Fair	Yes		0	Pruning		Residential	Municipality	Unknown	8/16/2016	NECE
337	Essex Street	0	Essex-12	Yes	Hedge Maple	Acer	campestre	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0687.JPG	16	25	0	Poor	No	Brick	Poor	Yes	dead branches	0	Deadwood Removal		Residential	Municipality	Unknown	8/16/2016	NECE
337	Essex Street	0	Essex-13	Yes	Other - See Comments	Ginkgo	biloba	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0688.JPG	2	10	0	Good	No	Brick	Fair	Yes	Ginkgo tree	0		None	Residential	Municipality	Unknown	8/16/2016	NECE
343	Essex Street	0	Essex-14	Yes		Bradford Pear	Pyrus	calleryana	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0689.JPG	12	30	1	Fair	No	Brick	Fair	Yes	cobblestones and mulch	0	None		Residential	Municipality	Unknown	8/16/2016
345	Essex Street	0	Essex-15	Yes	Bradford Pear	Pyrus	calleryana	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0690.JPG	18	30	1	Fair	No	Brick	Fair	Yes	cobblestones	0	Pruning		Residential	Municipality	Unknown	8/16/2016	NECE
347	Essex Street	0	Essex-16	Yes	Bradford Pear	Pyrus	calleryana	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0691.JPG	18	35	1	Fair	No	Brick	Fair	Yes	pebbles in tree bed	0	Pruning		Residential	Municipality	Unknown	8/16/2016	NECE
347	Essex Street	0	Essex-17	Yes	Bradford Pear	Pyrus	calleryana	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0692.JPG	18	30	0	Fair	No	Brick	Fair	Yes		0	None		Residential	Municipality	Unknown	8/16/2016	NECE
346	Essex Street	0	Essex-18	Yes	Ash	Fraxinus	pennsylvanica	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0693.JPG	16	30	1	Good	No	Brick	Fair	Yes	green ash	0	Pruning		Residential	Municipality	Unknown	8/16/2016	NECE
344	Essex Street	0	Essex-19	Yes	Ash	Fraxinus	pennsylvanica	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0694.JPG	22	30	1	Fair	No	Brick	Fair	Yes	new tree box; red mulch	0	None		Residential	Municipality	Unknown	8/16/2016	NECE
342	Essex Street	0	Essex-20	Yes	Zelkova	Zelkova	serrata	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0695.JPG	8	25	1	Good	No	Brick	Fair	Yes	plants in tree box	0	None		Residential	Municipality	Unknown	8/16/2016	NECE
342	Essex Street	0	Essex-21	Yes	Norway Maple	Acer	platanoides	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0696.JPG	32	30	1	Good	No	Brick	Heaving	Yes	root cut; was in sidewalk	0	None		Residential	Municipality	Unknown	8/16/2016	NECE
336	Essex Street	0	Essex-22	Yes	Other - See Comments	Ginkgo	biloba	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0697.JPG	8	30	1	Good	No	Brick	Good	Yes	Ginkgo; plants in tree box	0	None		Residential	Municipality	Unknown	8/16/2016	NECE
330	Essex Street	2	Essex-23	Yes		Norway Maple	Acer	platanoides	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0698.JPG	4	15	1	Fair	No	Brick	Good	Yes		3	None		Residential	Municipality	Unknown	8/16/2016
328	Essex Street	0	Essex-24	Yes	Ash	Fraxinus	pennsylvanica	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0699.JPG	20	30	1	Good	No	Brick	Fair	Yes		0	None		Residential	Municipality	Unknown	8/16/2016	NECE
324	Essex Street	0	Essex-25	Yes	Ash	Fraxinus	pennsylvanica	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0700.JPG	22	25	1	Fair	No	Brick	Heaving	Yes	dead branches	0	Pruning		Residential	Municipality	Unknown	8/16/2016	NECE
318	Essex Street	0	Essex-26	Yes	Bradford Pear	Pyrus	calleryana	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0701.JPG	5	15	1	Fair	No	Brick	Fair	Yes		0	None		Residential	Municipality	Unknown	8/16/2016	NECE
318	Essex Street	0	Essex-27	Yes	Bradford Pear	Pyrus	calleryana	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0702.JPG	5	20	1	Good	No	Brick	Fair	Yes		0	None		Residential	Municipality	Unknown	8/16/2016	NECE
314	Essex Street	0	Essex-28	Yes	Cherry	Prunus	subhirtella	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0703.JPG	24	25	1	Poor	No	Brick	Fair	Yes	dead branches; higan cherry	0	Pruning		Residential	Municipality	Unknown	8/16/2016	NECE
85	Federal-	0	Federal-01	Yes	Ash	Fraxinus	pennsylvanica	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0711.JPG	14	25	0	Good	Yes	Brick	Fair	No		0	None		Commercial	Municipality	Unknown	8/16/2016	NECE
85	Federal-	0	Federal-02	Yes	Bradford Pear	Pyrus	calleryana	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0712.JPG	10	25	0	Fair	No	Brick	issing Cobble/Bri	No		0	None		Commercial	Municipality	Unknown	8/16/2016	NECE
85	Federal-	0	Federal-03	Yes	Bradford Pear	Pyrus	calleryana	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0713.JPG	14	25	1	Good	No	Brick	issing Cobble/Bri	No		0	None		Commercial	Municipality	Unknown	8/16/2016	NECE
85	Federal-	0	Federal-04	Yes	Bradford Pear	Pyrus	calleryana	H:\Clients\S																	

Street Number	Street Name	Ward	ID	Tree Present	Name	Genus	Species	Photo Link	Diameter	Height	Quantity	Condition	Trunk Injury	Surrounding Sidewalk Material	Sidewalk Condition	Wires	Comments	Priority	Resolution	Action Taken	Land Use	Owner	Install Date	Last Update	Last Editor
385	Lafayette	0	Lafayette-15	Yes	Norway Maple	Acer	platanoides	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0504.JPG	10	25	1	Fair	No	Concrete	Good	Yes	dead branches	0	Deadwood Removal		Residential	Municipality	Unknown	8/12/2016	NECE
381	Lafayette	0	Lafayette-16	Yes	Pin Oak	Quercus	palustris	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0505.JPG	50	70	1	Good	No	Bit. Pavement	Fair	Yes		0	Pruning		Residential	Municipality	Unknown	8/12/2016	NECE
375	Lafayette	0	Lafayette-17	Yes	Pin Oak	Quercus	palustris	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0_506.JPG	60	75	1	Good	No	Bit. Pavement	Good	Yes	some dead branches	0	Pruning		Residential	Municipality	Unknown	8/12/2016	NECE
361	Lafayette	0	Lafayette-18	Yes	Pin Oak	Quercus	palustris	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0507.JPG	65	75	1	Good	No	Concrete	Fair	Yes	tree in street; bike path shifted to accomodate	0	Pruning		Residential	Municipality	Unknown	8/12/2016	NECE
343	Lafayette	0	Lafayette-19	Yes	Red Oak	Quercus	rubra	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0508.JPG	7	20	1	Fair	No	Concrete	Fair	No		0	Insect Damage		Residential	Municipality	Unknown	8/12/2016	NECE
436	Lafayette	0	Lafayette-20	Yes	Norway Maple	Acer	platanoides	H:\Clients\Salem\Street Tree Survey\Photos\IMG_0509.JPG	18	40	1	Fair	No	Concrete	Heaving	Yes	sidewalk needs repair	0	Pruning		Residential	Municipality	Unknown	8/12/2016	NECE
112	North Street	0	North-01	Yes	Bradford Pear	Pyrus	calleryana		6	20	1	Fair	No	Concrete	Good	Yes		0	None		Commercial	Municipality	Unknown	8/10/2016	NECE
116	North Street	0	North-02	Yes	Bradford Pear	Pyrus	calleryana		8	20	1	Fair	No	Concrete	Good	Yes		0	None		Commercial	Municipality	Unknown	8/10/2016	NECE
116	North Street	0	North-03	Yes	Bradford Pear	Pyrus	calleryana		9	15	1	Fair	No	Concrete	Good	Yes		0	None		Commercial	Municipality	Unknown	8/10/2016	NECE
128	North Street	0	North-05	Yes	Bradford Pear	Pyrus	calleryana		6	15	1	Fair	No	Concrete	Good	No		0	Insect Damage		Commercial	Municipality	Unknown	8/10/2016	NECE
128	North Street	0	North-06	Yes	Bradford Pear	Pyrus	calleryana		7	20	1	Fair	No	Concrete	Good	No		0	Insect Damage		Commercial	Municipality	Unknown	8/10/2016	NECE
128	North Street	0	North-07	Yes	Bradford Pear	Pyrus	calleryana		4	12	1	Good	No	Concrete	Good	No		0	None		Commercial	Municipality	Unknown	8/10/2016	NECE
128	North Street	0	North-08	Yes	Hedge Maple	Acer	campestre		8	25	1	Good	No	Concrete	Good	Yes		0	None		Commercial	Municipality	Unknown	8/10/2016	NECE
136	North Street	0	North-09	Yes	Norway Maple	Acer	platanoides		13	30	1	Poor	No	Concrete	Good	Yes	very sparse because of wires	0	None		Residential	Municipality	Unknown	8/10/2016	NECE
136	North Street	0	North-10	Yes	Bradford Pear	Pyrus	calleryana		13	30	1	Good	No	Concrete	Good	Yes		0	None		Residential	Municipality	Unknown	8/10/2016	NECE
138	North Street	0	North-11	Yes	Bradford Pear	Pyrus	calleryana		14	25	1	Fair	No	Concrete	Good	Yes		0	None		Residential	Municipality	Unknown	8/10/2016	NECE
138	North Street	0	North-12	Yes	Norway Maple	Acer	platanoides		7	25	1	Poor	No	Concrete	Good	Yes	tree lopsided due to wires	0	None		Residential	Municipality	Unknown	8/10/2016	NECE
146	North Street	0	North-13	Yes	Bradford Pear	Pyrus	calleryana		11	30	1	Fair	No	Concrete	Good	Yes		0	Insect Damage		Residential	Municipality	Unknown	8/10/2016	NECE
148	North Street	0	North-14	Yes	Bradford Pear	Pyrus	calleryana		8	20	1	Fair	No	Concrete	Good	Yes		0	None		Residential	Municipality	Unknown	8/10/2016	NECE
150	North Street	0	North-15	Yes	Zelkova	Zelkova	serrata		10	20	1	Good	No	Concrete	Good	Yes		0	Insect Damage		Residential	Municipality	Unknown	8/10/2016	NECE
152	North Street	0	North-16	Yes	Bradford Pear	Pyrus	calleryana		11	25	1	Fair	No	Concrete	Good	Yes		0	Insect Damage		Residential	Municipality	Unknown	8/10/2016	NECE
152	North Street	0	North-17	Yes	Bradford Pear	Pyrus	calleryana		13	35	1	Fair	No	Concrete	Good	Yes		0	Insect Damage		Residential	Municipality	Unknown	8/10/2016	NECE
156	North Street	0	North-18	Yes	Norway Maple	Acer	platanoides		7	20	1	Poor	No	Concrete	Good	Yes	Dry	0	Other - See Comments		Residential	Municipality	Unknown	8/10/2016	NECE
158	North Street	0	North-19	Yes	Hedge Maple	Acer	campestre		8	20	1	Fair	No	Concrete	Good	Yes		0	None		Residential	Municipality	Unknown	8/10/2016	NECE
164	North Street	0	North-20	Yes	Bradford Pear	Pyrus	calleryana		7	20	1	Good	No	Concrete	Good	Yes		0	None		Residential	Municipality	Unknown	8/11/2016	NECE
164	North Street	0	North-21	Yes	Bradford Pear	Pyrus	calleryana		8	20	1	Good	No	Concrete	Good	Yes		0	Insect Damage		Residential	Municipality	Unknown	8/11/2016	NECE
166	North Street	0	North-22	Yes	Bradford Pear	Pyrus	calleryana		7	20	1	Good	No	Concrete	Good	Yes		0	None		Residential	Municipality	Unknown	8/11/2016	NECE
166	North Street	0	North-23	Yes	Bradford Pear	Pyrus	calleryana		6	20	1	Fair	No	Concrete	Good	Yes		0	Insect Damage		Residential	Municipality	Unknown	8/11/2016	NECE
168	North Street	0	North-24	Yes	Red Maple	Acer	rubrum		5	20	1	Fair	No	Concrete	Good	Yes		0	Insect Damage		Residential	Municipality	Unknown	8/11/2016	NECE
170	North Street	0	North-25	Yes	Bradford Pear	Pyrus	calleryana		8	20	1	Good	No	Concrete	Good	Yes		0	None		Residential	Municipality	Unknown	8/11/2016	NECE
170	North Street	0	North-26	Yes	Bradford Pear	Pyrus	calleryana		5	20	1	Good	No	Concrete	Good	Yes		0	None		Residential	Municipality	Unknown	8/11/2016	NECE
180	North Street	0	North-27	Yes	Bradford Pear	Pyrus	calleryana		8	20	1	Good	No	Concrete	Good	Yes		0	None		Residential	Municipality	Unknown	8/11/2016	NECE
182	North Street	0	North-28	Yes	Norway Maple	Acer	platanoides		18	30	1	Good	No	Concrete	Good	Yes		0	None		Residential	Municipality	Unknown	8/11/2016	NECE
188	North Street	0	North-29	Yes	Red Maple	Acer	rubrum		4	15	1	Good	No	Concrete	Good	Yes		0	None		Residential	Municipality	Unknown	8/11/2016	NECE
188	North Street	0	North-30	Yes	Bradford Pear	Pyrus	calleryana		8	25	1	Fair	No	Concrete	Good	Yes		0	Pruning		Residential	Municipality	Unknown	8/11/2016	NECE
194	North Street	0	North-31	Yes	Bradford Pear	Pyrus	calleryana		5	15	1	Good	No	Concrete	Good	Yes		0	None		Residential	Municipality	Unknown	8/11/2016	NECE
202	North Street	0	North-32	Yes	Hedge Maple	Acer	campestre		7	20	1	Good	No	Concrete	Good	Yes		0	None		Residential	Municipality	Unknown	8/11/2016	NECE
202	North Street	0	North-33	Yes	Hedge Maple	Acer	campestre		5	15	1	Poor	No	Concrete	Good	No	Needs water/dying	0	Removal		Residential	Municipality	Unknown	8/11/2016	NECE
206	North Street	0	North-34	Yes	Bradford Pear	Pyrus	calleryana		2	10	1	Poor	No	Concrete	Good	No	needs water; recently planted	0	Other - See Comments		Residential	Municipality	Unknown	8/11/2016	NECE
208	North Street	0	North-35	Yes	Bradford Pear	Pyrus	calleryana		10	20	1	Poor	No	Concrete	Good	No	Also deadwood removal	0	Pruning		Residential	Municipality	Unknown	8/11/2016	NECE
210	North Street	0	North-36	Yes	Bradford Pear	Pyrus	calleryana		9	25	1	Fair	No	Concrete	Good	Yes		0	Insect Damage		Residential	Municipality	Unknown	8/11/2016	NECE
212	North Street	0	North-37	Yes	Bradford Pear	Pyrus	calleryana		10	25	1	Fair	No	Concrete	Good	Yes		0	Insect Damage		Residential	Municipality	Unknown	8/11/2016	NECE
215	North Street	0	North-38	Yes	Hedge Maple	Acer	campestre		9	20	1	Good	No	Concrete	Good	Yes		0	None		Residential	Municipality	Unknown	8/11/2016	NECE
241	North Street	0	North-39	Yes	Norway Maple	Acer	platanoides		34	50	1	Poor	No	Concrete	Good	Yes		0	Deadwood Removal		Residential	Municipality	Unknown	8/11/2016	NECE
118	North Street	0	North-4	Yes	Bradford Pear	Pyrus	calleryana		7	15	1	Fair	No	Concrete	Good	Yes		0	None		Residential	Municipality	Unknown	8/10/2016	NECE
237	North Street	0	North-40	Yes	Red Maple	Acer	rubrum		20	40	1	Poor	No	Concrete	Good	Yes	leaning to side because of wires	0	Other - See Comments		Residential	Municipality	Unknown	8/11/2016	NECE
231	North Street	0	North-41	Yes	Norway Maple	Acer	platanoides		36	50	1	Fair	No	Concrete	Good	Yes	big gap where wires are	0	Pruning		Residential	Municipality	Unknown	8/11/2016	NECE
227	North Street	0	North-42	Yes	Norway Maple	Acer	platanoides		22	40	1	Fair	No	Concrete	Good	Yes	gap where wires are	0	None		Residential	Municipality	Unknown	8/11/2016	NECE
227	North Street	0	North-43	Yes	Bradford Pear	Pyrus	calleryana		3	10	1	Fair	No	Concrete	Good	No	very dry; new tree	0	Other - See Comments		Residential	Municipality	Unknown	8/11/2016	NECE
225	North Street	0	North-44	Yes	Bradford Pear	Pyrus	calleryana		7	20	1	Fair	No	Concrete	Good	Yes		0	Insect Damage		Residential	Municipality	Unknown	8/11/2016	NECE
223	North Street	0	North-45	Yes	Bradford Pear	Pyrus	calleryana		8	25	1	Fair	No	Concrete	Good	Yes		0	Insect Damage		Residential	Municipality	Unknown	8/11/2016	NECE
217	North Street	0	North-46	Yes	Norway Maple	Acer	platanoides		40	55	1	Fair	No	Concrete	Good	Yes	gap for wires	0	None		Residential	Municipality	Unknown	8/11/2016	NECE
211	North Street	0	North-47	Yes	Honey Locust	Gleditsia	triacanthos		2	10	1	Good	No	Concrete	Good	No		0	None		Residential	Municipality	Unknown	8/11/2016	NECE
209	North Street	0	North-48	Yes	Bradford Pear	Pyrus	calleryana		5	15	1	Good	No	Concrete	Good	Yes		0	None		Residential	Municipality	Unknown	8/11/2016	NECE
205	North Street	0	North-49	Yes	Norway Maple	Acer	platanoides		24	45	1	Fair	No	Concrete	Good	Yes	gap for wires	0	None		Residential	Municipality	Unknown	8/11/2016	NECE
203	North Street	0	North-50	Yes	Bradford Pear	Pyrus	calleryana		2	12	1	Fair	No	Concrete	Good	No		0	Deadwood Removal		Residential	Municipality	Unknown	8/11/2016	NECE
203	North Street	0	North-51	Yes	Bradford Pear	Pyrus	calleryana		18	25	1	Fair	No	Concrete	Good	Yes		0	Pruning		Residential	Municipality	Unknown	8/11/2016	NECE
201	North Street	0	North-52	Yes	Hedge Maple	Acer	campestre		5	20	1	Fair	No	Concrete	Good	Yes		0	Pruning		Residential	Municipality	Unknown	8/11/2016	NECE
199	North Street	0	North-53	Yes	Norway Maple	Acer	platanoides		30	45	1	Fair	No	Concrete	Good	Yes	gap for wires	0	Deadwood Removal		Residential	Municipality	Unknown	8/11/2016	NECE
195	North Street	0	North-54	Yes	Norway Maple	Acer	platanoides		26	40	1	Poor	No	Concrete	Good	Yes	gap for wires	0	Deadwood Removal		Residential	Municipality	Unknown	8/11/2016	NECE
193	North Street	0	North-55	Yes	Hedge Maple	Acer	campestre		12	30	1	Poor	No	Concrete	Good	Yes	very dry	0	Other - See Comments		Residential	Municipality	Unknown	8/11/2016	NECE
185	North Street	0	North-56	Yes	Bradford Pear	Pyrus	calleryana		4	14	1	Good	No	Concrete	Good	No		0	None		Residential	Municipality	Unknown	8/11/2016	NECE
185	North Street	0	North-57	Yes	Norway Maple	Acer	platanoides		18	25	1	Good	No	Concrete	Good	Yes	gap for wires	0	Deadwood Removal		Residential	Municipality	Unknown	8/11/2016	NECE
183	North Street	0	North-58	Yes	Norway Maple	Acer	platanoides		16	25	1	Fair	Yes	Concrete	Good	Yes	gap for wires	0	Deadwood Removal		Residential	Municipality	Unknown	8/11/2016	NECE
183	North Street	6	North-59	Yes	Norway Maple	Acer	platanoides		18	25	1	Fair	No	Concrete	Good	Yes	gap for wires; ""no parking"" sign on tree	2	Deadwood Removal		Residential	Municipality	Unknown	8/11/2016	NECE
177	North Street	0	North-60	Yes	Norway Maple	Acer	platanoides		16	25	1	Poor	No	Concrete	Good	Yes	dry; lopsided because of wires	0	Removal		Residential	Municipality	Unknown	8/11/2016	NECE
173	North Street	0	North-61	Yes	Bradford Pear	Pyrus	calleryana		6	20	1	Fair	No	Concrete	Good	Yes		0	Insect Damage		Residential	Municipality	Unknown	8/11/2016	NECE
171	North Street</																								

Street Number	Street Name	Ward	ID	Tree Present	Name	Genus	Species	Photo Link	Diameter	Height	Quantity	Condition	Trunk Injury	Surrounding Sidewalk Material	Sidewalk Condition	Wires	Comments	Priority	Resolution	Action Taken	Land Use	Owner	Install Date	Last Update	Last Editor
127	North Street	0	North-79	Yes	Red Maple	Acer	rubrum		6	20	1	Fair	No	Concrete	Good	No		0	Insect Damage		Commercial	Municipality	Unknown	8/11/2016	NECE
125	North Street	0	North-80	Yes	Red Maple	Acer	rubrum		5	20	1	Fair	No	Concrete	Good	No		0	Insect Damage		Residential	Municipality	Unknown	8/11/2016	NECE
123	North Street	0	North-81	Yes	Birch	Betula	lenta		45	25	1	Fair	No	Concrete	Good	Yes	sweet birch	0	Pruning		Residential	Municipality	Unknown	8/11/2016	NECE
121	North Street	0	North-82	Yes	Bradford Pear	Pyrus	calleryana		10	25	1	Fair	No	Concrete	Good	No		0	Insect Damage		Residential	Municipality	Unknown	8/11/2016	NECE
119	North Street	0	North-83	Stump	N/A				4	0	1	N/A	N/A	Concrete	Good	No	stump removal needed	0	Other - See Comments		Residential	Municipality	Unknown	8/11/2016	NECE
111	North Street	0	North-84	Yes	Norway Maple	Acer	platanoides		18	30	1	Fair	No	Concrete	Good	No	dry	0	Deadwood Removal		Commercial	Municipality	Unknown	8/11/2016	NECE
109	North Street	0	North-85	Yes	Norway Maple	Acer	platanoides		18	60	1	Fair	No	Concrete	Good	No		0	None		Residential	Municipality	Unknown	8/11/2016	NECE
109	North Street	0	North-86	Yes	Norway Maple	Acer	platanoides		22	50	1	Poor	No	Concrete	Good	No	many dead branches	0	Deadwood Removal		Residential	Municipality	Unknown	8/11/2016	NECE
0	North Street	0	North-87	Yes	Bradford Pear	Pyrus	calleryana		7	30	1	Fair	No	Concrete	Good	No	very dry	0	Pruning		Commercial	Municipality	Unknown	8/11/2016	NECE
0	North Street	0	North-88	Yes	Bradford Pear	Pyrus	calleryana		6	25	1	Fair	No	Concrete	Good	No	dry	0	Pruning		Commercial	Municipality	Unknown	8/11/2016	NECE
93	North Street	0	North-89	Yes	Norway Maple	Acer	platanoides		8	25	1	Good	No	Concrete	Good	No	dark red leaves in Summer-	0	None		Commercial	Municipality	Unknown	8/11/2016	NECE
87	North Street	0	North-90	Yes	Norway Maple	Acer	platanoides		6	20	1	Fair	No	Concrete	Good	No	dry	0	Insect Damage		Commercial	Municipality	Unknown	8/11/2016	NECE
18	Summer Street	0	Summer-01	Yes	Norway Maple	Acer	platanoides		16	25	0	Poor	Yes	Mixed Material	Fair	No	dead branches	0	Pruning		Residential	Municipality	Unknown	8/16/2016	NECE
18	Summer Street	0	Summer-02	No	Other - See Comments				0	0	1	Other/Unknown		Mixed Material	Fair	No	empty tree pit	0	Other - See Comments		Residential	Municipality	Unknown	8/16/2016	NECE
18	Summer Street	0	Summer-03	No	Other - See Comments				0	0	1	Other/Unknown		Mixed Material	Fair	No	empty tree pit	0	Other - See Comments		Residential	Municipality	Unknown	8/16/2016	NECE
6	Summer Street	0	Summer-04	Yes	Norway Maple	Acer	platanoides		18	25	1	Fair	No	Concrete	Fair	No	dead branches; flowers in tree bed	0	Pruning		Residential	Municipality	Unknown	8/16/2016	NECE
5	Summer Street	2	Summer-05	Yes	Norway Maple	Acer	platanoides		18	20	2	Fair	No	Mixed Material	Good	No	cobblestones in tree bed surrounded by brick	2	Pruning		Commercial	Municipality	Unknown	8/16/2016	NECE
17	Summer Street	0	Summer-06	Yes	Norway Maple	Acer	platanoides		6	25	1	Fair	No	Concrete	Fair	No	grass/weeds in tree bed	0	None		Residential	Municipality	Unknown	8/16/2016	NECE
17	Summer Street	0	Summer-07	Yes	Ash	Fraxinus	pennsylvanica		12	25	1	Poor	No	Mixed Material	Fair	No	cigarette butts; green ash	0	Pruning		Residential	Municipality	Unknown	8/16/2016	NECE
17	Summer Street	0	Summer-08	Yes	Ash	Fraxinus	pennsylvanica		12	30	1	Fair	No	Concrete	Heaving	No	red mulch; green ash	0	Pruning		Residential	Municipality	Unknown	8/16/2016	NECE
19	Summer Street	0	Summer-09	Yes	Ash	Fraxinus	nigra		12	25	1	Poor	No	Concrete	Heaving	No	black ash	0	Pruning		Residential	Municipality	Unknown	8/16/2016	NECE
21	Summer Street	0	Summer-10	Yes	Ash	Fraxinus	nigra		12	25	0	Fair	No	Concrete	Heaving	No	black ash	0	None		Residential	Municipality	Unknown	8/16/2016	NECE
25	Summer Street	0	Summer-11	Yes	Ash	Fraxinus	pennsylvanica		14	25	0	Fair	No	Concrete	Heaving	No	green ash	0	Pruning		Residential	Municipality	Unknown	8/16/2016	NECE
27	Summer Street	0	Summer-12	Yes	Ash	Fraxinus	pennsylvanica		16	25	0	Fair	No	Concrete	Heaving	No	dead branches	0	Pruning		Residential	Municipality	Unknown	8/16/2016	NECE

Street Number	Street Name	Ward	ID	Tree Present	Name	Genus	Species	Photo Link	Diameter	Height	Quantity	Condition	Trunk Injury	Surrounding Sidewalk Material	Sidewalk Condition	Wires	Comments	Priority	Resolution	Action Taken	Land Use	Owner	Install Date	Last Update	Last Editor
12	Andrew Street	2	*	Yes	London Plane	Platanus	acerifolia		12	0	1						Tree needs to be removed - pic taken	1	Removal	checked 4-16;			Unknown		
25	Andrew Street	2	*	No					0	0	1						Open tree pit	3	Open pit				Unknown		
12	Arbella Street	2	*	Yes					0	0	1						Deadwood	2	Pruning				Unknown		
22	Arbella Street	2	*	Yes					0	0	2						Deadwood and Removal of 2nd tree	2	Pruning	techecked 4-1			Unknown		
22	Arbella Street	2	*	Yes	Maple	Acer			12	0	1						remove	2	Removal				Unknown		
1	Barnes Circle	3	*	Yes	Poplar	Populus			0	0	1						corner of Barnes Rd - city prop - deadwood (pic)	2	Pruning				Unknown		
9	Barr Street	6	*	Yes	Pear				12	0	1						prune back from house	3	Pruning				Unknown		
84	Barstow Street	6	*	Stump					7	0	1							2	Stump	checked 4-16;			Unknown		
43	Bayview	1	*	Yes	Maple	Acer			36	0	1						at corner of Juniper - large cavity - pictures taken - may need removal	1	Pruning				Unknown		
20	Beach Avenue	1	*	Yes	Maple	Acer			10	0	1						deadwood over sidewalk	1	Pruning				Unknown		
3	Beachmont	6	*	Yes					0	0	1						Prune deadwood	2	Pruning				Unknown		
11	Belleau Rd	5	*	Yes	Maple	Acer			13	0	1						Removal (pic)	2	Removal	checked 4-16:			Unknown		
5	Belleau Rd	5	*	Yes					0	0	2						Prune	2	Pruning				Unknown		
13	Bellevue	4	*	No	Honey Locust	Gleditsia	triacanthos		0	0	1						plant Locust	2	Plant				Unknown		
13	Boardman	2	*	No	Red Maple	Acer	rubrum		0	0	1						columnar red maple	2	Plant				Unknown		
116	Boston Street	4	*	No					0	0	1						open pit	3	Open pit				Unknown		
148	Boston Street	4	*	No					0	0	1						open pit	3	Open pit				Unknown		
149	Boston Street	4	*	No					0	0	1						open pit	3	Open pit				Unknown		
95	Boston Street	4	*	No					0	0	1						open pit	3	Open pit				Unknown		
97	Boston Street	4	*	No					0	0	1						open pit	3	Open pit				Unknown		
0	Boston Street	4	*	No					0	0	1						corner of Hanson	3	Open pit				Unknown		
0	Boston Street	4	*	No					0	0	1						in front of Dairy Witch	3	Open pit				Unknown		
20	Bradford	6	*	Stump					35	0	1						remove	3	Stump				Unknown		
0	Bradford	6	*	Yes	Maple	Acer			26	0	1						corner of Tremont remove (pics) cavities and leaning	1	Removal	checked 4-16;			Unknown		
35	Bridge Street	1	*	No	Chanticlear Pear	Pyrus	calleryana		0	0	1						Chanticlear Pear	2	Plant				Unknown		
107	Bridge Street	2	*	Yes					0	0	1						remove 6"" caliper branch onto abut tree	2	Pruning				Unknown		
16	Briggs	2	*	Stump	Japanese Tree Lilac	Syringa	reticulata		14	0	1						stump; replant JTL	2	Stump	checked 4-16:			Unknown		
32	Briggs	2	*	Stump					14	0	1						stump; do not replant	2	Stump	checked 4-16:			Unknown		
8	Bristol	5	*	Stump					5	0	1						Stump	2	Stump	checked 4-16:			Unknown		
34	Broad	2	*	No					0	0	1						open area to plant	3	Plant				Unknown		
28	Broad	2	*	Yes	Zelkova	Zelkova	serrata		10	0	1							1	Removal	Added 4-16			Unknown		
52	Broad	2	*	Yes					18	0	1						removal	1	Removal	checked 4-16;			Unknown		
0	Brown	2	*	No					0	0	1						Open pit opposite parking garage	3	Plant				Unknown		
28	Buffum	6	*	Stump	Norway Maple	Acer	platanoides		20	0	1						remove stump replant red maple; 20"" Norway Maple	2	Stump				Unknown		
44	Buffum	6	*	Stump	Japanese Tree Lilac	Syringa	reticulata		15	0	1						remove stump replant JTL	2	Stump				Unknown		
6	Buffum	6	*	Stump	Red Maple	Acer	rubrum		14	0	1						remove stump replant red maple	2	Stump				Unknown		
14	Buffum	6	*	No					0	0	1						open tree lawn	3	Plant				Unknown		
22	Buffum	6	*	Yes	Red Maple	Acer	rubrum		2	0	1						Remove (pic)	2	Removal	checked 4-16;			Unknown		
26	Buffum	6	*	Yes					0	0	1						corner Randall remove lg. leader facing Mason (pic)	2	Pruning				Unknown		
4	Buffum	6	*	No					0	0	1						open tree lawn	3	Plant				Unknown		
40	Buffum	6	*	No					0	0	1						open pit	3	Open pit				Unknown		
0	Buffum	6	*	Yes	Ash	Fraxinus			12	0	0						corner of Mason - low prune over sidewalk	2	Pruning				Unknown		
0	Butler	4	*	No					0	0	3						three open pits	2	Open pit				Unknown		
16	Cabot	5	*	No					0	0	1						Open pit	2	Open pit				Unknown		
22	Cabot	5	*	Yes	Pear				0	0	1						Prune	2	Pruning				Unknown		
25	Cabot	5	*	No					0	0	1						Open pit	3	Open pit				Unknown		
28	Cabot	5	*	No					0	0	1						Open pit	3	Open pit				Unknown		
41	Cabot	5	*	No					0	0	1						Open pit	3	Open pit				Unknown		
43	Calumet	4	*	Yes	Maple	Acer			8	0	1						Tree leaning to street (pic)	2	Removal	checked 4-16:			Unknown		
11	Cambridge	2	*	No					0	0	1						Open pit	3	Open pit				Unknown		
18	Carlton	2	*	Stump					12	0	1						stump	2	Stump				Unknown		
20	Cedar	5	*	Yes					7	0	1						removal	2	Removal	checked 4-16:			Unknown		
40	Cedar	5	*	No					0	0	1						Possible planting area	3	Plant				Unknown		
50	Cedar	5	*	Yes	Maple	Acer			15	0	1						Remove - cavity at top	2	Removal	checked 4-16:			Unknown		
53	Cedar	5	*	Yes	Norway Maple	Acer	platanoides		40	0	1						remove deadwood and lighten up backside (pic)	1	Pruning				Unknown		
6	Cedarcrest	7	*	Stump					26	0	1						stump do not replant	2	Stump				Unknown		
0	Central Street	2	*	Stump					0	0	1						opposite Red's - stump removal	2	Stump	checked 4-16;			Unknown		
22	Chandler	7	*	Stump	Cherry	Prunus			12	0	1						stump;replant Cherry	2	Stump				Unknown		
11	Chandler	6	*	No					0	0	1						open pit	3	Open pit				Unknown		
24	Chandler Road	7	*	Yes	Maple	Acer			14	0	1						removal; replant JTL	2	Removal	checked 3-16;			Unknown		
26	Chandler Road	7	*	No	Pear	Pyrus	calleryana		0	0	1						columnar pears	2	Plant				Unknown		
1	Chase	1	*	No					0	0	1						small pit concrete	2	Open pit-fill				Unknown		
31	Chestnut	2	*	Yes					0	0	1						inspection -see click fix	2	Pruning				Unknown		
102	Columbus Ave	1	*	No					0	0	1						Possible area to plant	3	Plant				Unknown		
3	Columbus Square	1	*	Stump	Elm	Ulmus	americana		0	0	2						Opposite #2 two stumps in is.; replant Elm	2	Stump	checked 4-16:			Unknown		
2	Columbus Square	1	*	Stump	Elm	Ulmus	americana		15	0	2						stump; plant elm in is.	2	Stump	checked 4-16;			Unknown		
90	Congress Street	1	*	Stump					8	0	1						stump	2	Stump				Unknown		
65	Congress Street	1	*	Yes	London Plane	Platanus	acerifolia		0	0	6						Low prune 6 tree	2	Pruning				Unknown		
79	Congress Street	1	*	No					0	0	1						Possible area to plant	3	Plant				Unknown		
94	Congress Street	1	*	Yes					8	0	1						remove 2 trees	2	Removal				Unknown		
3	Cressy Ave	6	*	No	Quanzan Cherry	Prunus	serrulata		0	0	1						Quanzan cherry	2	Plant				Unknown		
16	Cross	2	*	No					0	0	1						open pit on Saudners	3	Open pit				Unknown		
3	Cross St Ct	2	*	Yes	Black Locust				40	0	1						opposite #3 removal	1	Removal	:heck Assesso			Unknown		
3	Dalton pkwy	3	*	No					0	0	1						open area to plant	3	Plant				Unknown		
18	Dalton pkwy	3	*	Yes	Chanticlear Pear	Pyrus	calleryana		10	0	5						low prune 5 trees	2	Pruning				Unknown		
17	Dalton pkwy	3	*	Yes					0	0	1						Removal	1	Removal	checked 3-16;			Unknown		
22	Dearborn	6	*	Yes	Maple	Acer			24	0	1						Remove large stubs, possible total removal	2	Pruning				Unknown		
0	Dearborn	6	*	Yes					0	0	1						Large leader needs removal (pic)	1	Pruning				Unknown		
97	Derby	1	*	Yes	Maple	Acer			12	0	1						Branch dead overhanging street	1	Pruning				Unknown		
100	Derby	1	*	No					0	0	2						2 open pits near 100 Derby FILL	1	Open pit-fill				Unknown		
109	Derby	1	*	Yes	Chanticlear Pear	Pyrus	calleryana		8	0	1						Low pruning and cut back at least 12-18"" from house	1	Pruning				Unknown		

Street Number	Street Name	Ward	ID	Tree Present	Name	Genus	Species	Photo Link	Diameter	Height	Quantity	Condition	Trunk Injury	Surrounding Sidewalk Material	Sidewalk Condition	Wires	Comments	Priority	Resolution	Action Taken	Land Use	Owner	Install Date	Last Update	Last Editor
126	Derby	1	*	No					0	0	1						Open pit	2	Open pit				Unknown		
10	Dow	1	*	No					0	0	1						open pit	2	Open pit				Unknown		
17	Dow	1	*	Yes					0	0	1						inspection -see click fix	2	Pruning				Unknown		
43	Dow	1	*	Yes					0	0	1						on corner of Park St	1	Removal	checked 4-16;			Unknown		
40	Dow	1	*	No					0	0	3						Three empty pits	3	Open pit				Unknown		
11	Dunlap	6	*	No					0	0	1						open tree lawn 2 trees	3	Plant				Unknown		
19	Dunlap	6	*	Yes	Linden	Tilla	americana		12	0	1						low prune over sidewalk	2	Pruning				Unknown		
0	Dunlap	6	*	Yes					24	0	2						Removal	1	Removal	checked 3-16;			Unknown		
31	Dunlap	6	*	Yes	Sugar Maple	Acer	saccharium		48	0	1						deadwood possible removal	1	Pruning				Unknown		
43	Dunlap	6	*	Yes					0	0	1						5''' dead leader over street	1	Pruning				Unknown		
44	Dunlap	6	*	No					0	0	1						Open pit	3	Open pit				Unknown		
0	Dunlap	6	*	No					0	0	1						open tree lawn - 4 trees	3	Plant				Unknown		
51	Dunlap	6	*	Yes					0	0	1						small broken branch over sidewalk	2	Pruning				Unknown		
59	Dunlap	6	*	No					0	0	0						open tree lawn	3	Plant				Unknown		
9	Dunlap	6	*	No					0	0	1						open pit	3	Open pit				Unknown		
19	East Collins	2	*	Yes					0	0	1						Deadwood	3	Pruning				Unknown		
17	Eden	5	*	Yes					0	0	1						inspection -see click fix	2	Pruning				Unknown		
4	Elm Ave	7	*	Yes	Honey Locust	Gleditsia	triacanthos		8	0	1						remove and replant Locust	2	Removal				Unknown		
6	Elm Ave	7	*	Yes	Maple	Acer			28	0	1						Removal; replant Locust	2	Removal	checked 3-16;			Unknown		
61	Endicott	3	*	No					0	0	1						open space for tree	3	Plant				Unknown		
1	English	1	*	Yes					0	0	2						Low pruning needed on 2 trees near Essex	2	Pruning				Unknown		
14	English	1	*	No	Japanese Tree Lilac	Syringa	reticulata		0	0	1						japanese tree lilac	2	Plant				Unknown		
34	English	1	*	No					0	0	1						Open pit	2	Open pit				Unknown		
360	Essex Street	1	*	Stump					14	0	1							2	Stump				Unknown		
12	Essex Street	1	*	Yes					0	0	1						deadwood	2	Pruning				Unknown		
290	Essex Street	2	*	No					0	0	1						Open pit	3	Open pit				Unknown		
294	Essex Street	2	*	No					0	0	1						Open pit	3	Open pit				Unknown		
232	Essex Street	2	*	Yes					16	0	1						tree on Washington St next to coffee shop	2	Removal	checked 4-16;			Unknown		
393	Essex Street	2	*	No					0	0	1						Open pit	3	Open pit				Unknown		
150	Essex Street Mall	2	*	Stump					0	0	1						inspection -see click fix	2	Stump				Unknown		
9	Everett	6	*	Stump	Japanese Tree Lilac	Syringa	reticulata		5	0	1						Stump;replant JTL	2	Stump	checked 4-16;			Unknown		
1	Everett	6	*	No	Honey Locust	Gleditsia	triacanthos		0	0	1						Locust	2	Plant				Unknown		
4	Everett	6	*	No	Japanese Tree Lilac	Syringa	reticulata		0	0	1						japanese tree lilac	2	Plant				Unknown		
2	Fairfield	5	*	No					0	0	1						Possible planting area	3	Plant				Unknown		
10	Fairmont	6	*	Yes	Norway Maple	Acer	platanoides		12	0	1						deadwood	1	Pruning				Unknown		
21	Fairmont	6	*	No					0	0	1						open pit on Nursery	3	Open pit				Unknown		
28	Federal-	2	*	No					0	0	2						2 open pits at 28B and 28C	3	Open pit				Unknown		
121	Federal-	2	*	Yes	Linden	Tilla	americana		0	0	1						sucker growth	2	Pruning				Unknown		
142	Federal-	2	*	Yes	Horse Chestnut	Castanea	dentate		0	0	1						deadwood	2	Pruning				Unknown		
172	Federal- Street	2	*	Stump					12	0	1						stump	2	Stump				Unknown		
35	Felt	6	*	Yes					0	0	1						inspection -see click fix	2	Pruning				Unknown		
23	Felt	6	*	No					0	0	1						Open tree lawn	3	Plant				Unknown		
54	Forrester	2	*	No					0	0	2						Open tree pits	3	Open pit				Unknown		
21	Forrester	2	*	Yes	Maple	Acer			24	0	1						deadwood	2	Pruning				Unknown		
24	Forrester	2	*	Yes	Pear				10	0	1						low prune	2	Pruning				Unknown		
135	Fort	1	*	Yes	Cherry	Prunus			0	0	2						opposite 135 cherry trees	1	Removal	checked 4-16;			Unknown		
26	Gardner	5	*	Stump					0	0	1							2	Stump				Unknown		
16	Gardner	5	*	Yes					0	0	1						inspection -see click fix	2	Pruning				Unknown		
22	Gardner	5	*	No					0	0	1						Open pit on Cabot; contract	3	Open pit				Unknown		
16	Gardner	5	*	Yes					0	0	1						inspection -see click fix	2	Pruning				Unknown		
20	Gedney	2	*	Yes					0	0	4						inspection -see click fix	2	Pruning				Unknown		
24	Goodell	6	*	Yes	Ash	Fraxinus			0	0	1						sucker growth	3	Pruning				Unknown		
7	Goodell	6	*	No					0	0	1						open pit	3	Open pit				Unknown		
5	Green	5	*	Yes					0	0	1						corner of Eden large cavity	1	Removal	checked 4-16;			Unknown		
15	Grove	6	*	Yes	Linden	Tilla	americana		0	0	1						low prune and sucker growth	2	Pruning				Unknown		
13	Hancock	5	*	No					0	0	1						Open pit	3	Open pit				Unknown		
21	Hancock	5	*	No					0	0	1						Open pit	3	Open pit				Unknown		
43	Hancock	5	*	Yes					0	0	1							1	Removal	checked 4-16;			Unknown		
0	Hanson	4	*	No					0	0	2						corner of Putnam	2	Open pit				Unknown		
38	Harbor	1	*	No					0	0	1						Open pit	2	Open pit				Unknown		
57	Harbor	1	*	Yes	Maple	Acer			6	0	1						Removal	1	Removal	checked 4-16;			Unknown		
71	Harbor	1	*	No					0	0	1						Open pit	2	Open pit				Unknown		
80	Hathorne Street	3	*	Stump					20	0	1						stump	2	Stump				Unknown		
1	Hayes Road	7	*	Yes					20	0	1						removal (pic)	1	Removal	checked 3-16;			Unknown		
13	Hayes Road	7	*	Yes					0	0	1						Remove leader over street	1	Pruning				Unknown		
3	Hayes Road	7	*	Yes					14	0	1						removal	1	Removal	checked 3-16;			Unknown		
6	Hayes Road	7	*	No	Japanese Tree Lilac	Syringa	reticulata		0	0	1						replant JTL	3	Plant				Unknown		
2	Hazel	5	*	No					0	0	2						Open pit	3	Open pit				Unknown		
30	Hazel	5	*	No					0	0	1						Open pit; do not replant	3	Open pit				Unknown		
32	Hazel	5	*	Yes					3	0	1						removal	2	Removal	checked 4-16;			Unknown		
56	Highland Ave	3	*	Stump					12	0	1						Opposite #56 at Hospital -replace	2	Stump				Unknown		
140	Highland Ave	4	*	Stump	Red Maple	Acer	rubrum		10	0	1						stump; replant columnar red maple	2	Stump				Unknown		
30	Highland Ave	4	*	Stump	Japanese Tree Lilac	Syringa	reticulata		8	0	1						Stump;replant JTL	2	Stump				Unknown		
5	Home Street	4	*	Stump					32	0	1							2	Stump				Unknown		
0	Howard St. Cemetery	2	*	Yes					0	0	3						Dead trees, deadwood throughout	2	Removal				Unknown		
0	Intervale	7	*	Stump					35	0	1						2 stumps at Cedarview	3	Stump				Unknown		
10	Irving	6	*	Yes	Maple	Acer			12	0	1						Removal	1	Removal	checked 3-16;			Unknown		
21	Jackson	3	*	No					0	0	1						open area to plant	3	Plant				Unknown		
193	Jefferson	3	*	Yes					14	0	1						remove - marked	1	Removal	checked 4-16;			Unknown		
235	Jefferson	3	*	Yes	Maple	Acer			22	0	1						Consider removal - pic	2	Removal	checked 4-16;			Unknown		
256	Jefferson	3	*	No					0	0	1						Open pit - fill	2	Open pit-fill				Unknown		

Street Number	Street Name	Ward	ID	Tree Present	Name	Genus	Species	Photo Link	Diameter	Height	Quantity	Condition	Trunk Injury	Surrounding Sidewalk Material	Sidewalk Condition	Wires	Comments	Priority	Resolution	Action Taken	Land Use	Owner	Install Date	Last Update	Last Editor
291	Jefferson	3	*	No					0	0	1						Open pit	2	Open pit				Unknown		
323	Jefferson	5	*	No					0	0	1						Open pit	2	Open pit				Unknown		
404	Jefferson	7	*	No					0	0	1						Open pit	2	Open pit				Unknown		
406	Jefferson	7	*	No					0	0	1						Open pit	2	Open pit				Unknown		
262	Lafayette	5	*	Stump	Quanzan Cherry	Prunus	serrulata		0	0	1						stump;no replant	2	Stump	checked 4-16;			Unknown		
220	Lafayette	5	*	Stump					20	0	1						stump;replant Q Cherry	2	Stump	checked 4-16;			Unknown		
276	Lafayette	5	*	Stump					0	0	1							2	Stump				Unknown		
249	Lafayette	7	*	Stump					16	0	1						stump	2	Stump				Unknown		
254	Lafayette	7	*	Stump					12	0	1						stump	2	Stump				Unknown		
0	Lafayette	2	*	Yes	Maple	Acer			10	0	2						across from Station near Pizza Shop	3	Pruning				Unknown		
231	Lafayette	5	*	Yes	London Plane	Platanus	acerifolia		12	0	1						low prune	2	Pruning				Unknown		
233	Lafayette	5	*	Yes					10	0	1						removal	1	Removal	checked 4-16;			Unknown		
248	Lafayette	5	*	Yes					0	0	1						deadwood	2	Pruning				Unknown		
261	Lafayette	5	*	Yes					0	0	1						remove leader	2	Pruning				Unknown		
277	Lafayette	5	*	Yes					0	0	1						remove leader	1	Pruning				Unknown		
292	Lafayette	5	*	Yes	Maple	Acer			14	0	1						deadwood	2	Pruning				Unknown		
293	Lafayette	5	*	Yes					36	0	1						low prune	2	Pruning				Unknown		
312	Lafayette	5	*	Yes					0	0	1						deadwood	2	Pruning				Unknown		
320	Lafayette	5	*	Yes					0	0	1						low prune	2	Pruning				Unknown		
464	Lafayette	5	*	Yes					0	0	6						pruning along sea wall	2	Pruning				Unknown		
194	Lafayette	7	*	Yes	Maple	Acer			7	0	1						At Gardner	2	Removal	checked 4-14;			Unknown		
46	Lafayette Place	5	*	No	Eastern Redbud	Cercis	cercideae		0	0	1						Eastern Redbud	2	Plant				Unknown		
0	Lafayette Street	2	*	Stump					2	0	1						At side of Fire Station on Derby	2	Stump				Unknown		
156	Lafayette Street	7	*	Yes					3	0	1						Removal	3	Removal	checked 3-16;			Unknown		
164	Lafayette Street	7	*	No					0	0	1						Open pit	3	Open pit				Unknown		
176	Lafayette Street	7	*	No					0	0	1						Open pit	3	Open pit				Unknown		
284	Lafayette Street	7	*	Yes					0	0	1						Prune deadwood	2	Pruning				Unknown		
285	Lafayette Street	7	*	No					0	0	1						Open pit	3	Open pit				Unknown		
314	Lafayette Street	7	*	No					0	0	2						Plant	3	Plant				Unknown		
135	Lafayette Street	7	*	Yes	Sugar Maple	Acer	saccharium		26	0	1						opposite 135 @ park	1	Removal	checked 3-16;			Unknown		
2	Larkin Lane	1	*	Stump					12	0	1							2	Stump				Unknown		
12	Larkin Lane	1	*	Stump					12	0	1						stump	2	Stump				Unknown		
42	Leach	5	*	Stump					7	0	1							2	Stump				Unknown		
50	Leach	5	*	Stump					15	0	1							2	Stump				Unknown		
21	Leavitt	1	*	No					0	0	1						Open pit	2	Open pit				Unknown		
21	Lemon	2	*	No					0	0	1						open pit	3	Open pit				Unknown		
1	Lilian	7	*	Yes					0	0	1						Prune leader - no need to remove	1	Pruning				Unknown		
101	Linden	5	*	Stump					0	0	1							2	Stump				Unknown		
16	Linden	5	*	No					0	0	1						Open Pit on Laurel	3	Open pit				Unknown		
22	Linden	5	*	No					0	0	1						Open pit	3	Open pit				Unknown		
44	Linden	5	*	No					0	0	1						Open pit	3	Open pit				Unknown		
66	Linden	5	*	No					0	0	1						Open pit	3	Open pit				Unknown		
69	Linden	5	*	No					0	0	1						Open pit	3	Open pit				Unknown		
83	Linden	5	*	No					0	0	1						Open pit	3	Open pit				Unknown		
16	Linden Ave	7	*	No	Japanese Tree Lilac	Syringa	reticulata		0	0	1						japanese tree lilac	2	Plant				Unknown		
5	Linden Ave	7	*	Yes					12	0	1						Removal	2	Removal				Unknown		
34	Loring	5	*	Yes					0	0	1						large 7" stub	2	Pruning				Unknown		
461	Loring	7	*	No	Maple	Acer			0	0	1						Columnnar Maple	2	Plant				Unknown		
464	Loring	7	*	Yes	Silver Maple	Acer	saccharium		0	0	1						On Oakview prune sucker growth	2	Pruning				Unknown		
497	Loring	7	*	Yes	Norway Maple	Acer	platanoides		13	0	1						on Elm	1	Removal	checked 4-16;			Unknown		
94	Loring	7	*	No					0	0	1							2	Plant				Unknown		
410	Loring Avenue	7	*	Yes	Maple	Acer			20	0	1						Corner of Cedarview dead leader over street	1	Pruning				Unknown		
19	Manning	6	*	No	Red Maple	Acer	rubrum		0	0	1						columnnar red maple	2	Plant				Unknown		
1	Maple Ave	7	*	Yes	Maple	Acer			10	0	1						Removal (pic)	1	Removal	checked 4-16;			Unknown		
3	Maple Ave	7	*	Yes	Maple	Acer			15	0	1						Possible removal	2	Removal	checked 4-16;			Unknown		
0	Maple Ave	7	*	Yes	Maple	Acer			12	0	1						At Loring removal	2	Removal	checked 4-16;			Unknown		
0	March	2	*	Yes	Maple/Linden/Ash				0	0	19						Low pruning needed on multiple trees near start - blocking ped access	2	Pruning				Unknown		
114	Margin	3	*	Yes					18	0	1						removal	1	Removal	checked 4-16;			Unknown		
11	Mason	6	*	Yes	Quanzan Cherry	Prunus	serrulata		0	0	1						sucker growth	3	Pruning				Unknown		
20	Mason	6	*	No					0	0	1						open pit	3	Open pit				Unknown		
22	Mason	6	*	No					0	0	1						open pit	3	Open pit				Unknown		
25	Mason	6	*	No					0	0	1						open pit	3	Open pit				Unknown		
32	Mason	6	*	No					0	0	1						open pit on Barstow	3	Open pit				Unknown		
45	Mason	6	*	No					0	0	1						open pit - fill with asphalt	3	Open pit-fill				Unknown		
3	McKinley Road	7	*	Stump					10	0	1						stump	2	Stump				Unknown		
78	Memorial Drive	1	*	Stump	Red Maple	Acer	rubrum		14	0	1						stump; plant red maple	2	Stump	checked 4-16;			Unknown		
8	Memorial Drive	1	*	Yes	Maple	Acer			32	0	1						deadwood	1	Pruning				Unknown		
22	Memorial Drive	1	*	Yes	Maple	Acer			14	0	1						Removal	1	Removal				Unknown		
57	Memorial Drive	1	*	No	Japanese Tree Lilac	Syringa	reticulata		0	0	1						japanese tree lilac	2	Plant				Unknown		
1	Messervy	5	*	No	Red Maple	Acer	rubrum		0	0	1						replant columnnar red maple	2	Plant				Unknown		
1	Messervy	5	*	No					0	0	1						corner of Summit	3	Open pit				Unknown		
88	Moffatt	7	*	Stump					16	0	1						stump	2	Stump				Unknown		
68	Moffatt	7	*	Stump					12	0	1						redo	2	Stump	checked 4-16;			Unknown		
68	Moffatt	7	*	Yes	Maple	Acer			17	0	1						off Pershing	1	Removal	1 stump too			Unknown		
29	Mooney	4	*	Yes					0	0	1						inspection -see click fix	2	Removal				Unknown		
1	Mooney	6	*	Yes					12	0	2						opposite #1 - 2 trees remove; don't replace	2	Removal	checked 4-16;			Unknown		
5	Mooney	6	*	Yes					0	0	1						deadwood - possible removal (pic)	2	Pruning				Unknown		
50	Naumkeag Street	1	*	Stump					12	0	1						opposite #36	2	Stump				Unknown		
165	North Street	6	*	Stump					3	0	1							2	Stump	checked 4-16;			Unknown		
165	North Street	6	*	Stump	Japanese Tree Lilac	Syringa	reticulata		16	0	1						Stump; replant JTL	2	Stump	checked 4-16;			Unknown		
192	North Street	6	*	No					0	0	3						open area to plant	3	Plant				Unknown		

Street Number	Street Name	Ward	ID	Tree Present	Name	Genus	Species	Photo Link	Diameter	Height	Quantity	Condition	Trunk Injury	Surrounding Sidewalk Material	Sidewalk Condition	Wires	Comments	Priority	Resolution	Action Taken	Land Use	Owner	Install Date	Last Update	Last Editor
237	North Street	6	*	Yes	Maple	Acer			19	0	1						on Mooney; don't COT replace	2	Removal	checked 4-16;			Unknown		
99	North Street	6	*	Yes	Hedge Maple	Acer	campestre		0	0	1						on Mason - cut back from bldg	3	Pruning				Unknown		
5	North end	6	*	No					0	0	1						open pit	3	Open pit				Unknown		
0	North-end	6	*	Yes	Norway Maple	Acer	platanoides		8	0	1						removal	2	Removal	checked 4-16;			Unknown		
4	Northey	2	*	Yes					0	0	1						Significant woody sucker growth	1	Pruning				Unknown		
17	Northey	2	*	Yes	Maple	Acer			0	0	1						Large leader of maple needs removal - cavity	1	Pruning				Unknown		
19	Northey	2	*	Yes	Maple	Acer			12	0	1						cavity on leader	2	Pruning				Unknown		
20	Northey	2	*	No					0	0	1						open pit	2	Open pit				Unknown		
8	Northey	2	*	No					0	0	1						open pit	3	Open pit				Unknown		
11	Nursery	6	*	No					0	0	3						3 open pits 2 on King	3	Open pit				Unknown		
14	Nursery	6	*	No					0	0	1						open pit	3	Open pit				Unknown		
17	Nursery	6	*	No					0	0	1						opposite # 17	2	Open pit				Unknown		
23	Oakland	6	*	Yes					0	0	1						deadwood	2	Pruning				Unknown		
0	Oakland	6	*	No					0	0	0						open area to plant 5 trees	3	Plant				Unknown		
38	Oakland	6	*	No	Japanese Tree Lilac	Syringa	reticulata		0	0	1						japanese tree lilac	2	Plant				Unknown		
12	Oakview	7	*	No					0	0	1						Open Pit	3	Open pit				Unknown		
37	Ocean	5	*	Stump					0	0	1						inspection -see click fix	2	Stump				Unknown		
63	Ocean Ave	5	*	No					0	0	1						Open pit	3	Open pit				Unknown		
69	Ocean Ave	5	*	No					0	0	1						Open pit	3	Open pit				Unknown		
7	Ocean Ave	5	*	No					0	0	1						open pit	2	Open pit				Unknown		
168	Ocean Ave West	5	*	Yes					13	0	1						Removal	1	Removal	checked 3-16;			Unknown		
168	Ocean Ave West	5	*	No					0	0	1						Open area to plant	3	Plant				Unknown		
190	Ocean Ave West	5	*	No					0	0	1						Open area to plant	3	Plant				Unknown		
85	Ord	4	*	Yes	Maple	Acer			0	0	1						Opp. #86 Ord (pic)	1	Removal				Unknown		
86	Ord	4	*	Yes	Maple	Acer			0	0	1							2	Removal				Unknown		
88	Ord	4	*	Yes					0	0	1						deadwood	2	Pruning				Unknown		
74	Ord Street	4	*	Stump	Japanese Tree Lilac	Syringa	reticulata		0	0	1						stump;replace JTL	2	Stump				Unknown		
76	Ord Street	4	*	Stump					0	0	1							2	Stump				Unknown		
91	Ord Street	4	*	Stump					0	0	1							2	Stump				Unknown		
0	Ord Street	4	*	Stump					0	0	1						opp Shiliber	2	Stump				Unknown		
2	Orleans	4	*	Stump					0	0	1						inspection -see click fix	2	Stump				Unknown		
0	Orleans	4	*	Yes	Willow	Salix	babylonica		0	0	3						at corner of Marlborough	2	Pruning				Unknown		
52	Orne	6	*	No					0	0	1						on Orchard - open pit	3	Open pit				Unknown		
0	Osborne	6	*	Yes	Quanzan Cherry	Prunus	serrulata		0	0	1						prune back from house	2	Pruning				Unknown		
0	Osborne	6	*	Yes	Ash	Fraxinus			16	0	1						opposite Walter - prune	3	Pruning				Unknown		
19	Osgood	2	*	Yes					0	0	1						dead branch over st	1	Pruning				Unknown		
23	Osgood	2	*	Yes	Maple	Acer			24	0	1						large cavity over st	1	Removal	checked 4-16;			Unknown		
22	Park	1	*	Yes	Maple	Acer			18	0	1						On Dow - prune - cavity - may need take-down	2	Pruning				Unknown		
18	Peabody	1	*	Yes					0	0	3						Low prune 3 tree near Wendy's	1	Pruning				Unknown		
20	Perkins	1	*	No					0	0	1						adjacent to #20 and parking lot	2	Open pit				Unknown		
28	Perkins	1	*	Yes					16	0	1						high priority	1	Removal				Unknown		
35	Perkins	1	*	Yes	Maple	Acer			7	0	1						large cavities -pic	1	Removal	checked 4-16;			Unknown		
5	Peter Road	7	*	No	Japanese Tree Lilac	Syringa	reticulata		0	0	1						On Chandler Road;replant JTL	2	Plant				Unknown		
46	Phillips	6	*	Yes					28	0	1						removal	1	Removal	checked 3-16;			Unknown		
26	Pickman	7	*	Stump	Pear	Pyrus	calleryana		30	0	1						stump;replant col pear	2	Stump	checked 4-16;			Unknown		
24	Pickman	2	*	Yes					0	0	1						inspection -see click fix	2	Pruning				Unknown		
13	Pickman	2	*	No					0	0	0						opposite #13 - fill in open pit	3	Open pit-fill	fill in			Unknown		
21	Pleasant	2	*	Yes	Linden	Tilla	americana		0	0	1						Sucker growth and take back from house	2	Pruning				Unknown		
23	Pleasant	2	*	Yes					0	0	1						Significant woody sucker growth	2	Pruning				Unknown		
16	Pleasant	2	*	No	Japanese Tree Lilac	Syringa	reticulata		0	0	1						plant	2	Plant				Unknown		
26	Prince	1	*	No					0	0	1						open pit-replant	2	Plant				Unknown		
44	Prince	1	*	No	Japanese Tree Lilac	Syringa	reticulata		0	0	1						japanese tree lilac	2	Plant				Unknown		
46	Prince	1	*	No					0	0	2						open pits - fill	2	Open pit-fill				Unknown		
46	Prince	1	*	No	Japanese Tree Lilac	Syringa	reticulata		0	0	1						japanese tree lilac	2	Plant				Unknown		
5	Prince	1	*	Yes	Maple	Acer			0	0	2						Low prune	2	Pruning				Unknown		
0	Proctor	4	*	No					0	0	1						Open pit	3	Open pit				Unknown		
110	Rainbow Terrace	7	*	Yes	Oak	Quercus			35	0	1						Removal (pic)	2	Removal	checked 4-16;			Unknown		
7	Rand	6	*	Stump					12	0	1						stump	2	Stump				Unknown		
10	Rand	6	*	Stump					18	0	1						stump	2	Stump				Unknown		
1	Rand	6	*	Yes	Maple	Acer			18	0	1						Removal (pic)	2	Removal	checked 4-16;			Unknown		
23	Raymond Ave	7	*	Yes	Maple	Acer			12	0	1						remove deadwood	2	Pruning				Unknown		
36	Raymond Ave	7	*	No	Japanese Tree Lilac	Syringa	reticulata		0	0	1						Open pit; replant JTL	3	Open pit				Unknown		
42	Raymond Ave	7	*	No					0	0	1						Open pit	3	Open pit				Unknown		
44	Raymond Ave	7	*	No					0	0	1						Open pit	3	Open pit				Unknown		
26	Raymond Road	7	*	No					0	0	1						open pit	3	Open pit				Unknown		
48	Raymond Road	7	*	Yes	Maple	Acer			17	0	1						Possible removal (pic)	2	Removal	checked 4-16;			Unknown		
53	Raymond Road	7	*	Yes	Maple	Acer			18	0	1						removal	2	Removal				Unknown		
16	Rice	2	*	Yes	Chanticleer Pear	Pyrus	calleryana		8	0	1						Needs to be pruned back from house	2	Pruning				Unknown		
20	Rice	2	*	Yes	Sugar Maple	Acer	saccharium		36	0	1						Deadwood on large tree	3	Pruning	checked 4-8-;			Unknown		
4	Riverbank	7	*	No					0	0	2						open pits - fill	3	Open pit-fill				Unknown		
9	Roosevelt	6	*	Stump					10	0	1						Redo	2	Stump	checked 4-16;			Unknown		
19	Roslyn	5	*	Stump					3	0	1							2	Stump	checked 4-16;			Unknown		
12	Roslyn	5	*	No					0	0	1						Open pit	3	Open pit				Unknown		
2	Roslyn	5	*	No					0	0	2						Open pit	3	Open pit				Unknown		
4	Roslyn	5	*	No					0	0	1						Open Tree Lawn	3	Plant				Unknown		
14	Sable West	4	*	Yes	Pear				0	0	2						Low prune	2	Pruning				Unknown		
27	Salem	1	*	No					0	0	1						Open pit on Dow - no replacement	2	Open pit-fill				Unknown		
17	Salem	1	*	No					0	0	1						Open pit opposite #17	2	Open pit				Unknown		
18	Salem	1	*	Yes					20	0	1						25' stick	2	Removal				Unknown		
35	Salem	1	*	No					0	0	2						2 Open pits	2	Open pit				Unknown		
3	Salem	1	*	Yes					16	0	2						large stick plus 2nd tree	1	Removal				Unknown		

Street Number	Street Name	Ward	ID	Tree Present	Name	Genus	Species	Photo Link	Diameter	Height	Quantity	Condition	Trunk Injury	Surrounding Sidewalk Material	Sidewalk Condition	Wires	Comments	Priority	Resolution	Action Taken	Land Use	Owner	Install Date	Last Update	Last Editor
37	Salem	1	*	Yes					0	0	1						newly planted tree needs soil in pit	1	Pruning				Unknown		
9	Salem	1	*	No					0	0	1						Open pit opposite #9	2	Open pit				Unknown		
16	Saunders	1	*	Yes					0	0	1						inspection -see click fix	2	Pruning				Unknown		
18	Saunders	1	*	Yes					0	0	1						inspection -see click fix	2	Pruning				Unknown		
16	Saunders	2	*	No					0	0	1						open pit	3	Open pit				Unknown		
7	Savoy	5	*	Yes					0	0	1						inspection -see click fix	1	Removal				Unknown		
67	School	6	*	No					0	0	1						open pit	3	Open pit				Unknown		
6	South Pine	2	*	Yes					0	0	1						inspection -see click fix	2	Pruning				Unknown		
12	Summer Street	2	*	No					0	0	3						Three spaces in grass area could plant #12-#16	3	Plant				Unknown		
37	Summit Ave	5	*	Stump	Quanzan Cherry	Prunus	serrulata		30	0	1						stump:replant Q Cherry	2	Stump	checked 4-16;			Unknown		
9	Sunset	7	*	No					0	0	1						Open pit	3	Open pit				Unknown		
10	Surrey	7	*	Stump					0	0	1						stump	2	Stump				Unknown		
10	Surrey	7	*	No	Japanese Tree Lilac	Syringa	reticulata		0	0	1						japanese tree lilac	2	Plant				Unknown		
11	Surrey	7	*	No	Japanese Tree Lilac	Syringa	reticulata		0	0	1						japanese tree lilac	2	Plant				Unknown		
15	Surrey	7	*	No	Pear	Pyrus	calleryana		0	0	1						columnar pear	2	Plant				Unknown		
7	Surrey	7	*	Yes					0	0	1						Prune	3	Pruning				Unknown		
13	Thorndike	2	*	Yes	Maple	Acer			0	0	1						large tree removal pic 3, 4 and 5	1	Removal	checked 4-16;			Unknown		
39	Turner	1	*	No					0	0	2						empty pits - fill - no trees recommended	1	Open pit-fill				Unknown		
17	Turner	1	*	Yes	Oak	Quercus			12	0	1						low prune	2	Pruning				Unknown		
6	Vale	3	*	No					0	0	1						Open pit	2	Open pit				Unknown		
15	Victory	1	*	Yes	Maple	Acer			13	0	1						Remove - see picture	1	Removal	checked 4-16;			Unknown		
18	Vista	4	*	Yes					0	0	1						Stubs need to be removed from tree (pic)	2	Pruning				Unknown		
20	Vista	4	*	No					0	0	0						Opposite #20 room to plant	3	Plant				Unknown		
39	Walter	6	*	Yes	Large Maple	Acer			0	0	1						deadwood	2	Pruning				Unknown		
9	Ward	1	*	No					0	0	1						Open pit	2	Open pit				Unknown		
30	Ward	1	*	No					0	0	1						Opposite #30	2	Open pit				Unknown		
38	Ward	1	*	No					0	0	1						Open pit	2	Open pit				Unknown		
34	Ward Street	1	*	Stump					0	0	1						inspection -see click fix	2	Stump				Unknown		
30	Warren	2	*	No					0	0	1						open area to plant	3	Plant				Unknown		
38	Warren	2	*	No					0	0	1						open area to plant	3	Plant				Unknown		
43	Warren	2	*	Yes					0	0	1						deadwood	2	Pruning				Unknown		
35	Washington Sq	2	*	Yes					0	0	1						deadwood and hangers	2	Pruning				Unknown		
0	Webb-Tracey Walkway	2	*	Yes	Pine	Pinus			10	0	1						Pine tree needs to be removed	2	Removal	checked 4-16:			Unknown		
7	West Circle	5	*	Yes					0	0	1						inspection -see click fix	1	Pruning				Unknown		
71	Whalers Ln	3	*	Yes	Maple	Acer			5	0	1						Opposite #71/73 - severe cavity (pic)	1	Pruning				Unknown		
1	Wilfred	7	*	No	Hornbeam	Ostrya	virginiana		0	0	2						Hop Hornbean	2	Plant				Unknown		
2	Wilfred Terr	7	*	No	Japanese Tree Lilac	Syringa	reticulata		0	0	1						japanese tree lilac	2	Plant				Unknown		
17	Willow Ave	5	*	No	Pear	Pyrus	calleryana		0	0	1						replant col pear	2	Plant				Unknown		
41	Wilson	3	*	No					0	0	3						Possible area to plant three trees	3	Plant				Unknown		
58	Wilson	3	*	No					0	0	2						Possible area to plant two trees	3	Plant				Unknown		
66	Wilson	3	*	Yes					0	0	3						three trees need low pruning	2	Pruning				Unknown		
65	Wilson Street	3	*	Stump					12	0	1						Corner of Story - Remove and replace	2	Stump				Unknown		
22	Winter Street	2	*	Stump					40	0	1						stump	2	Stump				Unknown		
11	Winter Street	2	*	Yes	Maple	Acer			16	0	1						remove large branch with cavity	2	Pruning				Unknown		
12	Winter Street	2	*	No					0	0	1						open pit	3	Open pit				Unknown		
2	Winter Street	2	*	Yes					0	0	1						remove stubs and deadwood	2	Pruning				Unknown		
21	Winter Street	2	*	Yes	Maple	Acer			15	0	1						remove	1	Removal				Unknown		
22	Winter Street	2	*	No					0	0	1						Elm or Ginkgo	2	Plant				Unknown		
26	Winter Street	2	*	Yes	Maple	Acer			12	0	1						remove stubs and sign	2	Pruning				Unknown		
12	Winthrop	3	*	No					0	0	1						open space for tree	3	Plant				Unknown		
24	Winthrop	3	*	Yes					0	0	1						low pruning	1	Pruning				Unknown		
20	Winthrop	3	*	No					0	0	1						Open pit	3	Open pit				Unknown		


*Data collected from Tree Warden spreadsheet, full GPS data collection not completed



Attachment D

Tree Identification Key





Tree Identification Guide

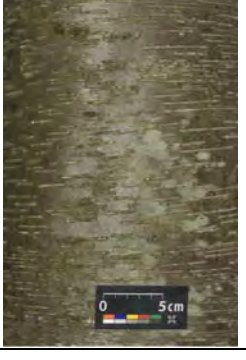Common Name	Scientific Name	Leaf	Bark
American Elm	<i>Ulmus Americana</i>		
Ash (Black)	<i>Fraxinus nigra</i>		
Ash (Green)	<i>Fraxinus pennsylvanica</i>		
Birch (Sweet)	<i>Betula lenta</i>		

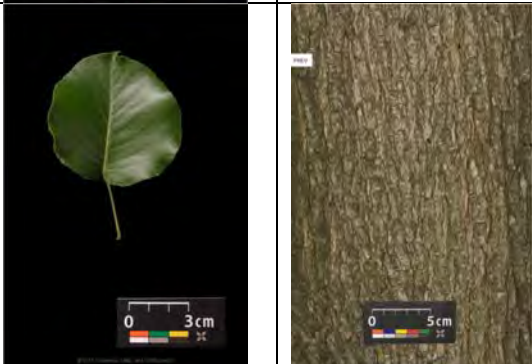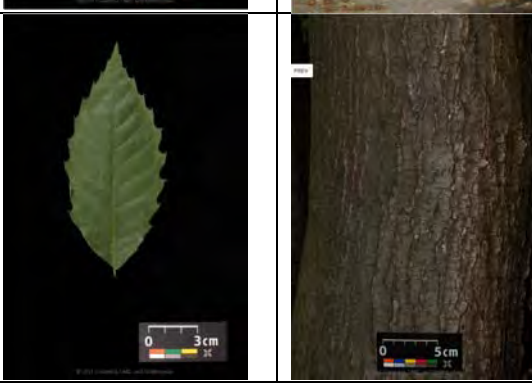Box Elder	<i>Acer negundo</i>	 Two photographs of Box Elder (<i>Acer negundo</i>). The left image shows a single, three-lobed green leaf against a black background, with a 3 cm scale bar below it. The right image shows a close-up of the tree's bark, which is deeply furrowed and textured, with a 5 cm scale bar below it.
Bradford Pear	<i>Pyrus calleryana</i>	 Two photographs of Bradford Pear (<i>Pyrus calleryana</i>). The left image shows a single, ovate green leaf with a smooth margin, set against a black background with a 3 cm scale bar. The right image shows the bark, which is finely textured and light brown, with a 5 cm scale bar.
Cherry (Higan)	<i>Prunus subhirtella</i>	 Two photographs of Cherry (Higan) (<i>Prunus subhirtella</i>). The left image shows a single, ovate green leaf with a serrated margin, against a black background with a 3 cm scale bar. The right image shows the bark, which is covered in numerous small, raised lenticels, with a 5 cm scale bar.
Chestnut	<i>Caastanea detate</i>	 Two photographs of Chestnut (<i>Caastanea detate</i>). The left image shows a single, ovate green leaf with a serrated margin, against a black background with a 3 cm scale bar. The right image shows the bark, which is dark and deeply furrowed, with a 5 cm scale bar.

Eastern Redbud	<i>Cercis canadensis</i>		
Ginkgo	<i>Ginkgo biloba</i>		
Hedge Maple	<i>Acer campestre</i>		
Honey Locust	<i>Gleditsia triacanthos</i>		

Hophornbeam	<i>Ostrya virginiana</i>		
Japanese Tree Lilac	<i>Syringa reticulata</i>		
Linden (American)	<i>Tilia americana</i>		
London Plane	<i>Platanus acerifolia</i>		

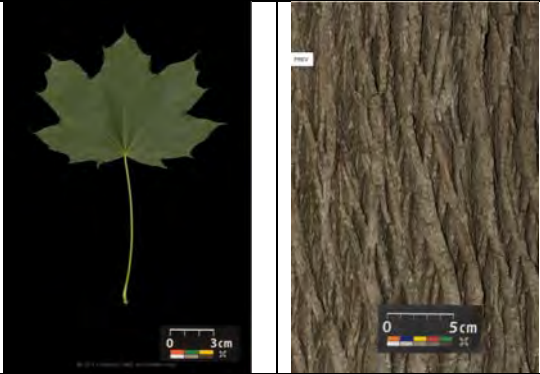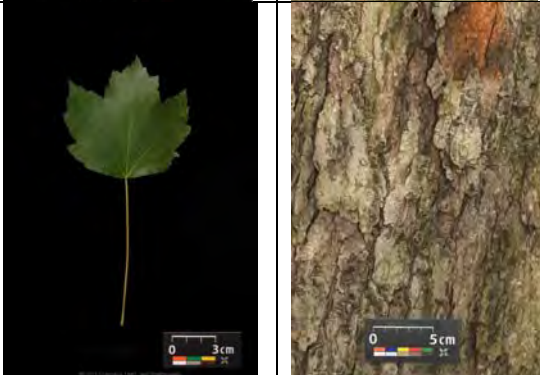Norway Maple	<i>Acer platanoides</i>	
Pin Oak	<i>Quercus palustris</i>	
Red Maple	<i>Acer rubrum</i>	
Red Oak	<i>Quercus rubra</i>	

Silver Maple	<i>Acer saccharum</i>		
Sugar Maple	<i>Acer saccharum</i>		
Weeping Willow	<i>Salix babylonica</i>		
White Pine	<i>Pinus strobus</i>		

Zelkova (Japanese)	<i>Zelkova serrata</i>		
Reference: Leafsnap.com			